



## Knowledge Base Article 84G8566353

### Issue

R7000 Off frequency adjustment.

### Resolution

The second local oscillator needs alignment. Align L39 coil on the PLL unit. Set the displayed frequency to 511.9999 MHz and adjust L39 coil for 768.0000 MHz at J6 test point on PLL unit. Icom recommends that the second local oscillator be checked on all of these units that are in need of repair.

### Category

Receivers : 3. Miscellaneous/FAQ's : Tabletop / PC Controlled : R7000