TECHNICAL MANUAL

MAINTENANCE INSTRUCTIONS WITH ILLUSTRATED PARTS BREAKDOWN DEPOT

RADIO FREQUENCY AMPLIFIER,

AM-7224/URC, P/N 10087-0000

HARRIS CORPORATION, RF COMMUNICATIONS GROUP FO4606-82-D-0079 FO9603-94-D-1349

> BASIC AND ALL CHANGES HAVE BEEN MERGED TO MAKE THIS A COMPLETE PUBLICATION

<u>DISTRIBUTION STATEMENT</u> – Distribution authorized to U.S. Government agencies only (Administrative or Operational Use) (15 August 1991). Questions concerning technical content should be directed to WR-ALC/LYRG. Other requests for this document shall be referred to WR-ALC/LYE, Robins AFB GA 31098.

<u>WARNING</u> – This document contains technical data whose export is restricted by the Arms Export Control Act (Title 22, U.S.C., Sec. 2751 et seq.) or the Export Administration Act of 1979, as amended (Title 50, U.S.C., App. 2401 et seq.). Violations of these export laws are subject to severe criminal penalties.

<u>HANDLING AND DESTRUCTION NOTICE</u> - Comply with distribution statement and destroy by any method that will prevent disclosure of the contents or reconstruction of the document.

PUBLISHED UNDER AUTHORITY OF THE SECRETARY OF THE AIR FORCE

LIST OF EFFECTIVE PAGES

INSERT LATEST CHANGED PAGES. DESTROY SUPERSEDED PAGES.

NOTE: The portion of the text affected by the changes is indicated by a vertical line in the margins of the page. Changes to illustrations are indicated by miniature pointing hands. Changes to wiring diagrams are indicated by shaded areas.

Dates of issue for original and changed pages are:

 Original
 0
 15 Jan 86

 Change
 1
 23 Mar 90

 Change
 2
 15 Aug 91

 Change
 3
 27 Mar 92

 Change
 4
 8 Nov 99

TOTAL NUMBER OF PAGES IN THIS PUBLICATION IS 150 CONSISTING OF THE FOLLOWING:

Page	*Change	Page	*Change	Page	*Change
No.	No.	No.	No.	No.	No.
Title. A	4 	FP-5			

^{*}Zero in this column indicates an original page

SAFETY SUMMARY

The following are general safety precautions that are not related to any specific procedures and therefore do not appear elsewhere in this publication. These are recommended precautions that personnel must understand and apply during many phases of operation and maintenance.

KEEP AWAY FROM LIVE CIRCUITS

Operating personnel must at all times observe all safety regulations. Do not replace components with the power supplies turned on. Under certain conditions, dangerous potentials may exist when the power control is in the off position, due to charges retained by capacitors. To avoid casualties, always remove power and discharge circuits to ground before touching any circuit components. Remove watches and rings before performing any maintenance procedures.

DO NOT SERVICE OR ADJUST ALONE

Under no circumstances should any person reach into or enter the enclosure for the purpose of servicing or adjusting the equipment except in the presence of someone who is capable of rendering aid.

RESUSCITATION

Personnel working with or near high voltages should be familiar with modern methods of resuscitation. Cardiopulmonary resuscitation procedures are outlined in T.O. 31-1-141-1, and annual refresher training requirements are outlined in AFOSH STD 127-50.

The following warnings appear in the text in this volume, and are repeated here for emphasis.

WARNING

Voltages dangerous to life exist in this radio equipment. Before removing the top cover, disconnect the primary power and wait 30 seconds. This allows time for all voltages to bleed off.

HANDLING OF ELECTROSTATIC DISCHARGE SENSITIVE DEVICES (EDSD)

Electrostatic Discharge Sensitive Devices (EDSD) must be handled with certain precautions that must be followed to minimize the effect of static build-up. Consult T.O. 00-25-234, DOD Std-1686, and DOD HDBK 263. EDSD devices are identified in this technical order by the following symbol:



TABLE OF CONTENTS

Section/Pa	ara	NOTE	Page	
		For chapters 1-5, see the On-Equipment Manual, T.O. 31R2-2URC-121.		
		CHAPTER 6. MAINTENANCE		
ł	INTRO	DUCTION		
	6-1.	Chapter Organization	6-1	
11	ALIGNI	MENT PROCEDURES		
	6-2. 6-3.	Introduction	6-1 6-2	
III	DIAGNOSTIC PROCEDURES			
	6-4. 6-5. 6-6. 6-7. 6-8. 6-9. 6-10. 6-11. 6-12. 6-13.	Depot Maintenance Philosophy Tube Assy, A1 Tank Assy, A2 VSWR/XFMR PWB Assy, A3 Fan Inverter PWB Assy, A4 Power Control PWB Assy, A5 Micro Control PWB Assy, A6 Front Panel PWB Assy, A7A1 Temp Sensor PWB Assy, A8 Interconnect PWB Assy, A9 Low Pass Filter Assy, A10	6-11 6-11 6-12 6-15 6-17 6-17 6-20 6-23 6-25 6-27 6-28	
IV	REMO'	VAL/REPLACEMENT PROCEDURES		
	6-15.	Removal/Replacement Procedures	6-29	
APPENDIX			6-33	
		CHAPTER 7. ILLUSTRATED PARTS BREAKDOWN		
1	INTRO	DUCTION		
	7-1. 7-2. 7-3. 7-4. 7-5.	Purpose	7-1 7-1 7-1 7-1 7-1	
Įį	MAINT	ENANCE PARTS LIST		
111	NUMERICAL INDEX			
IV	REFERENCE DESIGNATOR INDEX			

CHAPTER 8. FOLDOUT DRAWINGS

LIST OF ILLUSTRATIONS

Figure		Page
	CHAPTER 6. MAINTENANCE	
6-1	1 KW LPA	6-3
6-2	VSWR/XFMR PWB Assy	6-5
6-3	Power Control PWB Assy	6-7
6-4	Temp Sensor PWB Assy	6-10
	CHAPTER 7. ILLUSTRATED PARTS BREAKDOWN	
7-1	1 KW LPA, AM-7224/URC, Front View	7-14
7-2	1 KW LPA, AM-7224/URC, Exploded View	7-16
7-3	Installation Kit for 1 KW LPA	7-18
7-4	Tube Assy, A1	7-20
7-5	Bias/Sample PWB Assy, A1A1	7-24
7-6	Tank Assy, A2, Exploded View	7-26
7-7	Tank Assy, A2, Bottom View	7-28
7-8	Tune Capacitor No. 1 Assy, A2A1	7-30
7-9	Tune Capacitor No. 2 Assy, A2A2	7-32
7-10	Load Capacitor No. 1 Assy, A2A3	7-34
7-11	Load Capacitor No. 2 Assy, A2A4	7-36
7-12	Coil PWB Assy, A2A5	7-38
7-13	Coil Drive Assy, A2A6	7-40
7-14	Servo/Bandswitch Drive PWB Assy, A2A7	7-42
7-15	VSWR/XFMR PWB Assy, A3	7-44
7-16	Fan Inverter PWB Assy, A4	7-48
7-17	Power Control PWB Assy, A5	7-50
7-18	Micro Control PWB Assy, A6	7-54
7-19	Front Panel PWB Assy, A7A1	7-58
7-20	Temp Sensor PWB Assy, A8	7-60
7-21	Interconnect PWB Assy, A9	7-62
7-22	Low Pass Filter PWB Assy, A10	7-64
7-23	Connector PWB Assy, A11	7-66
	CHAPTER 8. FOLDOUT DRAWINGS	
FO-1	Family Tree 1 KW LPA	FP-1 FP-3
FO-2	Interconnection Diagram	FP-7
FO-3	Tube PWB Assy, A1A1	FP-9
FO-4	Tank Assy, A2	FP-9 FP-11
FO-5	Servo/Bandswitch Drive PWB Assy, A2A7	
FO-6	VSWR/XFMR PWB Assy, A3	FP-13
FO-7	Fan Inverter PWB Assy, A4	FP-15
FO-8	Power Control PWB Assy, A5	FP-17
FO-9	Micro Control PWB Assy, A6	FP-25 FP-31
FO-10	Front Panel PWB Assy, A7A1	
FO-11	Interconnect PWB Assy, A9	FP-33

LIST OF TABLES

Table		Page
	CHAPTER 6. MAINTENANCE	
6-1	Test Equipment	6-2

GLOSSARY

A Ampere(s)

A/D Analog-to-Digital (Converter)

AFSK Audio frequency shift keying; a baseband modulation scheme in which two audio

frequencies are used to represent binary coded data; the frequency is shifted to one

frequency to represent a 1 (mark) and to the other to represent a 0 (space).

AGC Automatic gain control ALE Address latch enable

AM Amplitude modulation; a modulation scheme in which the carrier is made to vary in

amplitude in accordance with the modulating signal.

AME Amplitude modulation equivalent

ANTIVOX Prevents false VOX operation; see VOX

BFO Beat Frequency Oscillator, used in SSB detection circuits

BIT Built-in Test
BIU Bus interface unit
BW Bandwidth

CPU Central processing unit CREV Converter reverse

CW Continuous wave; a wave that does not vary in amplitude or frequency and is turned on

and off to carry intelligence, e.g., Morse Code

D/A Digital-to-Analog (Converter)

dB Decibel(s)

dBm Decibel(s) relative to one milliwatt
EMI Electromagnetic interference

EPROM Erasable programmable read-only memory

EU Execution unit

HF High frequency; a radio frequency band extending from about 3 MHz to 30 MHz; in this

manual, HF includes 1.6 to 30 MHz.

HV High voltage

IF Intermediate frequency
IM Intermodulation (distortion)

I/O Input/Output
KREV Keyer reverse
LCD Liquid crystal display
LED Light emitting diode
LPA Linear power amplifier

LSB Lower sideband; a modulation scheme in which the intelligence is carried on the first

sideband below the carrier frequency; see SSB

MIC Microphone mA Milliampere(s) mV Millivolt(s)

NBSV Narrow band secure voice
PEP Peak envelope power
PPC Peak power control
PWB Printed wiring board
RAM Random access memory

rms Root mean square RTC Real time clock

RX Receive

GLOSSARY (Continued)

S TONE Sidetone

SSB Single sideband; a modulation scheme in which the intelligence is carried by one of the

carrier sidebands, the other sideband and the carrier center frequency being suppressed

TGC Transmitter gain control

TX Transmit

uA Microampere(s) uP Microprocessor

USB Upper sideband; a modulation scheme in which the intelligence is carried on the first

sideband above the carrier frequency; see SSB

uV Microvolt(s)

Vac Volts, alternating current VCO Voltage controlled oscillator

Vdc Volts, direct current

VOX Voice operated transmission

VSWR Voltage standing wave ratio; the ratio of the maximum to the minimum voltage of a

standing wave on a radio frequency transmission line

W Watt(s)

INTRODUCTION

The purpose of this manual is to provide information necessary for the depot-level maintenance of Amplifier, Radio Frequency, AM-7224/URC, manufactured by the RF Communications Group of Harris Corporation, Rochester, New York. The manual is divided into three chapters. The contents of each chapter are briefly described in the following paragraphs.

NOTE

This manual only contains three chapters, because chapters 1-5 are contained in the On-Equipment Manual, T.O. 31R2-2URC-121. For a description of the contents of these chapters, see the INTRODUCTION in T.O. 31R2-2URC-121.

Chapter 6 describes the depot-level maintenance procedures. The maintenance procedures in this chapter are based on performance testing and trouble analysis of the subassembly or PWB to locate and replace faulty parts at the lowest replaceable unit level (LRU).

Chapter 7 contains the Illustrated Parts Breakdown (IPB) information at the depot level. This includes assemblies and parts that may be replaced at the depot location.

Chapter 8 contains foldout (FO) drawings, which consist of the schematic diagrams of all the PWB assemblies. A cross reference list is also provided. The diagrams are numbered FO-1, FO-2, etc. They are printed on sheets with page-size blank aprons to permit viewing the diagram with the rest of the book closed or opened to another page.

The following specifications, standards, and publications were used in the preparation of this manual.

APPLICABLE SPECIFICATIONS

SPECIFICATION	NAME
MIL-M-38798B, para. 3.4	Combined Operation and Maintenance Instructions Manual (Equipment).
MIL-M-38807, Amend. 4	Preparation of Illustrated Parts Breakdown.
MIL-M-38790 and MIL-M-38784A	General Requirements for Preparation of Technical Manuals.

APPLICABLE STANDARDS

STANDARD	NAME
MIL-STD-12	Abbreviations for use on Drawings and in Technical Type Publications.
MIL-STD-15-1A	Graphic Symbols for Electrical Components.
MIL-STD-17-1	Mechanical Symbols.
MIL-STD-806	Graphic Symbols for Logic Diagrams.

APPLICABLE PUBLICATIONS

PUBLICATION	NAME
DOD 5200.20	Distribution Statements on Technical Documents.
USAS Y14.15-1966	Electrical and Electronic Diagrams.
USAS Y32.16-1968	Electrical and Electronic Reference Designations.
T.O. 31-1-141 (Series)	Technical Manual-Basic Electronic Technology and Testing Practices.

CHAPTER 6

MAINTENANCE

WARNING

Voltages dangerous to life exist in this radio equipment. Before removing the top cover, disconnect the primary power and wait 30 seconds. This allows time for all voltages to bleed off.

Section I. INTRODUCTION

6-1. CHAPTER ORGANIZATION. This chapter is divided into four sections. Section I tells how the chapter is organized. Section II contains alignment procedures for the replaceable modules. This information is also contained in the On-Equipment Manual, T.O. 31R2-2URC-121, and is repeated here for convenience. Section III consists of diagnostic procedures which will enable you to

troubleshoot faulty modules to the component level. These procedures are based on use of the BIT feature. For more information on BIT, as well as removal/replacement procedures and periodic maintenance procedures, see the On-Equipment Manual, T.O. 31R2-2URC-121. Section IV contains removal/replacement procedures for the internal components of the Tank Assembly.

Section II. ALIGNMENT PROCEDURES

6-2. INTRODUCTION. This section contains instructions for checking and adjusting the replaceable subassemblies in the 1KW LPA. This section also contains circuit board layouts to help you

identify the components that can be adjusted. To do the procedures described in this section, you need the test equipment listed in Table 6-1.

Table 6-1. Test Equipment

Generic Name	Military Designation	Manufacturer, Model No.	National Stock No.	Required Range
Electronic Voltmeter w/ AC Probe & T-connector		Hewlett Packard, Model 410C Model 11036A Model 11042A	6625-00- 469-2258 6625-00- 910-5973 5985-00- 713-4356	20 to 224 V rms; 1.6 to 30 MHz (peak reading)
Digital Multimeter		Fluke, Model 8012A	6625-01- 140-0221	200 mV to 250 Vac; 200 mV to 40 Vdc; 0 to 20 megohms
PROM Programmer		Data I/O, Model System 19	7045-01- 115-8993	
Dummy Load		Bird, Model 8833	6625-00- 225-9074	1000 W, 50 ohms
1 KW LPA	AM-7224/URC	RF Communications RF-353	5820-01- 164-4871	
100 Watt Transceiver	RT 1446/URC	RF Communications RF-350K	5820-01- 162-3402	
Power Supply	PP-7913/URC	RF Communications RF-354	6130-01- 164-6580ZX	

NOTE: Equivalent Items Authorized

6-3. ALIGNMENT PROCEDURES

NOTE

After each of the following alignment procedures, disconnect test equipment and reconfigure equipment (module or circuit card) to normal operating condition.


a. TUBE ASSY, A1 (figure 6-1)

R3, RF Plate Sample Adjustment

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for a least 10 seconds.
- The LPA's AUTO/MANUAL BAND Switch is in the AUTO position.

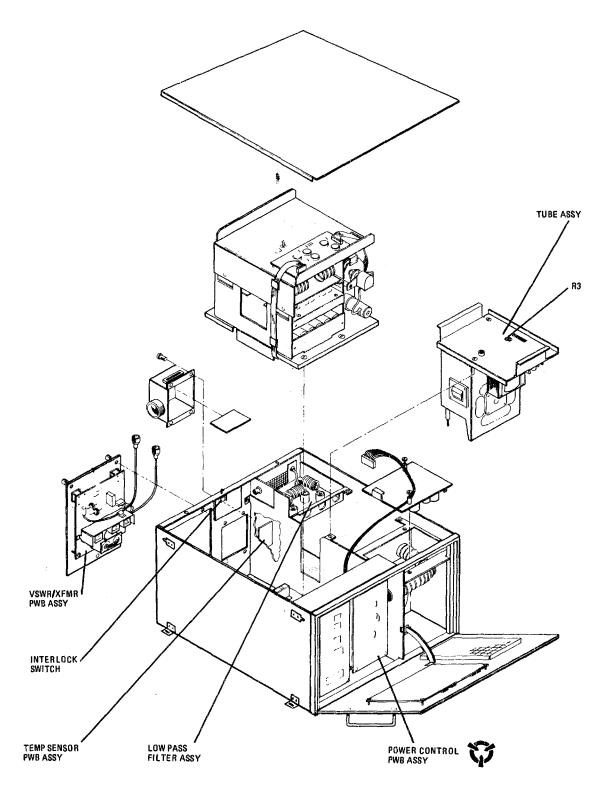

353-036

Figure 6-1. 1 KW LPA

- (1) Using a Model 11042A T-connector, connect an HP-410C Voltmeter (or equilvalent) between the LPA's RF output connector J5 and a dummy load.
- (2) Remove the top cover from the LPA, and pull the interlock switch all the way up to the "cheat" position.
- (3) Turn the LPA on and set the operating frequency at the transceiver to 7.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), place LPA IN OPERATE and tune the system.
- (4) Place the LPA in Manual mode with the AUTO/MANUAL BAND Switch in the 6-8 position. Set the ANTENNA Switch to the 50 ohm position and the LOCAL KEY Switch to CN. Key the transceiver, and monitor the voltage on the RF voltmeter.
- (5) With a reading of 223 ±2 Vac on the meter, adjust R3 (accessible through a hole in the Tube Assy near the connector--see figure 6-1) so that the RF PLATE (VOLTS) position on the LPA front panel meter reads 2100 ±20.
- (6) Return LOCAL KEY to OFF.
- b. TANK ASSY, A2

No adjustments.

c. VSWR/XFMR PWB ASSY, A3 (figure 6-2)

(1) R5, Null Adjustment

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for at least 10 seconds.
- The LPA'S AUTO/MANUAL BAND Switch is in the AUTO position.
 - (a) Connect the 1KW LPA antenna connector J5 to a dummy load.

- (b) Remove the top cover from the LPA, and pull the interlock switch all the way up to the "cheat" position.
- (c) Lower the LPA front panel to its horizontal position to gain access to the Power Control PWB Assy.
- (d) Connect a digital multimeter between test point TP2 and ground on the Power Control PWB Assy (see figure 6-3)
- (e) Turn the LPA on and set the operating frequency at the transceiver to 16.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), place the LPA in OPERATE and tune the system.
- (f) Key the system and adjust R5 (on the VSWR/XFMR PWB Assy -- see figure 6-2) for a null (minimum voltage) on the multimeter.

(2) R8, Forward Power Sample

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for at least 10 seconds.
- The LPA's AUTO/MANUAL BAND Switch is in the AUTO position.
 - (a) Using a Model 11042A T-connector and a Model 11036A AC Probe, connect an HP-410C Voltmeter (or equivalent) between the LPA's RF output connector J5 and a dummy load.
 - (b) Remove the top cover from the LPA, and pull the interlock switch all the way up to the "defeat" position.
 - (c) Lower the LPA front panel to its horizontal position to gain access to the Power Control PWB Assy.

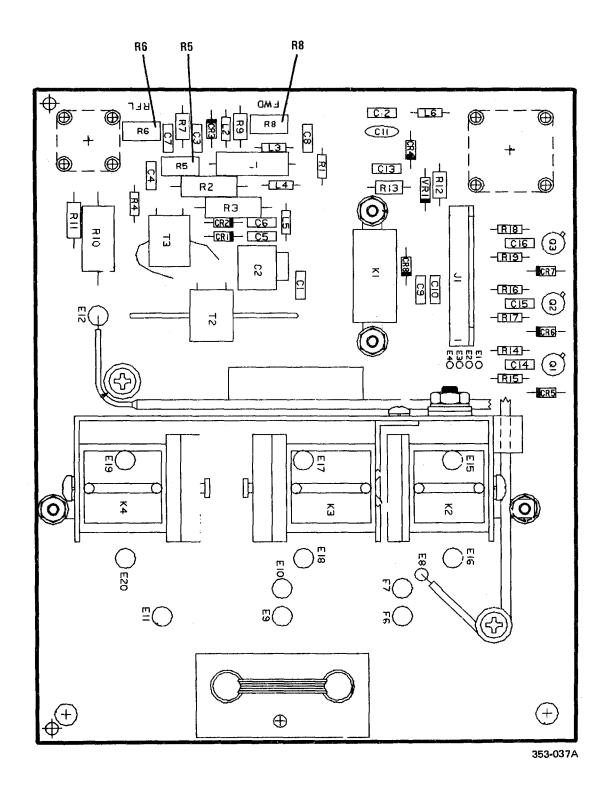


Figure 6-2. VSWR/XFMR PWB Assy

- (d) Connect a digital multimeter between test point TP1 and ground on the A5 Power Control PWB Assy (see figure 6-3). Ensure that R34 is fully CCW and R74 is fully CW.
- (e) Turn the LPA on and set the operating frequency at the transceiver to 16.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), place the LPA in OPERATE and tune the system.
- (f) Key the system and observe the output voltage on the HP-410C and the forward power sample voltage on the digital multimeter. The HP-410C should read 223 ± 2 Vac and the multimeter should read 7.00 \pm 0.05 Vdc.
- (g) If both readings are within tolerance, no adjustment is required. If either reading is out of tolerance, adjust Loop Gain Potentiometer R29 on the Power Control PWB Assy so that the HP-410C reads 223 Vac. If the multimeter reading is 7.00 ± 0.05 Vdc, no further adjustment is required.
- (h) If the multimeter reads less than 6.95 Vdc, adjust R29 on the Power Control PWB Assy for a reading of slightly less than 223 Vac on the HP-410C. Then adjust R8 on the VSWR/XFMR PWB Assy for a reading of 7 volts on the multimeter. Readjust R29 to increase the HP-410C reading toward 223 Vac. Continue to alternately adjust R29 toward 223 Vac and R8 toward 7 Vdc until the HP-410C reads 223 ±2 Vac and the multimeter reads 7.00 ± 0.05 Vdc.
- (i) If the multimeter reads more than 7.05 Vdc, adjust R8 on VSWR/XFMR PWB Assy for a reading of slightly less than 6.95 Vdc. Then adjust R29 on the Power Control PWB Assy for 223 Vac on the HP-410C. Readjust R8 toward 7 Vdc and R29 toward 223 Vac. Continue to alternately adjust R8 and R29 until the multimeter reads 7.00

 ± 0.05 Vdc and the HP-410C reads 223 ± 2 Vac.

(3) R6, Reflected Sample Adjustment

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for at least 10 seconds.
- The LPA's AUTO/MANUAL BAND Switch is in the AUTO position.
- R5 and R8 on the VSWR/XFMR PWB Assy are correctly adjusted.
 - (a) Connect the LPA's RF output connector J5 to a dummy load.
 - (b) Remove the top cover from the LPA, and pull the interlock switch all the way up to the "cheat" position.
 - (c) Lower the LPA front panel to its horizontal position to gain access to the Power Control PWB Assy.
 - (d) Connect a digital multimeter between test points TP1 and TP2 on the A5 Power Control PWB Assy (see figure 6-3).
 - (e) Turn the LPA on and set the operating frequency at the transceiver to 16.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), place the LPA in OPERATE and tune the system.
 - (f) Unkey the system if keyed and disconnect the dummy load from the J5 antenna connector.
 - (g) Key the system, and adjust R6 for 0.00 ±0.05 Vdc on the digital multimeter.
- d. FAN INVERTER PWB ASSY, A4

No adjustments.

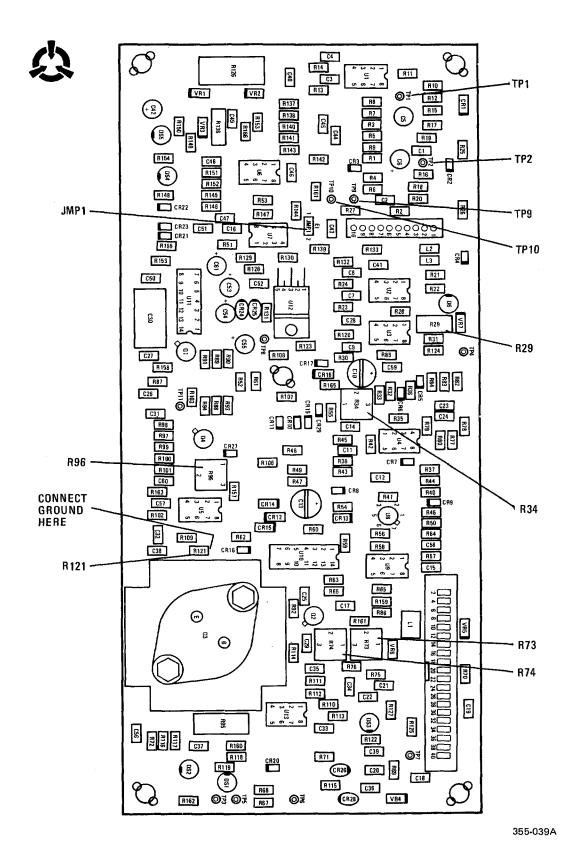


Figure 6-3. Power Control PWB Assy

e. POWER CONTROL PWB ASSY, A5 (figure 6-3)

(1) R29, Loop Gain Control

NOTE

To adjust R29, perform the Forward Power Sample adjustment, as described in c (2) above. The two adjustments are interactive.

(2) R34, CW/FSK Power Adjustment

This adjustment is normally set fully counterclockwise in the 1 KW LPA. If reduced power is required in the CW or FSK mode, then the required reduced power output may be obtained by adjusting R34 in a clockwise direction during normal operation.

(3) R73, Coupler Tune Power Adjustment

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for at least 10 seconds.
- The LPA's AUTO/MANUAL BAND Switch is in the AUTO position.
- R5, R6, and R8 on the VSWR/XFMR PWB Assy are correctly adjusted.
 - (a) Connect the LPA's RF output connector J5 to a dummy load.
 - (b) Lower the LPA front panel to its horizontal position in order to gain access to the Power Control PWB Assy.
 - (c) Turn the LPA on and set the operating frequency at the transceiver to 16.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), place the LPA in OPERATE and tune the system.

- (d) Connect a ground to the J1-5 side of R121 on the Power Control PWB Assy (see figure 6-3). This will place the Power Control PWB Assy into the coupler tune mode.
- (e) Set the LPA meter select switch on the front panel to the FWD PWR (WATTS) position and key the system. Adjust F73 on the Power Control PWB Assy for 200 watts on the front panel meter.
- (f) Unkey the system and remove the ground from R121.

(4) R74, Power Control Adjustment.

This potentiometer is normally set fully clockwise. If reduced output power is required in all modes, then this is accomplished by adjusting R74 counterclockwise until the desired output power is attained.

(5) R96, Max Plate Current Adjustment

NOTE

This adjustment assumes the following initial conditions:

- The LPA has been turned off for at least 10 seconds.
- The LPA's AUTO/MANUAL BAND Switch is in the AUTO position.
- R5, R6, and R8 on the VSWR/XFMR PWB Assy are correctly adjusted.
 - (a) Connect the LPA's RF output connector J5 to a dummy load.
 - (b) Lower the LPA front panel to its horizontal position in order to gain access to the Power Control PWB Assy.
 - (c) Turn the LPA on and set the operating frequency at the transceiver to 16.0000 MHz in CW mode. After the LPA has warmed up (is in STANDBY), set the

LPA's AUTO/MANUAL BAND Switch to the 16-24 position.

- (d) Set the TUNE PWR Switch to the ON position, and set the METER Switch to the $I_{\mbox{\scriptsize K}}$ (mA) position.
- (e) Adjust R96 on the PWB Assy for 400 ±8 on the front panel meter.
- f. MICRO CONTROL PWB ASSY, A6

No adjustments.

g. FRONT PANEL PWB ASSY, A7A1

No adjustments.

h. TEMP SENSOR PWB ASSY, A8 (figure 6-4).

NOTE

This adjustment can be performed on a "cold" LPA (one that has been turned off for at least 15 minutes) or a "hot" LPA (one that has been turned on for more than 10 seconds). If you remove the JMP1 jumper (on the Power Control PWB Assy) from a cold LPA, you can begin the adjustment procedure immediately (as soon as you turn the LPA on). However, if you remove the jumper from an LPA that has been on for

more than 10 seconds, then you should allow 15 minutes for the temperature sensors to stabilize at ambient before doing the adjustment.

- Lower the LPA front panel to its horizontal position to gain access to the Power Control PWB Assy.
- (2) Remove JMP1 (PN65474-001) on the Power Control PWB Assy (see figure 6-3).
- (3) With the LPA in warmup (for a cold LPA) or standby (for a hot LPA), connect a digital multimeter between test points TP9 and TP10 on the Power Control PWB Assy.
- (4) If the voltage on the multimeter is 0± 2 mV, no adjustment is necessary. If not, adjust R2 (R2 is accessible through the rear grille of the LPA--see figure 6-4) until the voltage is within the limits.
- (5) Re-install JMP1 on the Power Control PWB Assy.
- i. INTERCONNECT PWB ASSY, A9

No adjustments.

j. LOW PASS FILTER ASSY, A10

No adjustments.

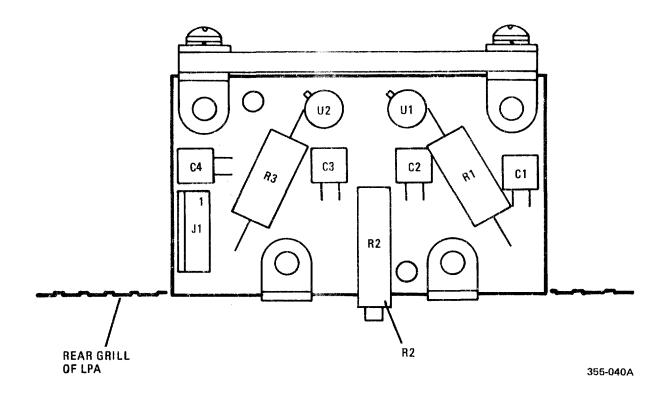


Figure 6-4. Temp Sensor PWB Assy

MAINTENANCE

Section III. DIAGNOSTIC PROCEDURES

6-4. DEPOT MAINTENANCE PHILO-SOPHY. The maintenance procedures presented in this chapter assume that equipment problems have already been isolated to one of the replaceable subassemblies listed below. This has been accomplished in the field using the BIT (Built-In Test) troubleshooting approach. (For a detailed description of BIT, see Chapter 6 in the On-Equipment Manual for the 1 KW Linear Power Amplifier, T.O. 31R2-2URC-121). As a depot maintenance technician, your job is to take these defective subassemblies returned from the field, swap them with known good subassemblies in a properly functioning 1 KW Linear Power Amplifier (the "test bed"), and troubleshoot the defective subassemblies to the component level. Once you have identified and replaced the faulty component (resistor, capacitor, transistor, etc.), you will then perform whatever adjustment or alignment procedures are required to restore the subassembly to peak operating condition. To accomplish these tasks, you will need the procedures contained in this chapter, a complete set of schematics (in Chapter 8 of this manual), and the test equipment listed in Table 6-1. Also, refer to Appendix B for front panel meter functions and normal operating ranges. The following is a list of the subassemblies covered in Section III:

SUBASSEMBLY	PARAGRAPH
Tube Assy, A1	6-5
Tank Assy, A2	6-6
VSWR/XFMR PWB Assy, A3	6-7
Fan Inverter PWB Assy, A4	6-8
Power Control PWB Assy, A5	6-9
Micro Control PWB Assy, A6	6-10
Front Panel PWB Assy, A7A1	6-11
Temp Sensor PWB Assy, A8	6-12
Interconnect PWB Assy, A9	6-13
Low Pass Filter Assy, A10	6-14

6-5. TUBE ASSY, A1.

- a. Preliminary Procedure.
 - (1) Remove the good Tube Assy from the testbed 1 KW Linear Power Amplifier, and replace it with the faulty Tube Assy.

- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
- (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.)
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in troubleshooting the Tube Assy. Refer to the section corresponding to the fault code you get. In the event that the test runs without generating a fault code, refer to the "Additional Symptoms" section following the fault code discussions. If your problem is not covered there, start at the beginning of the following procedures and work your way through to the end.

CODE 8

This fault code indicates that with the LPA in STANDBY, the DC plate voltage is greater than +100 Vdc.

The most probable cause of this fault code is an open R2, which prevents the DC plate sample from discharging quickly enough after the LPA is switched back to STANDBY from OPERATE.

CODE 9

This fault code indicates that the DC plate voltage is not between 2000 and 5000 Vdc when the 1 KW LPA is put into OPERATE.

If the Tube Assy is known to be bad and this fault code occurs, it means that there is probably an open in the Tube Assy's B+ line. With power off and all voltages discharged, remove the faulty

Tube Assy from the test bed and take resistance measurements to determine the cause of the open.

CODE 11

This fault code indicates that when the 1 KW LPA is put into OPERATE and the bias is turned on, the DC plate current is not between 20 and 150 mA.

With power off and all voltages discharged, remove the faulty Tube Assy from the test bed. Using an ohmmeter, do the following:

- (1) Check for continuity in the bias line between pins 4 and 5 of J1 and the cathode of the tube.
- (2) Check for continuity between the tube grid and ground.
- (3) Check for continuity in the filament line on both sides of the filament transformer T1.
- (4) Check for an open in the plate circuit between the tube anode and the DC plate sample circuit (R1 etc.).

If the above circuitry checks good, replace the tube.

CODE 14

This fault code indicates that although the plate voltage, bias, and RF drive from the transceiver is within tolerance, the plate current is not between 325 and 480 mA.

With power off and all voltages discharged, remove the faulty Tube Assy from the test bed. Using an ohmmeter, look for a problem in the RF input circuit between J1-9 and C1. If the RF input circuitry checks good, replace the tube.

CODE 15

This fault code indicates that although the plate current is within tolerance for the RF drive at the cathode, the microprocessor was unable to find a tune peak.

With power off and all voltages discharged, remove the faulty Tube Assy from the test bed.

Using an ohmmeter, check for a problem in the RF plate sample circuit (from C2 to J1-3). You might also check the adjustment of potentiometer R3. See the alignment procedures in Section II of this chapter.

CODE 18

This fault code indicates that the ratio of forward power to RF input power is not between 5 and 60.

With power off and all voltages discharged, remove the faulty Tube Assy from the test bed. Using an ohmmeter, do the following:

- (1) Check for a problem with the output coupling capacitor C4.
- (2) Check the continuity of the RF signal path from C4 to the output tab.
- (3) Check for a problem with load inductor L1.
- (4) If all the above components check good, replace the tube.

ADDITIONAL SYMPTOMS

High-voltage circuit breakers on the 1 KW Power Supply pop when the LPA is switched to OPERATE.

Since the Tube Assy is known to be bad, it means that there is probably a short on the Tube Assy's B+ line. With power off and all voltages discharged, remove the faulty Tube Assy from the test bed and take resistance measurements to determine the cause of the short.

6-6. TANK ASSY, A2.

a. Preliminary Procedure.

- (1) Remove the good Tank Assy from the testbed 1 KW Linear Power Amplifier, and replace it with the faulty Tank Assy.
- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.

- (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter).
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in troubleshooting the Tank Assy. Refer to the section corresponding to the fault oc le you get. In the event that the test runs without generating a fault code, start at the beginning of the following procedures and work your way through to the end.

CODE 4

This fault code indicates that the +13.5 Vdc, as measured at the input to the Micro Control PWB Assy, is not within the normal operating range (+10 to +16 Vdc).

Since the Tank Assy is known to be faulty, the problem is most likely a short on the Tank Assy's +13.5 V line or a short in one of the motors. Since this is a run-time fault (the FAULT light comes on whenever the +13.5 V supply is out of range for more than 3 seconds), you can easily determine whether the problem is in the supply line or in one of the motors:

- (1) If the fault occurs as soon as you turn the equipment on, the problem is in the +13.5 Vdc line.
- (2) If the fault occurs only during band selection, the problem is in the band switch drive motor.
- (3) If the fault occurs only during coil positioning, the problem is in the coil drive motor.

CODE 6

This fault code indicates either that the band switch did not turn or that it did not reach the specified band within 10 seconds.

The problem could be in the following areas:

(1) The Band Switch Motor. Check it as follows:

- (a) Check to see whether the motor turns when you change bands in manual mode. If not, check TP14 on the Servo/Band Switch Drive PWB Assy for approximately +13 Vdc. If the voltage is good, check to see whether the problem is in the motor cable or the motor itself. If the voltage at TP14 is bad, check for approximately +2.5 to +5.0 Vdc at TP15. If TP15 is good, the problem must be Q10, Q11, or one of their associated components. Or there might be an open in the +13.5 V line. If TP15 is bad, the problem could be in the band selection circuitry (see paragraph 2 below), the band switch, or the connector (P1/J3).
- (b) If the motor does turn, check to see whether it turns fast enough (in other words, see if there is any mechanical binding which is slowing it down). If the motor appears to be turning freely, see if it stops within 10 seconds. If the motor does not stop within 10 seconds and does not appear to have any mechanical binding, look for a problem with the band switch or the band selection circuitry (see paragraph 2 below).
- (2) The band selection circuitry (U1 and its associated components on the Servo/Band Switch Drive PWB Assy). Check this circuitry as follows:
 - (a) In manual mode, select a band other than the one you're in now.
 - (b) At TP17-TP20 on the Servo/Band Switch Drive PWB Assy, check to see that the bit pattern is correct for the band you have selected. For example, if you selected Band 1 (1.6 to 1.8 MHz), you should see a high on the BDSW 1 input to U1 and lows on BDSW 2, BDSW 4, and BDSW 8.
 - (c) If the input pattern to U1 is correct, check for a high on the corresponding output pin. In our example, pin 14 of U1 should be high; all other output pins (1-7, 9, 15) should be low.

(d) If the inputs and outputs of U1 are correct, check for continuity of the lines between U1 and connector J3/P1.

CODE 7

This fault code indicates either that the coil drive motor did not turn or that the coil position is incorrect.

Check the coil drive circuitry as follows:

- Check to see whether the motor turns when you move the manual TUNE switch to either MIN L or MAX L.
 - (a) If not, check TP6 (with the TUNE switch in the MAX L position) and TP10 (with the TUNE switch in the MIN L position) on the Servo/Band Switch Drive PWB Assy for approximately +12.5 Vdc with the motor running full speed. If the voltages are good, check to see whether the problem is in the motor cable or the motor itself. Also check to see whether there is any mechanical binding that might prevent the motor from turning.
 - (b) If the voltages at TP6 and TP10 are bad, check for an open in the +13.5 V line.
 - (c) If the motor turns in one direction but not the other, then check the appropriate driver transistors (Q1, Q2, and Q3 for MAX L; Q4, Q5, and Q6 for MIN L). Also check TP7 (MAX L) and TP8 (MIN L) for highs to turn the transistors on. When TP7 is high, check that Q8 (MIN L DISABLE) is turned off; when TP8 is high, check that Q7 (MAX L DISABLE) is turned off.
 - (d) Another reason why the motor might only turn in one direction is if the limit switch is stuck in one position or the other or if one of the limit switch transistors (Q13 or Q14) is shorted. Such a condition would cause the microprocessor to think that the motor had reached one of the end stops,

thus preventing any further motion in that direction.

- (2) If the coil drive motor moves freely in both directions, check to see whether the coil position is correct:
 - (a) Move the METER selector switch to COIL POS.
 - (b) Connect a voltmeter to TP1, which should read +5 Vdc.
 - (c) Using the manual TUNE switch, move the coil drive motor toward MIN L until the voltmeter reads 0 Vdc. At this point, the COIL POS meter on the LPA front panel should read 100 and the motor should stop. You should not be able to drive the motor any further in this direction.
 - (d) Connect the voltmeter to TP2, which should read +5 Vdc.
 - (e) Move the coil drive motor toward MAX L until the voltmeter reads 0 Vdc. At this point, the COIL POS meter should read 1770 and the motor should stop. You should not be able to drive the motor any further in this direction.
 - (f) If the COIL POS reading is incorrect at either end (for example, the voltage at TP1 went low when the COIL POS indicated 130; or the voltage at TP2 went low when the COIL POS indicated 1710), then you need to do an electromechanical realignment of the coil drive motor. See the alignment procedures in Section II of this chapter.
 - (g) If the COIL POS meter does not respond to changes in coil position or responds in a random manner, then check the twa and TWB outputs of the Encoder G1 at TP5 and TP4,respectively, with a dual-trace oscilloscope. While the motor is turning, these should both have TTLlevel squarewaves (0 to +5 Vdc). If not, suspect the encoder or its inputs (+5 Vdc and ground).

(h) If the voltages at TP1 and TP2 do not respond correctly, look for a problem with the limit switch or transistors Q13 or Q14. For example, if the voltage at TP1 goes to 0 at a coil position of 100, but the voltage at TP2 does not go to 0 at a coil position of 1770, then look for a problem with Q13. Conversely, if TP2 switches from +5 Vdc to 0 at a coil position of 1770, but TP1 does not switch at a coil position of 100, then look for a problem with Q14. If neither test point switches at its corresponding limit, then look for a problem with the limit switch.

CODE 15

This fault code indicates that while the coil was moving from MAX L to MIN L, the microprocessor was unable to find a tune peak.

The first thing to determine is whether this fault occurs in all frequency bands or just certain ones. Therefore, you should run the BIT test in each of the frequency bands and make a note of which bands the fault occurs in.

- (1) If the fault occurs in all bands, then the problem is most likely one of the following:
 - (a) An open in the RF line. Check for continuity between the input tab and the output connector J1.
 - (b) A short on the RF line. Check for a short between the RF signal line and ground.
 - (c) A bad variable coil L1. For example, the coil might be shorted internally.
 - (d) An open in the tune capacitor switch (S1-A), the load capacitor switch (S1-B), or the fixed-coil selector switch (S1-C).
- (2) If the fault occurs in only certain bands, try to determine what these bands have in common. For example, if the fault occurs only in the three lowest bands, then you might look for a shorted tuning capacitor (C5 or C6) or a shorted load capacitor (C5 or C6). Or, if the fault only occurs in Band 1,

then you might suspect fixed coil L2 (Band 1 is the only one in which this coil is not bypassed). Another possibility is a dirty or defective switch section.

CODE 16

This fault code indicates that when a tune peak is found, the forward tune power is not between 100 and 400 watts.

Use the same procedures as for code 15.

CODE 18

This fault code indicates that the ratio of forward power to RF input power is not between 5 and 60.

Use the same procedures as for code 15.

6-7. VSWR/XFMR PWB ASSY, A3.

- a. Preliminary Procedure.
 - (1) Remove the good VSWR/XFMR PWB Assy from the test-bed 1 KW Linear Power Amplifier, and replace it with the faulty VSWR/XFMR PWB Assy.
 - (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
 - (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
 - (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.)
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in troubleshooting the VSWR/XFMR PWB Assy. Refer to the section corresponding to the fault code you get. In the event that the test runs without generating a fault code, first check the "Additional Symptoms" section following the fault code discussions. If your problem is not covered there, start at the beginning of the following procedures and work your way through to the end.

CODE 10

This fault code indicates that when the LPA is put into OPERATE (but without bias or RF drive), the cathode current is greater than 5 mA.

This problem is most likely caused by the T/R Relay being stuck closed, which allows RF to go to the Tube Assy, causing the tube to conduct. The relay itself could be defective, or there could be a short on the T/R keyline (C10 shorted to ground, for example), causing the T/R Relay to stay energized.

CODE 14

This fault code indicates that when the LPA is keyed in OPERATE with bias and RF drive applied, the plate current is not between 325 and 480 mA.

In this case, the problem is most likely the T/R Relay's failure to energize, preventing RF drive from being applied to the tube. This could be caused by a defect in the relay itself (open or shorted coil, for example), an open +13.5 Vdc line, or an open T/R keyline.

CODE 15

This fault code indicates that when the LPA is keyed in OPERATE with bias and RF drive applied, a tune peak cannot be found.

Look for a short or open on the RF line. A possible problem could be the failure of one of the impedance-matching relays (K2-K4) to energize, which in turn could be caused by a defective relay or a fault in one of the relay driver circuits (Q1-Q3 and their associated components). Also, there could be an open in the FWD SAMPLE circuitry. Check the voltage at TP1 on the Power Control PWB Assy. If the FWD SAMPLE circuitry is working properly, this voltage should be positive (+7 Vdc indicates full forward power). If not, this voltage should be slightly negative.

CODE 16

This fault code indicates that when the LPA is keyed in OPERATE with bias and RF drive

applied, the FWD PWR is not between 100 and 400 watts.

Look for a problem in the FWD SAMPLE circuitry. Check the voltage at TP1 on the Power Control PWB Assy. If the FWD SAMPLE circuitry is working properly, this voltage should be positive (+7 Vdc indicates full forward power). If not, this voltage should be slightly negative. Also, check the adjustment of R8. See the alignment procedures in Section II of this chapter.

CODE 17

This fault code indicates that the VSWR is not less than 2.25:1.

NOTE

The following measurements should be taken with rf drive applied (the LPA is keyed in CW mode).

Look for a problem in the REFL SAMPLE/FWD SAMPLE circuitry by checking the voltages at TP1 and TP2 on the Power Control PWB Assy. Normally, TP1 should be close to +7 Vdc, and TP2 should be less than +1 Vdc. Also, check the adjustment of R5. See the alignment procedures in Section II of this chapter. Another possibility is an open in the RF line, which might be caused by a failure in one of the impedancematching relays (K2-K4) or their associated driver circuits (Q1-Q3 and their surrounding components).

CODE 18

This fault code indicates that the ratio of forward power to RF input power is not between 5 and 60.

Look for a problem in the RF IN SAMPLE circuitry. (Power gain is computed by taking the ratio of the FWD SAMPLE to the RF IN SAMPLE. Since the FWD SAMPLE has been used in several other calculations prior to this one without generating a fault code, the problem is more likely in the RF IN SAMPLE circuitry.)

ADDITIONAL SYMPTOMS

High Forward Power

Look for a problem in FWD SAMPLE circuitry. Also, check the adjustment of R8 (see the alignment procedures in Section II of this chapter).

6-8. FAN INVERTER PWB ASSY, A4.

a. Preliminary Procedure.

- (1) Remove the good Fan Inverter PWB Assy from the test-bed 1 KW LPA. Connect the two Fan Inverter PWB Assy cables to the faulty Fan Inverter PWB Assy. Rest the faulty Fan Inverter PWB Assy face up on top of the chassis, being careful to insulate it sufficiently.
- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
- (4) If there is a fault in the Fan Inverter PWB Assy, the fan should not be running. Use the following procedure to isolate the problem.

b. Troubleshooting Procedure.

- (1) Check for +13.5 Vdc at pin 2 or pin 5 of T2.
- (2) Check Q1 and Q2 for collector-emitter shorts.
- (3) Check the bias circuitry (R1-R3, CR1, C3).
- (4) Check C4 and C5 for shorts.

6-9. POWER CONTROL PWB ASSY, A5.

a. Preliminary Procedure.

(1) Remove the good Power Control PWB Assy from the test-bed 1 KW Linear Power Amplifier, and replace it with the faulty Power Control PWB Assy.

- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
- (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.)
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in troubleshooting the Power Control PWB Assy. Refer to the section corresponding to the fault code you get. In the event that the test runs without generating a fault code, first check the "Additional Symptoms" section following the fault code discussions. If your problem is not covered there, start at the beginning of the following procedures and work your way through to the end.

CODE 5

This fault code indicates that the XMTR FAULT line (TP11 on the Power Control PWB Assy) has gone low, indicating a temperature-related fault condition.

This fault code can be generated by any one of the following:

- (1) JMP 1 is not in place, or there is an open in the +13.5 Vdc line.
- (2) There is a fault in the LO AIR circuit (the LO AIR LED should be on if the problem is here).
- (3) There is a fault in the OVERTEMP circuit (the OVERTEMP LED should be on if the problem is here).

You should be able to isolate this problem quickly by checking the "sense" (whether the output corresponds to the inputs) of inverters U11D and U11E and of op amps U6A, U6B, and U7B.

CODE 10

This fault code indicates that when the LPA is put into OPERATE (but without bias or RF drive), the cathode current is greater than 5 mA.

- (1) Check the operation of U13A by placing the LPA into OPERATE and measuring the voltage on pin 1, which should be close to 0 (+12.5 mV or less). If it is greater than +12.5 mV, check the input at pin 3, which should be 40% of the voltage on pin 1. If the voltage on pin 3 is correct, then U13A is probably okay.
- (2) Check the voltage across R95, which should be the same as on U13-3. Normally, with the LPA in OPERATE and unkeyed, the voltage across R95 should be 0 (in other words, there should be no cathode current).
- (3) If the voltage across R95 indicates that there is cathode current, check for a problem with Q2 or Q3 (collector-emitter short) or with the keyline circuitry (U11A and Q1). With the LPA unkeyed, the output of U11A (pin 2) should be low, which keeps Q1 turned off, which in turn keeps Q2 and Q3 turned off.

CODE 11

This fault code indicates that with the LPA in OPERATE and bias applied (no RF drive), the plate current is not between 20 and 150 mA.

- (1) Key the LPA in OPERATE with no RF drive, and check the voltage at TP3. This voltage should be +5 Vdc. When you unkey the LPA, this voltage should increase to +24 Vdc. If the voltage at TP3 is incorrect, look for a problem in the bias circuit (Q2, Q3, and their associated components) or the keyline circuit (U11A, Q1, and their associated components). When the LPA is keyed, the output of U11A should be high, which turns on Q1, which then turns on Q2 and Q3.
- (2) If the voltage at TP3 is good, check the voltages at the input and output of U13A. With the LPA keyed in OPERATE (no RF drive), look for +20 to +150 mV on pin 3 and

+50 to +375 mV on pin 1. If these voltages are not correct, look for a problem in U13A or its associated components.

CODE 14

This fault code indicates that when the LPA is keyed in OPERATE with bias and RF drive applied, the plate current is not between 325 and 480 mA.

The bias, keyline, and cathode current sampling circuitry are probably okay; otherwise, code 11 would have been declared. In this case, since the fault occurs with RF drive applied, look for a problem in the TGC circuitry, which controls the amount of RF drive applied to the LPA. Check this circuitry as follows:

- (1) To see whether the TGC circuitry is indeed the cause of the problem, disconnect the cable from J1 on the AGC/TGC PWB Assy in the 100 Watt Transceiver. Run the BIT test again and see if Code 14 reappears. If it doesn't, continue with step 2 below. If it does, check the bias, keyline, and cathode current sampling circuitry as in Code 11 above.
- (2) Re-connect the cable to the AGC/TGC PWB Assy in the 100 Watt Transceiver. The first thing to do is determine whether the problem can be corrected by adjusting the potentiometers on the Power Control PWB Assy. Go the alignment procedures in Section II of this chapter and perform the entire alignment procedure. If this does not correct the problem, continue with step 3 below.
- (3) Key the LPA from the 100 Watt Transceiver in CW mode with the CW key. Measure the voltage at TP5. Normally, this voltage should be +8 Vdc. If it is greater than +8 Vdc, the output power will be lower than normal; if it is less, the output power will be greater than normal. If the voltage at TP5 is good, skip to step 8. If it is not, continue with step 4. Return the transceiver to USB mode.

NOTE

For all the measurements that follow, you must key the LPA from the 100 Watt Transceiver and hum into the microphone.

- (4) Observe the voltage at TP1 and TP2 with an oscilloscope. TP1 should read +7 Vdc at the peak of the waveform, and TP2 should read less than +1 Vdc (almost 0). Also, check pins 1 and 7 of U1. The voltages at these pins should be about the same as on the corresponding test points. If any of these voltages are incorrect, look for a problem in U1 and its associated components.
- (5) Check the output of U3A with an oscilloscope. Pin 1 (TP4) should be +8 Vdc at the peak. If this voltage is incorrect, look for a problem with U3A or its associated components.
- (6) Check the output (pin 1) of U9A for +8 Vdc (peak). Normally, U9A has unity gain. However, any one of several conditions can cause U8 to conduct. During CW power cutback, for example, after C10 charges, the output of U4A goes high, causing the output of U4B to go high, which in turn causes the output of U7A to go low, turning on U8 and increasing the gain of U9A. This same situation can occur if either CR29, CR10, or CR11 conducts (in response to an rf/DC protect voltage or an overtemperature or overcurrent condition), forcing the output of U4B to go high. If the voltages at U9A are not normal, do the following:
 - (a) Check the anodes of CR29, CR11, CR10, and CR7 to determine if any of these is sufficiently positive to cause pin 5 of U4B to go higher than +5 Vdc, causing the output of U4B to go low. If so, you can then identify the circuit that is causing this condition:
 - CR29 RF/DC protect (U3B and its associated components
 - CR11 Overtemperature (U6B and its associated components
 - CR10 Max plate current control (U5A and its associated components)

CR7 CW power cutback (U4A and its associated components)

- (b) If none of the above circuits is responsible for changing the gain of U9A by causing the output of U4B to go low, check for a problem in U4B, U7A, U8, or their associated components.
- (7) If the voltages at U9A are normal, check the voltages at U9B. Pin 5 should normally be at +4 Vdc (peak), and pin 7 (TP5) should be at +8 Vdc (peak). If this is not the case, check for a possible problem in quad switch U10 or in U9B and one of its associated components.
- (8) Check for a possible problem in the PPC circuitry (U5B and its associated components). Measure the voltage at TP6 with an oscilloscope. Normally, this voltage should be 0 to +5 Vdc (peak). A voltage greater than this initiates the cutback condition in the transceiver (Exciter PWB Assy). Check to see whether the PPC LED illuminates (this LED should illuminate whenever the voltage at TP6 exceeds +5 Vdc, which is the threshold point for U13B). If the voltage at TP6 is consistently greater than +5 Vdc (PPC LED is on continuously), check for a problem in U5B and its associated circuitry.

CODE 16

This fault code indicates that when the LPA is keyed in OPERATE with bias and RF drive applied, the FWD PWR is not between 100 and 400 watts.

Use the same procedure as for Code 14.

ADDITIONAL SYMPTOMS

High Forward Power, Low Forward Power

Look for a problem in the TGC circuitry. Use the same procedure as for Code 14.

6-10. MICRO CONTROL PWB ASSY, A6.

a. Preliminary Procedure.

- Remove the good Micro Control PWB Assy from the test-bed 1 KW Linear Power Amplifier, and replace it with the faulty Micro Control PWB Assy.
- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
- (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the évents that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.) If you are unable to run the BIT test, either from the 100 Watt Transceiver or from the LPA, go to the "Additional Symptoms" section following the fault code discussions.
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in troubleshooting the Micro Control PWB Assy. Refer to the section corresponding to the fault code you get. In the event that the test runs without generating a fault code, check the "Additional Symptoms" section following the fault code discussions. If the procedure there does not indicate that there is a problem, chances are that the Micro Control PWB Assy is all right.

CODE 1

This fault code indicates that when the microprocessor reads the RF PLATE SAMPLE input to the A-to-D Converter, it indicates full scale, which means that the metering is inaccurate.

The problem is most likely in either the microprocessor chip (U1) or the A-to-D Converter chip (U6). Check the clock signal (TP4) to U6 (it should be 614.4 KHz). If the signal is bad at TP4, trace the line back through U31-5 and U31-1 (4.9152 MHz), all the way back to the clock oscillator (U8, Y1, etc.). If the signal at TP4 is good, try replacing the microprocessor

first (since it's socketed), then the A-to-D Converter.

CODE 3

This fault code indicates that when the microprocessor read the PRI PWR input to the A-to-D Converter, it found it to be out of range (which is 80 to 120% of the nominal value).

Since Code 1 was not declared, the microprocessor and the A-to-D Converter are probably okay. Look for an open (R140) or a short (C140) on the PRI PWR SAMPLE input line (J1-16 to U6-4) to the A- to-D Converter (U6).

CODE 4

This fault code indicates that when the microprocessor read the +13.5 VDC SAMPLE input to the A-to-D Converter, it found it to be out of range (which is +10 to +16 Vdc).

Since Code 1 was not declared, the microprocessor and the A-to-D Converter are probably okay. Look for an open (R16) or a short (C22, VR2) on the +13.5 VDC SAMPLE input line (J1-47, -48 to U6-3) to the A-to-D Converter (U6). Check also the voltage divider formed by R16 and R17. Another possibility is that VR2 is breaking down at a lower potential than it is rated at (5.1 Vdc).

CODE 6

This fault code indicates that the band switch, when commanded to move to a different band, did not reach the selected band within 10 seconds.

(1) With the LPA in manual mode, select a different operating band from the one you're in now. Then check the BDSW output signal lines to the Tank Assy for the correct binary code. In other words, if you switch from the 1.6 to 1.8 MHz band (Band 1) to the 4 to 6 MHz band (Band 5), you should see highs on pins 5 and 9 of Output Latch U13 and lows on pins 2 and 6. Check for the signals on the output sides of their resistors (R120-R123) also. If the code is correct, try switching to Band 2 (U13-6 should be high; pins 2, 5, and 9 should be

low) and then to Band 8 (U13-2 should be high; pins 5, 6, and 9 should be low), checking the code at both bands. If the codes are correct in all cases, proceed to step 2.

(2) If the Output Latch U13 and the BDSW signal lines are functioning properly, check the BDSW ON line and the Input Latch U28. After making a band change in manual mode, check to see whether pin 13 of U17 goes high and then low again after a few seconds. Check for the opposite on pin 12 of U17 and pin 14 of U28. If U17 appears to be working properly, suspect U28.

CODE 7

This fault code indicates that when the coil drive motor was commanded to move first to MIN L and then to MAX L, it either did not move or its position counter was found to be inaccurate (the coil's position at MIN L or MAX L did not agree with stored values).

- (1) Check the MIN L and MAX L signal lines on both sides of U11. When the BIT test is run, U11-3 should be low normally and then go high momentarily. The opposite should happen at U11- 14. After U11-3 returns low, U11-2 should go high momentarily and then return low again. The opposite should occur at U11- 15. If the signals are good at U11, check at the output sides of the respective resistors (R125, R126). If the signals are good there, proceed to step 2.
- (2) Check the MIN L LIMIT and MAX L LIMIT signal lines coming into the board. When the BIT test is run, the MIN L LIMIT signal line (U28-13) should go low and then high again. After the MIN L LIMIT signal line returns high, the MAX L LIMIT signal line (U28-8) should go low and then remain there for a few seconds until the tuning portion of the BIT test, when it should go high again. If these signals are incorrect, look for a problem in the input resistors (R130, R131) or the pullup resistor pack (R20).
- (3) Check the TWA and TWB signal lines (U17-9, U17-11). When the tuning coil is in motion, these signals should be TTL (0 to

+5 Vdc) square waves of opposite polarity. Check these signals on both the inputs and outputs of U17. Also, check the edge detector circuit: pins 4 and 5 of U26 should be high pulses when the coil drive motor starts to move and continue to be high pulses until the motor stops. Pin 1 of U26 should be the opposite. If this is not the case, look for a problem in U17, U26, or one of their associated components (R5, C24, C29, CR1,

CODE 8

This fault code indicates that with the LPA in STANDBY, the DC plate voltage is greater than 100.

- (1) Look for a problem in U25 or U20. Place the LPA in STANDBY and check the signal level at U25-12. It should be low. Then command the LPA to OPERATE, and see whether this pin goes high. If it does, check for the opposite reactions at U20-14 and the output side of R107.
- (2) If the signal at U25-12 is not correct, check the inputs to U25: +5 Vdc at pins 15 and 16; GND at pin 8; the clock signal (TP2) at pin 3 and the SERIAL DATA signal (TP3) at pin 2 (also check the pullup lines through R8); and the strobe signal at pin 1. If the inputs to U25 appear to be good, replace U25.

CODE 9

This fault code indicates that with the LPA in OPERATE, the DC plate voltage is not between 2000 and 5000.

Check for an open (R141) or a short (C141) on the DC PLATE SAMPLE line (J1-38 to U6-5). With the LPA in OPERATE, this line should read approximately +1.8 to +4.5 Vdc, which corresponds to a plate voltage of +2000 to +5000 Vdc.

CODE 11

This fault code indicates that when the LPA is keyed in OPERATE without RF drive, the plate current is not between 20 and 150 mA.

Check for an open (R138) or a short (C138) on the I SAMPLE line (J1-42 to U6-1).

CODE 12

This fault code indicates that when the RF MUTE command was sent to the 100 Watt Transceiver, the RF input level to the LPA did not drop below 6 W in 200 ms.

- (1) Look for a problem in U19 or U30. Run the BIT test and see whether U30-11, which should normally be high, goes low momentarily and then high again. If not, check for the reverse situation at U30-6.
- (2) If the signal is good at U30-6, suspect U30 itself or look for a short (CR8 or C111) or open (R111) on the RF MUTE signal line.
- (3) If the signal at U30-6 is not good, suspect U19. Before replacing it, check for +5 Vdc at pins 15 and 16 and for GND at pin 8. If these inputs are good, replace U19.

CODE 13

This fault code indicates that when the TPR (Tune Power Request) and TGC TPR signals were sent to the transceiver, the RF input signal level did not rise above 5 W in 20 seconds.

- (1) Check for an open (R137) or a short (C137) in the RF IN SAMPLE signal line (J1-12 to U6-28).
- (2) Another possibility is a fault in the DATA lines (J1-8, 9 to U1-10, 11). With the LPA in AUTO mode, change frequency bands on the transceiver and then key the system. You should see a series of pulses on the DATA+ line. Trace these pulses from U1-11 through U10, Q2, U4-1, and out to J1-9. You should also see these pulses at U4-4, U3, and back at U1-10.

CODE 15

This fault code indicates that when the LPA is keyed in OPERATE with RF drive, a tune peak cannot be found as the coil is moved from MAX L to MIN L.

- (1) Look for an open (R136) or a short (C136) in the FWD SAMPLE line (J1-39 to U6-27).
- (2) Check that the PA TUNE line (output side of R102) goes low while the microprocessor is attempting to find a tune peak during the BIT test. If not, check for an open R102 or a problem in U20 or U25 (these two chips should be okay; otherwise, a Code 8 would have been declared).

CODE 21

This fault code indicates that data sent from pin 11 of the microprocessor (U1) was not received (echoed back) at pin 10. Normally, this code indicates a problem in the communications link between the LPA and the transceiver; but in this case, since we know that the Micro Control PWB Assy is faulty, the problem has to be in the onboard DATA lines (J1-8, 9 to U1-10, 11). With the LPA in AUTO mode, change frequency bands on the transceiver and then key the system. You should see a series of pulses on the DATA+ line. Trace these pulses from U1-11 through U10, Q2, U4-1, and out to J1-9. You should also see these pulses at U4-4, U3, and back at U1-10.

ADDITIONAL SYMPTOMS

Microprocessor Fault

Microprocessor-related faults are generally characterized by an abnormal or random display and a loss of transceiver control functions (i.e., there is no LPA status displayed on the transceiver or the status is always MANUAL). In this case, running the BIT test is of no avail. Therefore, if you think you have a microprocessor-related fault and you cannot run the BIT test, use the following procedure:

NOTE

The Micro Control PWB Assy contains the Intel 8031 microprocessor, which controls all the functions of the LPA, including the BIT test. A failure in the microprocessor, EPROM, RAM, decoder, etc. will probably disable the BIT circuitry and most of the other LPA functions as well. Unless you are thoroughly familiar with the

circuitry of this board and with the operation of microprocessors, it will be very difficult for you to isolate a faulty chip or discrete component using standard test equipment and troubleshooting techniques. The following procedures, therefore, are intended to check only the most obvious and fundamental aspects of the board's operation. If these do not enable you to identify the problem, then you will need more advanced test equipment and test procedures, which are beyond the scope of this manual.

- (1) Check the supply voltage (+5 Vdc) to the microprocessor at U1-40. Also check for 0 Vdc at pins 20 and 31.
- (2) Check the reset pin (U1-9). Normally, this pin should be low all the time. If the microprocessor is not working properly, it will be pulsing high at a 9.375 Hz rate. If this is the case, then the clock oscillator (Y1, U8, and their associated components), counters U31 and U32, and buffers U17 and U3 are probably okay. If the reset line is continually high, look for a failure in U3 or U17.
- (3) Check the clock inputs to the microprocessor: U1-19 (4.9152 MHz), U1-15 (153.6 KHz), and U1-12 (300 Hz). If any of these inputs is bad, trace the signal line(s) back to the counters (U31, U32) and/or the oscillator (U8, Y1, etc.).
- (4) Check U1-30 (TP1) to see if it's pulsing high and low; it should not be stuck high or low. Do the same for U1-16, U1-17, and all the address lines.
- (5) If all the above checks are good, try replacing the microprocessor U1. This chip is socketed for easy replacement.
- (6) If the problem persists, replace the EPROM U2. This chip is also socketed.
- (7) If the problem still persists, check the supply voltages and ground connections to all the other chips, beginning with the RAM (U29) and the address decoder (U27).

6-11. FRONT PANEL PWB ASSY, A7A1.

a. Preliminary Procedure.

- (1) Disconnect the cable from the good Front Panel PWB Assy in the test-bed 1 KW Linear Power Amplifier, and connect it to the faulty Front Panel PWB Assy. It is not necessary to mount the faulty Front Panel PWB Assy in the test bed.
- (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
- (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
- (4) Look at the display on the front panels of both the 1 KW LPA and the 100 Watt Transceiver. If you notice anything abnormal, either when you first power up the LPA or after the LPA is warmed up and you try to operate it, refer to the appropriate section below.

b. Troubleshooting Procedures.

Problems with the 1 KW LPA can be grouped under the following general symptoms:

LPA does not power up.

The first thing you should do in this situation is determine whether the Front Panel PWB Assy has +5 V applied when you command the LPA to turn on from the 100 Watt Transceiver. Normally, this is indicated by the POWER ENABLE LED being on steady and the STANDBY LED blinking. If neither LED is on, look for a failure in the POWER ENABLE switch S8. If the STANDBY LED is blinking but the POWER ENABLE LED is off, look for a failure in the POWER ENABLE LED.

LPA status at 100 Watt Transceiver is missing or incorrect.

(1) If there is no LPA status at the transceiver (the AMP:STBY indicator is not visible on the transceiver's display), the problem could be anywhere on the output side of the data line (U17-U20, U11F, or the FP IN EN, SER CK, or SER DATA signal lines).

- (a) Every 50 ms, you should see a series of 200 KHz clock pulses on the SER CK line (pin 10 of U17-U20). During this time, the FP IN EN line (pin 9 of U17-U20 and pin 15 of U11) should go low, which allows the serial data to be clocked out from U17-U20 through U11F. Check pin 13 of U11 for a series of data pulses every 50 ms.
- (b) If the data pulses are not present, but the SER CK and FP IN EN signals are good, trace the data pulses back through U11-14 and the inputs (pin 11) and the outputs (pin 3) of U17-U20. Check for the presence of the operating voltages (+5 Vdc, GND) at each of these chips.
- (2) If you do have LPA status at the transceiver (AMP:STBY indicator is on) but the status is incorrect (e.g., the LPA MAN indicator on the transceiver is on when the LPA's AUTO/MANUAL BAND switch is in the AUTO position), look for a problem with switch S1 or shift registers U17 or U18 and their associated components.
 - (a) Rotate AUTO/MANUAL BAND switch S1 through each of its positions. At each position, check the bit pattern on pins 1, 4-7, and 13-15 of U17 and on pins 5-7 of U18. Only one of these pins should be low for a given setting of S1, and it should be different for each setting.
 - (b) If the bit pattern at the parallel inputs to U17 and U18 is correct for each position of S1, then check the serial outputs (pin 3) of both U17 and U18. Using a dual-trace oscilloscope, sync on the negative transition of the FP IN EN signal and look for a series of data pulses at U17-3 and- U18-3. Try changing the setting of S1 and look for a corresponding change in the data pattern.
 - (c) If the data signal at U17-3 and/or U18-3 is incorrect, check the operating voltages (+5 Vdc and GND) for U17 and/or U18. If the operating voltages are good, replace the appropriate chip

(U17 if the data signal at U17-3 was bad; U18 if the data signal at U17-3 was good).

Meter failures.

Look for a problem with METER switch S2 or with one of the resistor packs (R17, R18). Rotate S2 through each of its positions. At each position, check the bit pattern on the control lines to U17 (pins 1, 4, 13-15) and U18 (pins 4-7, 13, 14). For each switch setting, only one of these control lines should be low; all others should be high. Presumably, the shift registers (U17-U18), the output buffer (U11F), the SER CK line, and the FP IN EN line are good; otherwise, you would probably have missing or incorrect LPA status at the transceiver.

Manual control failures.

If one of the manual control switches (TUNE PWR, LOCAL KEY, TUNE, ANTENNA, and SELF TEST) does not appear to be functioning properly, check its operation by monitoring the logic level at its control line. For example, when you activate the TUNE PWR switch, pin 15 of U19 should go low. It should remain low until you flip the TUNE PWR switch off. For multiple switch failures, including failures at selected positions of the AUTO/MANUAL BAND and METER switches, look for a problem in one of the resistor packs (R16-R19).

LCD failures.

Typical failure modes for the LCD (DS1) are (1) the loss of an individual segment, (2) a completely blank display, or (3) a display in which the outline of the previous character persists after a new character appears.

(1) A good way to check whether a particular segment is defective is to run the BIT test. During the BIT test, all LCD segments are supposed to be lit. If a segment is not lit, check for a high at its corresponding control line on U28 (a high at the output of U28 turns the segment on). For example, if the center segment of the third character is not illuminated during BIT, check to see whether U28-15 is high during BIT. If it is, replace DS1. If it isn't, replace U28.

- (2) If the display is completely blank, do the following:
 - (a) Check for the presence of the operating voltages (+5 Vdc, GND) at U28 and DS1. If these voltages are good, run the BIT test and check for highs on all the outputs of U28 (pins 3-29, 32, 33, 37-39). If the outputs of U28 are high, replace DS1.
 - (b) If the outputs of U28 are not high, check for a series of 200 KHz clock pulses at U28-40 every 50 ms, along with a series of data pulses at U28-34. If the inputs to U28 are good, replace U34.
 - (c) If the clock signal is bad at U28-40, check it at U11-2. Also, check for a low on the LCD OUT EN line (U11-1) while the SER CK line and the SER DATA lines are pulsing. (The LCD OUT EN line allows the SER CK pulses to be buffered through U11A to U28-40.) If the inputs to U11 (including the +5 Vdc and GND operating voltages) are good, replace U11.
- (3) If the outline of a previous character persists after a new character appears, the 75 Hz LCD CLK signal is probably bad. Check it at pins 1 and 28 of DS1 and at pin 31 of U28.

LED Failures.

If you suspect that one of the front panel LEDs is defective, run the BIT test. All of the LEDs should be on during the test.

(1) If one LED fails to light, check its driver circuit. The four LEDs are controlled by U26, pins 4-7. A high on one of these pins is applied to the base of its driver transistor, thus turning it and its associated LED on. For example, if the FAULT LED fails to come on during the BIT test, check for a high on U26-4. If U26-4 is low, replace U26. If U26-4 is high, the problem is either in Q1, R6, or DS2.

- (2) If two or more LEDs fail to function properly, do the following:
 - (a) If none of the LEDs comes on, check the supply voltages (+5 Vdc and GND) to U26: pins 15 and 16 should be at +5 Vdc, and pin 8 should be at 0 Vdc. Also, check for a series of 200 KHz clock pulses every 50 ms at pin 3 and a corresponding series of data pulses at pin 2. At the same time, pin 1 should pulse high whenever there is a change in the LED status, such as when the LPA is switched from STANDBY to OPERATE. When the clock and data lines are inactive, pin 1 should be low. If all the inputs to U26 are good, replace U26. If not, trace out the defective signal line.
 - (b) If at least one of the LEDs comes on, replace U26.

6-12. TEMP SENSOR PWB ASSY, A8.

- a. Preliminary Procedure.
 - (1) Remove the good Temp Sensor PWB Assy from the test-bed 1 KW Linear Power Amplifier, and replace it with the faulty Temp Sensor PWB Assy.
 - (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
 - (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
 - (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.)
- b. Interpreting the BIT Codes. Use the fault code listed below as a guide in troubleshooting the Temp Sensor PWB Assy. In the event that the test runs without generating a fault code, check the "Additional Symptoms" section following the discussion of the fault code.

CODE 5

This fault code indicates that the XMTR FAULT line (TP11 on the Power Control PWB Assy) went low, which could have been caused by any of the following:

Low air flow

High ambient temperature

JMP1 on the Power Control PWB Assy not being installed

Since we know that the problem is in the Temp Sensor PWB Assy, we can eliminate the last cause. To determine whether the fault code is generated by low air flow or by high ambient temperature, check whether the LO AIR LED (DS4) or the OVERTEMP LED (DS5) on the Power Control PWB Assy comes on when the fault is declared.

(1) The LOW AIR LED indicates that the temperature sensed by U2 on the Temp Sensor PWB Assy (as measured by the voltage at TP9 on the Power Control PWB Assy) is at least 15° C to 21° C greater than the temperature sensed at U2 (as measured by the voltage at TP10). This could be caused by either a failure in the fan (which in this case we know is okay) or in one of the temperature sensing circuits (U1, U2, or their associated components). Do the following:

NOTE

This procedure can be performed on a "cold" LPA (one that has been turned off for at least 15 minutes) or a "hot" LPA (one that has been turned on for more than 10 seconds). If you remove the JMP1 jumper (on the Power Control PWB Assy) from a cold LPA, you can begin the procedure immediately (as soon as you turn the LPA on). However, if you remove the jumper from an LPA that has been on for more than 10 seconds, then you should allow 15 minutes for the temperature sensors to stabilize at ambient before doing the procedure.

- (a) Remove JMP1 on the Power Control PWB Assy. With the LPA in STANDBY, measure the voltages at TP9 and TP10 on the Power Control PWB Assy. At a room temperature of 21° C (70° F), both test points should read approximately +2.94 Vdc. (For each °C up or down, the voltage at the test points should increase or decrease by 10 mV.) If TP9 is off by more than a few tenths of a volt, replace U1. If TP10 is off, try adjusting potentiometer R2 on the Temp Sensor PWB Assy to make the voltage at TP10 match that at TP9. If adjusting R2 is ineffectual, replace U2.
- (b) If the above procedure does not isolate the problem, install JMP1 and measure the voltages at TP9 and TP10 again. TP10 should read the same as before, but TP9 should indicate an increase of approximately 70 mV (in other words, with the fan running, the heat generated by the conduction of R1 should increase the temperature of U1 by approximately 7° C).
- (c) If the results of the above tests are still inconclusive, try transmitting for awhile into the dummy load until the LPA reaches its normal operating temperature (110°C). Measure the voltages at TP9 and TP10 again. TP10 should read approximately +3.68 Vdc, with TP9 approximately 70 mV higher (+3.75 Vdc).
- (2) The OVERTEMP LED indicates that the ambient temperature of the LPA, as measured by U2 on the Temp Sensor PWB Assy, is greater than 150° C (302° F). The problem has to be in the U2 temperature sensing circuit. Try adjusting R2 first (see the alignment procedures in Section II of this chapter). If adjusting R2 fails to correct the problem, replace U2.

ADDITIONAL SYMPTOMS

Low forward power.

This could indicate a faulty U2 or a misadjusted R2. In other words, the output voltage of U2 is high enough to initiate power cutback, but not

high enough to generate an OVERTEMP fault. First try adjusting R2 (see the alignment procedures in Section II of this chapter). If this fails to correct the problem, replace U2.

6-13. INTERCONNECT PWB ASSY, A9.

- a. Preliminary Procedure.
 - (1) Remove the good Interconnect PWB Assy from the test-bed 1 KW Linear Power Amplifier, and replace it with the faulty Interconnect PWB Assy.
 - (2) Connect a dummy load to the output (J5) of the 1 KW Linear Power Amplifier (hereafter referred to as the 1 KW LPA).
 - (3) Power up the 1 KW LPA from the front panel of the 100 Watt Transceiver.
 - (4) After the 1 KW LPA is warmed up, run the BIT test. (For a complete description of the events that take place during the BIT test, including the causes of the various fault codes, see the Appendix at the end of this chapter.) If you are unable to run the BIT test, either from the 100 Watt Transceiver or from the LPA, go to the "Additional Symptoms" section following the fault code discussions.
- b. Interpreting the BIT Codes. Use the fault codes listed below as a guide in trouble-shooting the Interconnect PWB Assy. Refer to the section corresponding to the fault code you get. In the event that the test runs without generating a fault code, refer to the "Additional Symptoms" section following the fault code discussions. If your problem is not covered there, start at the beginning of the following procedures and work your way through to the end.

CODE 3

This fault code indicates that when the microprocessor read the PRI PWR SAMPLE input to the A-to-D Converter, it found it to be out of range (which is 80 to 120% of the nominal value).

The PRI PWR SAMPLE input to the A-to-D Converter is obtained from a precision volt-

age divider (R1, R2) in series with the +13.5 Vdc from the 1 KW Power Supply. With a nominal input voltage (+13.5 Vdc), there should be approximately +3 Vdc at the junction of R1 and R2. Measure the voltage across R1 and R2. The voltage across R1 should be 3.46 times greater than the voltage across R2. If the input voltage (+13.5 Vdc) is marginally high or low, a slight change in the ratio of these two resistors can generate a Code 3 fault.

CODE 8

This fault code indicates that with the LPA in STANDBY, the DC plate voltage is greater than 100.

Look for a fault in the HV ON circuit, specifically a shorted Q1 or Q2, which is keeping the high voltage relay (K1 in the 1 KW Power Supply) energized in STANDBY.

CODE 9

This fault code indicates that with the LPA in OPERATE, the DC plate voltage is not between 2000 and 5000.

The most obvious cause of this fault is an open Q1 or 02 (or a fault in one of their associated components), which is preventing the high voltage relay (K1 in the 1 KW Power Supply) from energizing in OPERATE.

ADDITIONAL SYMPTOMS

LPA does not power up.

Look for a problem in the POWER ON SW line: either an open or a short (C1 or CR1, for example).

No LPA status at the transceiver.

Since the Interconnect PWB Assy is the distribution center for the +13.5 Vdc to many of the other circuit boards, including the Micro Control PWB Assy which in turn supplies the Front Panel PWB Assy, an open in one of the +13.5 Vdc distribution lines could disrupt LPA transceiver communications. Check especially for continuity in the connectors, J1 and J2.

6-14. LOW PASS FILTER ASSY, A110. If this assembly is defective, the problem is most likely a shorted capacitor or an open inductor. You should be able to isolate the faulty component

very quickly by taking resistance measurements from the RF Me to ground and from one end of the RF line (J4) to the other (J5).

Section IV. REMOVAL/REPLACEMENT PROCEDURES

6-15. REMOVAL/REPLACEMENT
PROCEDURES. The following removal/replacement procedures are for the internal components of the A2 Tank Assy only. Removal/replacement procedures for the Tank Assy itself and for the other major subassemblies of the 1 KW LPA are contained in the On-Equipment Manual, T.O. 31R2-2URC-121.

NOTES

When replacing switches, apply a thin film of Dow Corning No. 200 silicone lubricant to the wiping surface of the switch contacts.

Some of the screws in the following procedures are secured with Loctite No. 222 (purple). Apply a new coating of Loctite 222 when reinstalling these screws.

- (1) Wafer Switches
 - (a) Band Select Switch

CAUTION

Due to the shape of the shaft that runs through the center of the Band Select Switch, it is possible to install the switch correctly or 180° out of phase. Therefore, before removing the switch, make sure that the switch is set for band 1 (1.6-1.8 MHz), in which case the open position of the switch should be oriented toward the driven pulley. When installing a new switch, make sure that its orientation is the same as that of the one you took out.

 Loosen the two setscrews holding the black plastic Geneva drive gear to the switch shaft.

NOTE

Before removing the Geneva drive gear from the shaft, place an identifying mark on the gear and the flat of the shaft. This is so you will be able to re-install the gear in the same position it was when you took it off.

- ii. Remove the Geneva drive gear from the shaft.
- iii. Remove the two Phillips screws holding the Band Select Switch to the chassis.
- iv. Unsolder the flexible cable wires from the old switch and solder them to the new switch, being careful to orient the flexible cable correctly.
- Mount the new switch to the chassis, making sure that its orientation is the same as for the old switch.
- vi. Mount the Geneva drive gear to the shaft.
- (b) Selector Switch Assy for the Tune Capacitors, Load Capacitors, and Inductors

NOTES

This switch assembly (S1-A, -B, and -C) must be replaced as a unit. If one of the sections is defective, do not attempt to repair it. Instead, replace the entire switch assembly.

Before starting the following procedure, select band 1 (1.6-1.8 MHz). Note the orientation of the three movable switch contacts on each section of the switch assembly. The contacts on the new switch assembly must be oriented the same way. Due to the shape of the switch shaft, it is possible to mount the switch in only one of two ways: correctly or 180° out of phase.

 Loosen the setscrew holding the black plastic Geneva drive gear to the switch shaft.

- ii. Remove the Geneva drive gear from the shaft.
- iii. Loosen six Phillips screws and remove the top cover (to which the circuit board is mounted).
- iv. Unsolder the Coil Assy leads at the switch. Also, unsolder the connecting strap to the variable coil. Disconnect the ground wire to the chassis by removing the Phillips mounting screw.
- v. Remove the four Phillips screws and remove the Coil Assy.
- vi. After placing identifying marks on the two Load Capacitor Assemblies, remove them from the chassis by removing their two Phillips mounting screws.
- vii. Do the same for the two Tune Capacitor Assemblies.
- viii. Unsolder the remaining strap to the variable coil.
- ix. On the bottom of the Tank Assy, remove the three mounting nuts for the switch assembly.
- x. Remove the switch assembly.
- xi. Unsolder any remaining leads or jumpers from the old switch assembly and transfer them to the new switch assembly.
- xii. Unsolder coil L6 from the old switch assembly. Remove the two plastic mounting screws, and remove the coil. Transfer this coil to the new switch assembly.
- xiii. Mount the new switch assembly to the Tank Assy chassis. Use the chassis ground strap as a guide in orienting the new switch assembly correctly. Make sure that the orientation of the movable switch contacts is the same as it was on the old switch assembly. Install and

- tighten the three mounting nuts on the bottom of the Tank Assy.
- xiv. Solder the leads from the variable coil to the new switch assembly.
- xv. Install the Tune Capacitor
 Assemblies and the Load Capacitor
 Assemblies, making sure that the
 assemblies are correctly installed
 per your identifying marks. Check
 that all the contacts on these
 assemblies engage the switch
 tabs.
- xvi. Install the Coil Assy, and make all solder connections between it and the switch assembly.
- xvii. Install the top cover and tighten the six Phillips screws.
- xviii. Install the Geneva drive gear.
- xix. Check the shaft alignment as follows:

With the drive pin completely disengaged from the Geneva drive gear, check that the three movable switch contacts in each section are centered on their corresponding fixed contacts. Manually rotate the band switch drive through all the frequency bands, checking the alignment of the movable switch contacts in each band.

xx. To align the shaft:

Remove the two Phillips screws and the Geneva drive gear. Twist the shaft manually until the contacts are centered. Position the Geneva drive gear onto the adjustable disk so that the mounting holes in the drive gear align with the holes in the disk. Install and tighten the Phillips screws. Rotate the drive 360° and check whether the contact alignment is still correct. You may

have to go back and forth a couple of times to optimize the alignment for the entire range of bands.

(2) S3, Overtravel Limit Switch

NOTE

This switch is located on the bottom of the Tank Assy.

- (a) Manually rotate the band switch drive pulley until the switch actuator is in the middle of the cam. The switch should be actuated at this point.
- (b) Note the orientation of the flexible cable, and unsolder the flexible cable wires from the switch.
- (c) Remove the two Phillips mounting screws from the standoffs, and remove the switch.
- (d) Mount the new switch to the standoffs with the two Phillips screws.
- (e) Resolder the flexible cable wires, making sure that the cable orientation is correct.
- (f) Before tightening the screws, make sure that the switch is actuated but not bottomed out. In other words, the switch actuator should not be at the limit of its travel.

(3) Band Switch Drive Motor

- (a) Unsolder the motor leads at the bottom of the chassis where they are connected to the flexible cable. Mark the flexible cable wires appropriately.
- (b) Slip the drive belt off the drive pulley.
- (c) Loosen the setscrew and remove the drive pulley from the motor shaft.
- (d) Remove the three Phillips screws holding the motor to the chassis.
- (e) Remove the motor.

(f) Install the new motor, reversing the order of the above steps.

(4) Coil Drive Motor

- (a) Unsolder the flexible cable leads from the coil drive motor and mark them.
- (b) Remove the four Phillips screws holding the Coil Drive Assy to the chassis.
- (c) Pull the Coil Drive Assy straight out, disengaging the Coil Drive Assy coupling from the coil shaft coupling (the couplings are mated together with a phenolic key which will fall out when the Coil Drive Assy is removed).
- (d) Slip the drive belt off the coil drive pulley.
- (e) Loosen the setscrew and remove the pulley from the motor shaft.
- (f) Remove the three screws holding the motor to the Coil Drive Assy mounting plate.
- (g) Remove the motor.
- (h) Install the new motor, reversing the order of the above steps and being careful not to disturb the position of the gears.

(5) Motion Sensor Assy

- (a) Loosen the two slotted setscrews on the Motion Sensor side of the white plastic coupling.
- (b) Unsolder the four Motion Sensor flexible cable wires, being careful to mark their positions.
- (c) Remove the two Phillips mounting screws and remove the Motion Sensor Assy.
- (d) Remove the nut and remove the Motion Sensor from its mounting plate.

(e) To install the new Motion Sensor, reverse the order of the above steps.

(6) Limit Switch

- (a) Manually position the tuning coil so that it is at least a third of the way from either end stop.
- (b) Remove the two Phillips screws holding the Limit Switch Assy.
- (c) Remove the nut and remove the Limit Switch from its mounting plate.
- (d) Unsolder the Limit Switch from its flexible cable, and note the cable's orientation.
- (e) To install a new Limit Switch, reverse the order of the above steps.

(7) Tuning Coil

- (a) Manually position the tuning coil to its rear end stop.
- (b) Remove the Coil Drive Assy, but do not unsolder any wires (see paragraph 4 above).
- (c) Remove the two nuts, and disconnect the three straps at the front of the coil.

- (d) Grasping the coil with one hand, remove the two Phillips screws holding the tuning coil assembly to the side of the chassis.
- (e) Remove the tuning coil assembly, and remove its coupling half.
- (f) Assemble the coupling half to the shaft of the new coil assembly using the two setscrews. Manually position the new tuning coil assembly so that it is in the same position as the old one (with the coil at its rear end stop).
- (g) Fasten the new tuning coil assembly to the side of the chassis with the two Phillips screws. Do not tighten the screws.
- (h) Connect the straps at the front of the coil.
- (i) Install the Coil Drive Assy, mating the coil drive coupling to the coil shaft coupling with the phenolic key. If the two couplings do not line up, rotate the coil shaft until they do. DO NOT ROTATE THE COIL DRIVE COUPLING.
- (j) Tighten the Coil Drive Assy mounting screws.

APPENDIX A

CHECKS PERFORMED DURING THE AUTOMATIC BIT ROUTINE FOR THE 1 KW LPA

NOTE

If BIT is initiated during WARMUP, only the tests up to and including the Band Switch/Servo Coil Test are performed.

- 1. Front Panel Test. At the start of the test, the front panel is disabled and remains so for the remainder of the test. Also at the start of the test, all front panel LCD segments and LED indicators are turned on. They stay on for the remainder of the test with the exception of the condition when tune power is requested from the 100 Watt Transceiver (see "Keying Test").
- 2. <u>Micro Control Test.</u> The microprocessor is checked. If its operation is determined to be incorrect, FAULT 2-01 is declared.
- 3. <u>Primary Power Test.</u> The primary power level is sampled. If it is not between 80 and 120% of the nominal value, FAULT 2-03 is declared.
- 4. Low Voltage Supply Test. The 13.5 V supply is sampled. If it is not between 10 and 16 Vdc, FAULT 2-04 is declared.
- 5. <u>Transmitter Fault Test.</u> If the XMTR-FAULT signal line (temperature sensor) is active, FAULT 2-05 is declared.
- 6. Band Switch/Servo Coil Test. For this test, a band other than the current operating band is selected for the band switch. Once this position is reached, the switch returns to the current operating band position. If the switch does not turn, or if it takes over 10 seconds to reach the selected band, FAULT 2-06 is declared. The coil is moved to MIN L and then to MAX L, and the coil position counter is checked at both limits. If the coil does not move, or if the position counter is inaccurate, FAULT 2-07 is declared. If the 1 KW LPA is in WARMUP, no further testing is done.
- 7. <u>High Voltage Test.</u> With the 1 KW LPA in STANDBY, FAULT 2-08 is declared if the DC plate voltage is greater than 100 volts. The 1 KW LPA is put into OPERATE. If the DC plate voltage is not between 2000 and 5000 volts, FAULT 2-09 is

declared. If the plate current is greater than 5 mA, FAULT 2-10 is declared.

- 8. <u>Bias Test.</u> The power amplifier bias is turned on (the LPA is keyed without RF drive). If the plate current is not between 20 and 150 mA, FAULT 2-11 is declared.
- 9. Keying Test. An RF MUTE message is sent to the 100 Watt Transceiver. If the RF input signal level is not below 6 watts in 200 milliseconds. FAULT 2-12 is declared. If the RF input falls below 6 watts, the T/R relay is keyed and the RF MUTE signal is removed. Tune Power Request (TPR) and Transmit Gain Control Tune Power Request (TGC TPR) messages are sent to the 100 Watt Transceiver. The message "rF" is sent to the METER LCD display to let the operator know that RF input power is required to complete the test. This message remains until the RF input signal level is greater than 5 watts. If the RF input signal is not greater than 5 watts in 20 seconds. FAULT 2-13 is declared. If the RF input signal level is sufficient, the power amplifier plate current is checked. If the power amplifier plate current is not between 325 mA and 480 mA, FAULT 2-14 is declared. The DC plate voltage is checked again at this point; and if it is not within the previously specified limits for the OPERATE mode (2000 to 5000 Vdc), FAULT 2-09 is declared.
- 10. <u>Tuning Test.</u> A TGC Lock command is sent to the 100 Watt Transceiver. Using the auto-tuning software, the coil is moved toward MIN L while searching for a tune peak. If no tune peak is found, FAULT 2-15 is declared. When the tune peak is found, forward power is checked. If the forward power is not between 100 watts and 400 watts, FAULT 2-16 is declared. If the forward power is normal, the VSWR is checked. If the VSWR is not less than 2.25:1, FAULT 2-17 is declared. If the VSWR is normal, the ratio of forward power to RF input power is checked. This ratio must be between 5

and 60. If not, FAULT 2-18 is declared. Tune Power Request Off, TGC Tune Power Request Off, and TGC Lock Off commands are sent to the 100 Watt Transceiver when this part of the test is completed.

11. <u>Transceiver Serial Link Test.</u> As in normal operation, certain failures in the serial link to the transceiver during the BIT test cause FAULT 2-21 to be declared.

12. Test Completion.

- (a) The BIT tests described in the above paragraphs are continued until a fault is encountered. When a fault is flagged, all further testing is aborted.
- (1) If the BIT test was initiated from the 100 Watt Transceiver, the fault code is displayed on the transceiver LCD display. The fault code will also appear on the LPA's LCD display if the METER selector switch is placed in the STATUS/FAULT position. The fault code may be cleared by commanding the LPA to OPERATE from the 100 Watt Transceiver or by moving the METER selector switch out of the STATUS/FAULT position.
- (2) If the BIT test was initiated from the LPA, the fault code is displayed on the LPA's front panel meter. The fault code will also

appear on the transceiver's LCD display if "2ND," "TEST" is pressed. To remove the LPA from the test mode, the METER selector switch must be moved out of the STATUS/FAULT position. The fault code may be cleared by commanding the LPA to OPERATE from the 100 Watt Transceiver (if the LPA is placed back in AUTO) or by moving the METER selector switch to the STATUS/FAULT position and then out again.

- (b) If no fault is encountered during any of the tests, the following occurs:
- (1) If the BIT test was initiated from the 100 Watt Transceiver, the message "PASSEd" is displayed on the transceiver front panel for 5 seconds; and the LPA front panel returns immediately to its normal operating mode.
- (2) If the BIT test was initiated from the LPA, the message "PASS" is displayed on the meter. The message will remain there as long as the METER selector switch is in the STATUS/FAULT position. When the selector switch is moved out of the STATUS/FAULT position, the message disappears and the LPA front panel returns to its normal operating mode.

APPENDIX B

Meter Functions and Normal Operating Ranges

Position	Function	Range/Units	Normal (Stby/ Warmup)	Normal (Operate, Keyed in CW)
PRI PWR (%)	Displays the average primary power input as a percentage of the nominal value	0% to 166%	90 to 110	90 to 110
13.5 VDC	Displays the average output of the low voltage power supply	0 to +22 Vdc	11 to 16	11 to 16
DC PLATE (VOLTS)	Displays the average plate voltage of the power amplifier tube	0 to +5000 Vdc	0	2400 to 3200 ⁽¹⁾
¹K	Displays the average cathode	0 to 2000 mA	0	700 to
	(plate) current of the power amplifier tube	1		1100 ⁽¹⁾
RF IN (WATTS)	Displays the peak RF input power from the 100 Watt Transceiver	0 to 250 W	0 to 100 ⁽²⁾	40 to 100 ⁽¹⁾
RF PLATE (VOLTS)	Displays the peak RF voltage at the plate of the power amplifier tube (with respect to the average DC voltage)	0 to 5000 Vdc	0	1800 to 2400 ⁽¹⁾
FWD PWR (WATTS)	Displays the peak forward power at the RF output	0 to 1500 W	0	900 to 1100
REFL PWR (WATTS)	Displays the peak reflected power at the RF output	0 to 1500 W	0	0 to 100, depending on load ⁽¹⁾
ANT VSWR	Displays the peak ratio of the mismatch between the 1 KW LPA and its load, be it antenna, antenna coupler, or dummy load	1:1 to 999:1	0	1:1 to 2:1 ⁽¹⁾
COIL POS	Displays the servo coil position	100 to 1770	See Figure 3-1	See Figure 3-1
STATUS/ FAULT	Displays a fault code. If the FAULT light is lit and the meter is switched to the STATUS/FAULT position, a fault code will be displayed. When the selector switch is moved out of the STATUS/FAULT position, the fault code will be cleared and the FAULT light will be turned off.	Fault codes		

⁽¹⁾ With a power output of 1 KW, as indicated on the FWD PWR meter.

⁽²⁾ With the transceiver keyed; otherwise, the reading will be 0 W.

CHAPTER 7

ILLUSTRATED PARTS BREAKDOWN

Section 1. INTRODUCTION

- **7-1. PURPOSE.** This chapter lists, illustrates, and describes the detail parts for the 1 KW LPA. Its purpose is for the identification, requisitioning, and issuance of parts at the depot level.
- 7-2. SCOPE. Bulk electrical items, such as terminals, wire, heat shrink tubing, etc., are not listed in this manual. Common hardware items, such as screws, washers, nuts, etc., when used to attach structural components that are not normally removed or disassembled, are also not listed. In general, the parts installed at the time the 1 KW LPA was manufactured are listed and identified in this chapter. When a part (including vendor items), which is different from the original, was installed during the manufacture of later items, series, or blocks, all parts are listed (and "Usable-On" coded). However, when the original part does not have continued application (no spares of the original were procured or such spares are no longer authorized for replacement), only the preferred part is listed. Also, when a part was installed during modification, and the original does not have continued application, only the preferred item is listed. Interchangeable and substitute parts. subsequently authorized by the Government, are not listed in this chapter; such items are identified by information available through the Interchangeable and Substitute (I & S) Data Systems. Refer to T.O. 00-25-184. When a standard size part can be replaced with an oversize or undersize part, the latter parts, showing sizes, are also listed. Repair Parts Kits
- and Quick Change Units are listed when they are available for replacement.
- 7-3. CHAPTER ORGANIZATION. This chapter is divided into two sections. Section I, INTRODUCTION, explains the purpose, scope, and organization of the chapter. Section II. MAINTENANCE PARTS LIST, consists of illustrations, in which the detail parts of the 1 KW LP are identified by numbers (called index numbers). followed by lists which contain parts numbers, descriptions, and other relevant data for the items identified on the illustrations. Section II also contains two other lists: A numerical index, which lists the parts in alphanumerical sequence; and a reference designator index, which lists the electrical parts in alphabetical sequence by their reference designators.
- 7-4. SOURCE, MAINTENANCE, AND RECOVERABILITY (SMR) CODES. This chapter contains Air Force Peculiar In-Being Source and Repair Codes only. Definitions of these SMR codes, as well as detailed coding criteria and transposition matrices for each coding method, may be obtained from T.O. 00-25-195. Refer to page 7-13.
- 7.5. FEDERAL SUPPLY CODES FOR MANUFACTURERS (FSCM). The codes used in this chapter are as follows. The first list is in numerical order by FSCM; the second is in alphabetical order by manufacturer name.

FSCM	NAME AND ADDRESS	02660	Bunker Ramo-Eltra Corporation Amphenol Division 2801 S. 25th Avenue	06980	Varian Associates, Inc. EIMAC Division 301 Industrial Way
00000	Ordnance Corps The Defense Logistics Services Center	02735	Broadview, IL 60153 RCA Corporation	07263	San Carlos, CA 94070 Fairchild Camera and Instrument
00141	PIC Design Corporation Division of Wells-Benrus Corporation Benson Road	02,00	Solid State Division Route 202 Somerville, NJ 08876	0,235	Corporation Semiconductor Division Subsidiary of Schlumberger LTD
	P.O. Box 1004 Middlebury, CT 06762	02768	Illinois Tool Works, Inc. Fastex Division		North American Sales Mail Stop 14-1053 401 Ellis Street
00159	Acme Electric Corporation Cuba, NY		195 Algonquin Road Des Plaines, IL 60016		P.O. Drawer 7284 Mountain View, CA 94042
00213	Nytronics Components Group, Inc. Subsidiary of Nytronics Inc. Orange Street Darlington, SC 29532	03508	General Electric Company Semi-Conductor Products Department W. Genesee Street Auburn, NY 13021	07707	USM Corporation Subsidiary of Emhart Industries, Inc. USM Fastener Division 510 River Road Shelton, CT 06484
00348	Microtran Co., Inc. 145 E. Mineola Avenue P.O. Box 236 Valley Stream, NY 11582	03888	Pyrofilm Division Division of KDI Electronics Inc. 60 S. Jefferson Road Whippany, NJ 07981	07858	Arrow Hart Canada LTD Scarborough, Ontario Canada M8Z 2R4
00493	Sargent Art Division of Mead Corporation Hazleton, PA	04009	Crouse-Hinds Arrow Hart Inc. Arrow Hart Division 103 Hawthorn Street Hartford, CT 06105	08289	Blinn Delbert Company, Inc. The 1678 E. Mission Blvd. P.O. Box 2007 Pornona, CA 91769 5065
00752	Eaton Corporation All Division Lond Island Plants Commack Road Deer Park, L.I., NY 11729	04222	AVX Ceramics Division of AVX Corporation 19th Avenue South P.O. Box 867	08484	Breeze-Eastern Corporation Subsidiary of Transtechnology Corporation 700 Liberty Avenue Union, NJ 07083
00758	Neilsen Products Company Lake Elmo, MN		Myrtle Beach, SC 29577	08544	United Shoe Machinery Corporation
00779	AMP, Inc. 2800 Fulling Mill P.O. Box 3608 Harrisburg, PA 17105	04386	Litton Industries, Inc. Litton Systems Inc. Triad-Utrad Division 305 N. Briant Street Huntington, IN 46750	08779	Cincinnati, OH Signal Transformer Company, Inc. 500 Bayview Avenue Inwood, NY 11696
00853	Sangamo Weston, Inc. Sangamo Capacitor Division Subsidiary of Schlumberger LTD Sangamo Road	04426	Licon Division of Illinois Tool Works, Inc. 6615 W. Irving Park Road Chicago, IL 60634	09023	Cornell-Dubiller Electronics 118 E. Jones Street Fuquay-Varina, NC 27526
	P.O. Box 128 Pickens, SC 29671	04713	Motorola, Inc. Semiconductor Products	09166	Stone City Products, Inc. 1206 7th Street P.O. Box 369
01009	Alden Products Company 117 N. Main Street P.O. Box 860		Sector 5005 E. McDowell Road Phoenix, AZ 85008	09214	Bedford, IN 47421 General Electric Company
01295	Brockton, MA 02403 Texas Instruments Inc.	05326	General Electric Company Aviation Service Operation/CINT!		Semi-Conductor Products Department Power Components Operation
	Semiconductor Group 13500 N. Central Expressway P.O. Box 225012 M/S 49		333 W. Seymour Avenue Cincinnati, OH 45216		W. Genesee Street Auburn, NY 13021
01961	Dallas, TX 75265 Varian Associates, Inc. Pulse Engineering Subsidiary	05828	General Instrument Corporation Government Systems Division 600 W. John Street Hicksville. NY 11802	09353	C and K Components, Inc. 15 Riverdale Avenue Newton, MA 02158
2011	7250 Convoy CT P.O. Box 12235 San Diego, CA 92112	06090	Raychem Corporation 300 Constitution Drive Menlo Park, CA 94025	10026	CSI Capacitors A Division of CSI Technologies, Inc. Del Dios Highway P.O. Box 2052
02111	Spectrol Electronics Corporation Subsidiary of Carrier Corporation 17070 E. Gale Avenue P.O. Box 1220 City of Industry, CA 91749	06383	Panduit Corporation 17301 Ridgeland Tinley Park, IL 60477	10054	Escondido, CA 92025 Marson Corp 130 Crescent Avenue Chelsea, MA 02150
02114	Amperex Electronic Corporation Ferroxcube Division 5083 Kings HWY	06402	E-T-A Circuit Breakers 7400 N. Croname Road Chicago, IL 60648	11195	Magna Division Vermont American Corporation 1001 West Park Road
	Saugerties, NY 12477	06540	Mite Corporation		Elizabethtown, KY 42701
02289	HI-G Company Subsidiary of Nytronics Inc. 101 Locust Street Hartford, CT 06114		Amatom Electronic Hardware Division 446 Blake Street New Haven, CT 06515	11236	CTS of Berne, Inc. 406 Parr Road Berne, IN 46711

11897	Plastiglide Manufacturing Corporation 2701 W. El Segundo Blvd. Hawthorne, CA 90250	16546	Centralab, Inc. A North American Philips Company 4561 Colorado Los Angeles, CA 90039	21340	ITT Telecom Products Corporation Network Systems Division HWY 137 Suncrest Drive P.O. Box N Carroll Reece Station
12040	National Semiconductor Corporation Commerce Drive P.O. Box 443	16733	Cablewave Systems, Inc. 60 Dodge Avenue North Haven, CT 06473	22526	Johnson City, TN 37601 Du Pont E I De Nemours and Company, Inc.
10000	Danbury, CT 06810	16741	Triad Transformer Corporation		Photo Products Department Berg Electronics Division
12909	Cardion Electronics Division of General Signal Controls, Inc.	17117	Huntington, IN Electronic Molding Corporation		Route 83 New Cumberland, PA 17070
	A Unit of General Signal Corporation Long Island Expressway Woodbury, NY 11797		96 Mill Street Woonsocket, RI 02895	22701	Bestran Corporation Dilectron Division 2669 So. Myrtle Avenue
		17856	Siliconix, Inc.		Monrovia, CA 91016
12969	Unitrode Corporation 580 Pleasant Street Watertown, MA 02172		2201 Laurelwood Road Santa Clara, CA 95054	22903	Singer Company The Link Flight Simulation Division
	170.00.00011, 170.10217.0	18212	American Trans-Coil Corporation		Advanced Products Operation
13103	Thermalloy Company, Inc. 2021 W. Valley View Lane	10212	124-06 101st Avenue Richmond Hill, NY 11419		1077 E. Arques Avenue P.O. Box 3484
	P.O. Box 340839				Sunnyvale, CA 94088
	Dallas, TX 75234	18324	Signetics Corporation		0
13499	Rockwell International Corporation Collins Telecommunications		Military Products Division 4130 S. Market Court Sacramento, CA 95834	24446	General Electric Company 3135 Easton Turnpike Fairfield, CT 06431
	Products Division	40700	mon o	0.50	0
	Defense Electronics Operations 855 NE 35th Street	18722	RCA Corporation Solid State Division	24546	Corning Glass Works 550 High Street
	Cedar Rapids, IA 52498		Crestwood Road		Bradford, PA 16701
13764	Micro Plastics, Inc.		Mountaintop, PA 18707	25330	General Connector Corporation
13704	HWY 178 N.	18796	Murato Erie Technological Products	23330	Subsidiary of the Union Corporation
	Flippin, AR 72634	10.00	State College Operations 1900 W. College Avenue		80 Bridge Street Newton, MA 02158
14304	Harris Corporation		State College, PA 16801		
	RF Communications Division	40070	Danie durant of A	25403	Amperex Electronic Corporation
	1680 University Avenue Rochester, NY 14610	18876	Department of Army U.S. Army Missile Command		Semiconductor Solid State and Active Devices-Electro
	Hochester, NY 14610		Redstone Arsenal, AL 35809		Optical Devices
14519	Designatronics, Inc.		riodatorio Piradriar, AL 00000		Providence Pike
	55 S. Denton Avenue	18915	Birtcher Corporation		Slatersville, RI 02876
	New Hyde Park, NY 11040		The Industrial Division		
4.4655	Council Dubling Stantonics		4501 N. Arden Drive	26066	Minnesota Mining and Manfacturing
14655	Cornell-Dubilier Electronics Division of Federal Pacific Electric		P.O. Box 4399 El Monte, CA 91734		Company Industrial Tape Division
	Company		El Molle, OA 31704		3M Center
	Government Contracts Department	19200	U.S. Army Armament Research and		St Paul, MN 55101
	150 Ave L		Development Command		A Pro- Control
	Newark, NJ 07101		Dover, NJ 07801	26344	Mite Corporation 466 Blake Street
14674	Corning Glass Works	19207	U.S. Army Tank Automotive		New Haven, CT 06515
	Houghton Park		Command Warran MI 49999	26667	Litton Industries, Inc.
	Corning, NY 14830		Warren, MI 48090	20007	Triad Distributor Division
14933	Defense Electronics Supply Center	19396	Illinois Tool Works, Inc.		Huntington, IN
	Dayton, OH 45401		Paktron Division	07044	Mating at Company to the Company tion
15542	Mini-Circuits Laboratory		900 Follin Lane S.E. Vienna, VA 22180	27014	National Semiconductor Corporation 2900 Semiconductor Drive
10042	Division of Scientific Components		10111121100		Santa Clara, CA 95051
	Corporation	19647	Caddock Electronics, Inc.		
	2625 E. 14th Street		1717 Chicago Avenue	27264	Molex, Inc.
	Brooklyn, NY 11235		Riverside, CA 92507		2222 Wellington Court Lisle, IL 60532
15801	Fenwal Electronics	19701	Mepco/Electra, Inc.		2.0.0, 12.0000
	Division of Kidde Walter and		A North American Philips Company	27777	Varo, Inc.
	Company, Inc.		P.O. Box 760		Electron Devices Division
	63 Fountain Street		Mineral Wells, TX 76067		2203 Walnut Street P.O. Box 401146
	Framingham, MA 01701	21052	High Energy Corporation		Garland, TX 75040
15912	T and B/Ansley Corporation	_,,,,_	Subsidiary of Inductotherm		
	Subsidiary of Thomas and Betts		Corporation	28124	Minnesota Mining and Manufacturing
	Corporation		Lower Valley Road		Company
	4371 Valley Blvd.		Parkesburg, PA 19365		Industrial Coated Abrasives Division 3M Center
	Los Angeles, CA 90031	21317	Electronic Applications Company		St. Paul, MN 55101
15969	Dixie Chemical Company	£1017	4918 Santa Anita Avenue		-11. day 11.100 (0)
	3635 W. Dallas Street		El Monte, CA 91734		
	Houston, TX 77019				

28480	Hewlett-Packard Company Corporate HQ 3000 Hanover Street Palo Alto, CA 94304	34649	Intel Corporation 3065 Bowers Avenue Santa Clara, CA 95051	54254	Minnesota Mining and Manufacturing Company Data Recording Products Division 350 S. Lewis Road
	Faio Aito, CA 94304	34899	Coir Dita Dendusta Cornection		
28482	Electronic Laboratory Supply Company	34099	Fair-Rite Products Corporation 1 Commercial Row Wallkill, NY 12589	54473	Camarillo, CA 93010 Matsushita Electric Corporation of
	7208 Germantown Avenue Philadelphia, PA 19119	37695	Magnavox Government and		America One Panasonic Way
28520	Heyco Moided Products		Industrial Electronics Co. 1313 Production Road		P.O. Box 1501 Secaucus, NJ 07094
	1750 Blvd. P.O. Box 160		Fort Wayne, IN 46808	54904	Eltra Corporation Subsidiary of Allied Chemical
	Kenilworth, NJ 07033	44122	LXD		Company
29964	Allied Devices Corporation 2365 Milburn Avenue		24500 High Point Road Cleveland, OH 44122		Medwec Division 105 Skyport Drive
	P.O. Drawer E.	44655	Ohmite Manufacturing Company		P.O. Box 417
	Baldwin, NY 11510	44000	3601 W. Howard Street Skokie, IL 60076	55000	Scottsbluff, NE 69361
30142	Minnesota Mining and Manufacturing		,	55002	Power Conversion, Inc. 495 Boulevard
	Company Energy Systems	46384	Penn Engineering and Manfacturing Corporation		Elmwood Park, NJ 07407
	3M Center Bldg, 551		Old Easton Road	55285	The Bergquist Company, Inc.
	St. Paul, MN 55101		P.O. Box 1000		5300 Edina Industrial Blvd.
31433	Union Carbide Corporation		Danboro, PA 18916		Minneapolis, MN 55435
	Electronics Division	49671	RCA Corporation	55322	Samtec, Inc.
	HWY 276 SE P.O. Box 5928		30 Rockefeller Plaza		810 Progress Blvd.
	Greenville, SC 29606		New York, NY 10020		P.O. Box 1147
		50157	Midwest Components, Inc.		New Albany, IN 47150
31922	Leeds and Northrup Company		1981 Port City Blvd.	55566	RAF Electronic Hardware, Inc.
	A Unit of General Signal Corporation Sumneytown Pike		P.O. Box 787 Muskegon, MI 49443	35550	95 Silvermine Road Seymour, CT 06483
	North Wales, PA 19454	F0470	Don't Changle Catalana da an		35,50., 61.55.55
32039	Zeus Industrial Products, Inc.	50173	Curt Straub Enterprises 444 W. Ocean Blvd.	56289	Sprague Electric Company
	Ft. Thompson Street		Suite 1106		87 Marshall Street
	Raritan, NJ 08869		Long Beach, CA 90802		North Adams, MA 01247
32097	PCC Pertec Division	50434	Hewlett-Packard Company	56637	RCD Components, Inc.
32037	Pertec Computer Corporation	50434	Optoelectronics Division		330 Bedford Street
	9600 Irondale Avenue		640 Page Hill Road		Manchester, NH 03101
	Chatsworth, CA 91311		Palo Alto, CA 94304	56699	Mepco/Electra, Inc.
32284	Rotron Controls	51144	IDI Electric Canada LTD		6071 St. Andrews Road
-32204	Division Rotron, Inc.	31144	33 Fuller Road		Columbia, CS 29210
	Woodstock, NY		Box 159	57074	Alberox Corporation
32293	Intersil Inc.		Ajax, Ontario Canada L1S 2E1	37074	New Bedford, MA
32233	Subsidiary of General Electric	51984	NEC America, Inc.	E700E	A Pilla - Cit inia-
	Company		2741 Prosperity Avenue	57285	Millen Division Electronic Instrument and Specialty
	10710 N. Tantau Avenue		Fairfax, VA 22031		Corporation
	Cupertino, CA 95014	52458	Magnum Electric Corporation		42 Pleasant Street
32848	Thompson Industries	32430	6385 Dixie HWY		Stoneham, MA 02180
	Division of WMF Container		Erie, MI 48133	57771	Stimpson Company, Inc.
	Corporation	coero	Materials Or manths	0,,,,	900 Sylvan Avenue
	2501 E. Magnolia Street Phoenix, AZ 85036	52559	Metraplex Corporation Berkshire Industrial Park		Bayport, NY 11705
	r riscriik, M2 00000		Bidg. 3	57921	Bourns, Inc.
3 289 0	Luminescent Systems Inc.		Bethel, CT 06801	3/921	Precisions/Controls Division
	Etna Road	E0700	Minnesoto Mining and Manufacturing		1200 Columbia Avenue
	Grafton County Lebanon, NH 03766	52760	Minnesota Mining and Manufacturing Company		Ríverside, CA 92507
			Electro Products Division	57922	Bourns, Inc.
32997	Bourns, Inc.		341 Factory Road	0.022	Precisions/Controls Division
	Trimpot Division 1200 Columbia Avenue		Addison, IL 60101		1200 Columbia Avenue
	Riverside, CA 92507	53373	Midland-Ross Corporation		Riverside, CA 92507
	·		Cambion Division	57924	Bourns, Inc.
34335	Advanced Micro Devices		Barnstead Road		Networks Division
	901 Thompson Place Sunnyvale, CA 94086		Pittsfield, NH 03263		12155 Magnolia Avenue
	Called Adia OV SHOOD	53894	Aham, Inc.		Riverside, CA 92503
34553	Amperex Electronic Corporation		27901 Front Street	58167	Palco Connector, Inc.
	Component Division		Rancho California, CA 92390	_ 5.0,	75 Center Street
	Hauppauge, NY				Bristol, CT 06010

59076	Designatronics, Inc. Stock Drive Products Division 55 S. Denton Avenue New Hyde Park, NY 11040	63312	Endicott Research Group, Inc. 2601 Wayne Street P.O. Box 269 Endicott, NY 13760	72819	Carborundum Company The Electrical Products Division Globar Plant 3425 Hyde Park Blvd.
59730	Thomas and Betts Corporation HWY 218 S.	70485	Atlantic India Rubber Works, Inc. 571 W. Polk Street	70005	P.O. Box 339 Niagara Falls, NY 14302
50050	lowa City, IA 52240	70.40.4	Chicago, IL 60607	72835	Gochenaur Marine Company Philadelphia, PA
59950	Shielding Technology, Inc. Subsidiary of Chomerics, Inc. 120 Ethel Road W. Piscataway, NJ 08854	70494	Emhart Industries, Inc. Hardware Division 225 Episcopal Road Berlin, CT 06037	72962	Amerace Corporation Esna Division 2330 Vauxhall Road Union, NJ 07083
59993	International Rectifier Semiconductor Division 233 Kansas Street El Segundo, CA 90245	70903	Belden Corporation Subsidiary of Cooper Industries, Inc. 2000 S. Batavia Avenue Geneva, IL 60134	72982	Murata Erie North America, Inc. Erie Operations 645 W. 11th Street Erie, PA 16512
60705	Cera-Mite Corporation 1327 6th Avenue Grafton, WI 53024	70983	Bethlehem Steel Corporation Shipbuilding Department Room 1000 Martin Tower Bethlehem, PA 18016	73138	Beckman Instruments, Inc. Beckman Electronic Technologies Subsidiary of Smith Kline/Beckman
60963	Niagara Straw Company, Inc. 72 Lakeview Avenue Buffalo, NY 14201	71041	Incom International, Inc. Boston Gear Division, Inc. 14 Hayward Street		Corporation 2500 Harbor Blvd. Fullerton, CA 92634
61306	Silvered Electronic Mica Company, Inc. RT 6	71279	Quincy, MA 02171 Midland-Ross Corporation	73734	Federal Screw Products, Inc. 3917 N. Kedzie Avenue Chicago, IL 60618
61429	Willimantic, CT 06226 Fox Electronics		Cambion Division One Alewife Place Cambridge, MA 02140	73899	JFD Electronic Components A Division of Murata Erie North
01420	Fox Enterprises, Inc. P.O. Box 1078 Cape Coral, FL 33910	71400	Bussmann Division of McGraw-Edison Company 114 Old State Road		America 112 Mott Street Oceanside, NY 11572
61463	Uniroyal, Inc. Oxford Management and Research Center		P.O. Box 14460 St. Louis, MO 63178	73905	ITT Jennings 970 McLaughlin Avenue San Jose, CA 95116
24500	Benson Road Middlebury, CT 06749	71450	CTS Corporation 905 N. West Blvd. Elkhart, IN 46514	73988	The Harrington And King Perforating Company, Inc.
61529	Aromat Corporation 250 Sheffield Street Mountainside, NJ 07092	71468	ITT Cannon Electric Division of International Telephone	74199	5655 Fillmore Street Chicago, IL 60644 Quam Nichols Company
61587	Hughes Electronic Devices Corporation 13321 Grass Valley Avenue		and Telegraph Corporation 10550 Talbert Avenue P.O. Box 8040 Fountain Valley, CA 92708		218 E. Marquette Road Chicago, IL 60637
61725	P.O. Box 185 Grass Valley, CA 95945 ITT Components Division	71785	TRW, Inc. TRW Cinch Connectors Division 1501 Morse Avenue	74276	General Instrument Corporation Lamp Division/Worldwide 4433 N. Ravenswood Avenue Chicago, IL 60640
01725	International Telephone and Telegraph Corporation 3201 S. Standard Street	71895	Elk Grove Village, IL 60007 Delavan Corporation	74840	Illinois Capacitor, Inc.
	P.O. Box 2197 Santa Ana, CA 92707	71033	811 Fourth Street P.O. Box 100 West Des Moines, IA 50265		3757 W. Touhy Avenue Lincolnwood, IL 60645
61735	Pulse Engineering, Inc. 5004 Lehigh Road College Park, MD 20740	72136	Electro Motive Corporation Subsidiary of International Electronics Corporation	74868	Amphenol RF Operations An Allied Company 33 E. Franklin Street Danbury, CT 06810
61802	Toshiba Internation Industrial Division 13131 W. Little York Road	72619	Florence, SC Dialight Division Amperex Electronic Corporation	74970	Johnson EF Company 299 10th Avenue SW Waseca, MN 56093
61957	P.O. Box 40906 Houston, TX 77041		203 Harrison Place Brooklyn, NY 11237	75042	TRW, Inc. TRW Electronic Components
01937	USM Corporation Subsidiary of Emhart Industries, Inc. 140 Federal Street Boston, MA 02107	72634	Dielectric Products Company, Inc. Jersey City, NJ		IRC Fixed Resistors Philadelphia Division 401 N. Broad Street
62703	Varo Semiconductor, Inc. Subsidiary of Varo, Inc. 1000 N. Shiloh Road	72794	Dzus Fastener Company, Inc. 425 Union Blvd. West Islip, NY 11795	75263	Philadelphia, PA 19108 Keystone Carbon Company 1935 State Street
	P.O. Box 40676 Garland, TX 75040				St. Marys, PA 15857

75378	CTS Knights, Inc. 400 Reimann Avenue Sandwich, IL 60548	80045	Cincinnati Electronics Corporation Subsidiary of GEC, Inc. An English Electric Corporation Company	83325	SNC Manufacturing Company, Inc. 101 Waukau Road Oshkosh, WI 54901
75382	Kulka Electric Corporation A North American Philips Corporation Mt. Vernon, NY		2630 Glendale-Milford Road Cincinnati, OH 45241	83330	Kulka Smith, Inc. A North American Philips Company 1913 Atlantic Avenue
75045	Towns of Small and In	80063	U.S. Army Communications And		Manasquan, NJ 08736
75915	Tracor Littelfuse, Inc. 800 E. Northwest HWY Des Plaines, IL 60016		Electronics Materiel Readiness Command Logistics Engineering Directorate Fort Monmouth, NJ 07703	84830	Lee Spring Company, Inc. 1462 62nd Street Brooklyn, NY 11219
76301	McDonnel Douglas Corporation				• •
	McDonnel Aircraft Company P.O. Box 516 St. Louis, MO 63166	80101	General Electronics, Inc. Paterson, NJ	86797	Rogan Corporation 3455 Woodhead Drive Northbrook, IL 60062
76385	Minor Rubber Company, Inc.	80103	Veeco Instruments, Inc. Lambda Electronics Division	86928	Seastrom Manufacturing Company.
70003	49 Ackerman Street Bioomfield, NJ 07003		515 Broad Hollow Road Melville, NY 11747	80928	Inc. 701 Sonora Avenue Glendale, CA 91201
76490	Moto Meter Gauge and Equipment	80294	Bourns Instruments, Inc.		Cicidale, OA 31201
	Division Electric Auto Lite Company New York, NY		135 Magnolia Avenue Riverside, CA 92506	89032	Eaton Corporation Engineered Fasteners Division 8700 Brookpark Road
		80372	Marine Corps.		P.O. Box 6688
77264	Phoenix Specialty Manufacturing Company, Inc.		Navy Annex Washington, DC 20380		Cleveland, OH 44101
	971 Stewart Avenue		Washington, DC 20360	89110	AMP, Inc.
	Garden City, LI, NY 11530	81073	Grayhill, Inc.	33.73	Capitron Division
77342	ANIC Inc		561 Hillgrove Avenue		1595 S. Mt. Joy Street
11042	AMF, Inc. Potter and Brumfield Division		P.O. Box 10373 La Grange, IL 60525		Elizabethtown, PA 17022
	200 Richland Creek Drive		•	89265	AMF, Inc.
	Princeton, IN 47671	81095	Triad-Utrad Division Litton Systems, Inc.		Potter and Brumfield Division 200 Richland Creek Drive
77347	Poulsen and Wardon, Inc. Los Angeles, CA		National City, CA		Princeton, IN 47671
77609	RCA Corporation	81249	Library Efficiency Corporation New York, NY	90372	Wakefield Engineering Company P.O. Box 818
77009	RCA Service Company		New Tork, NT		Coeur D Alene, ID 83814
	RTE 38	81349	Mil Spec		
	Cherry Hill, NJ 08358	81483	International Rectifier	91506	Augat, Inc. 33 Perry Avenue
77820	Allied Amphenol Products	01403	9220 Sunset Blvd.		P.O. Box 799
	Bendix Connector Operations		Los Angeles, CA 90069		Attleboro, MA 02703
	40-60 Delaware Street Sidney, NY 13838	81564	Artted Company, Inc.	91836	Kings Electronics Company, Inc.
	Sidney, 147 10000	01304	50 Warehouse Street	31000	40 Marbledale Road
78488	The Stackpole Corporation		Springfield, MA 01118		Tuckahoe, NY 10707
	201 Stackpole Street St. Marys, PA 15857	81814	Zierick Manufacturing Company	91929	Honeywell, Inc.
	• '	31014	Radio Circle	31323	Micro Switch Division
79061	Vaco Products Company		Mt. Kisco, NY 10549		11 W. Spring Street
	1510 Skokie Blvd. Northbrook, IL 60062	82389	Switchcraft, Inc.		Freeport, IL 61032
	TO E IS OS IN THE STATE OF THE	02000	Subsidiary of Raytheon Company	92891	Alliance Engineering, Inc.
79136	Waldes Kohinoor, Inc 47-16 Austel Place		5555 N. Elstron Avenue Chicago, IL 60630		Alliance, OH
	Long Island City, NY 11101		Chicago, il 60030	92967	Hutchens Industries, Inc.
		82415	Airpax Corporation		215 N. Patterson Avenue
79218	Waterous Company 300 John E. Carroll Avenue E.		Frederick Division A North American Philips Company		P.O. Box 1427 SSS Springfield, MO 65805
	South St. Paul, MN 55075		Husky Park		Springheid, INO 03003
			P.O. Box 500	93958	Republic Electronics Corporation
79963	Zierick Manufacturing Company Radio Circle		Frederick, MD 21701		176 E. 7th Street Paterson, NJ 07524
	Mt. Kisco, NY 10549	82877	Rotron, Inc.		
	·		Custom Division	94033	Lapointe Industries, Inc.
80009	Tektronix, Inc. 4900 SW Griffith Drive		7 Hasbrouck Lane Woodstock, NY 12498		Electronic Products Division 155 W. Main Street
	P.O. Box 500		·		Rockville, CT 06066
	Beaverton, OR 97077	83014	Hartwell Corporation	0.4447	Sanders Associates, Inc.
80031	Mepco/Electra, Inc.		900 S. Richfield Road Placentia, CA 92670	94117	Daniel Webster HWY South
00001	22 Columbia Road		•		Nashua, NH 03061
	Morristown; NJ 07960	83079	Amerace Corporation	94222	Southco, Inc.
			Buchanan Crimptool Products Division	34222	210 N. Brinton Lake Road
			1065 Floral Avenue		Concordville, PA 19331
			Union, NJ 07083		

94464	Masstech Corporation	99256	PEM Engineering Com	pany	AMP, Inc. 2800 Fulling Mill	00779
	Subsidiary of Transtechnology Corporation Swamp Road	99313	Los Angeles, CA Varian Associates, Inc.		P.O. Box 3608 Harrisburg, PA 17105	
	RT 313		Microwave Tube Divisi		Amperex Electronic Corporation	34553
	P.O. Box 2001 Doylestown, PA 18901		611 Hansen Way Palo Alto, CA 94303		Component Division Hauppauge, NY	
94696	Magnecraft Electric Company 5575 N. Lynch Avenue	MARKE AN	n Annocco	cou	Amperex Electronic Corporation Ferroxcube Division	02114
	Chicago, IL 60630	Acme Elec	D ADDRESS F tric Corporation	SCM 00159	5083 Kings HWY Saugerties, NY 12477	
95146	Alco Electronic Products, Inc.	Cuba, NY			•	05400
	1551 Osgood Street North Andover, MA 01845	901 Thomp		34335	Amperex Electronic Corporation Semiconductor Solid State and Active Devices-Electro	25403
95275	Vitramon, Inc.	Sunnyvale	, CA 94086		Optical Devices	
	Box 544 Bridgeport, CT 06601	Aham, Inc. 27901 Fron		53894	Providence Pike Slatersville, RI 02876	
95987	WH Brady Company	Rancho Ca	alifornia, CA 92390		Amphenol RF Operations	74868
	727 W. Glendale Avenue Milwaukee, WI 53209	Airpax Cor	poration	82415	An Allied Company 33 E. Franklin Street	
	Iviiwaukee, VVI 55209	Frederick D	Division		Danbury, CT 06810	
96214	Texas Instruments, Inc. Equipment Group	Husky Parl	nerican Philips Company k		Aromat Corporation	61529
	13500 N. Central EXPY	P.O. Box 5	00		250 Sheffield Street	01529
	P.O. Box 660246 M/S 3137 Dallas, TX 75266	Frederick,		F707.4	Mountainside, NJ 07092	
96238	Dataproducts New England, Inc.	Alberox Co New Bedfo		57074	Arrow Hart Canada LTD Scarborough, Ontario Canada M8Z 2R4	07858
90230	Barnes Park North	Ales Fiest		05440	Scarborough, Critano Canada Moz 211-	•
	Wallingford, CT 06492	1551 Osgo	onic Products, Inc. ood Street	95146	Artted Company, Inc.	81564
96804	Bell Industries, Inc.		over, MA 01845		50 Warehouse Street Springfield, MA 01118	
	JW Miller Division 19070 Reyes Avenue		ducts Company	01009	Atlantic India Rubber Works, Inc.	70485
	P.O. Box 5825	117 N. Mai P.O. Box 8			571 W. Polk Street	
	Compton, CA 90224	Brockton, I			Chicago, IL 60607	
96906	Mil Spec	Alliance Er	ngineering, Inc.	92891	Augat, Inc.	91506
97520	Basler Electric Company RT 143	Alliance, C		03.00 (33 Perry Avenue P.O. Box 799 Attleboro, MA 02703	
	P.O. Box 269		henol Products	77820		
	Highland, IL 62249		nnector Operations ware Street		AVX Ceramics Division of AVX Corporation	04222
97942	Westinghouse Electric Corporation Defense and Electronic Systems	coloring, 14	1 10000		19th Avenue South P.O. Box 867	
	Center		ices Corporation urn Avenue	29964	Myrtle Beach, SC 29577	
	Baltimore-Washington Airport	P.O. Draw			Basler Electric Company	97520
	P.O. Box 1897 MS 984 Baltimore, MD 21203	Baldwin, N	IY 11510		RT 143 P.O. Box 269	97320
98003	Nielsen Hardware Corporation	Amerace (Esna Divis	Corporation	72962	Highland, IL 62249	
	770 Wethersfield Avenue	2330 Vaux			Beckman Instruments, Inc.	73138
	P.O. Box 568 Hartford, CT 06141	Union, NJ	07083		Beckman Electronic Technologies	73130
00004		Amerace (Corporation	83079	Subsidiary of Smith Kline/Beckman	
98291	Sealectro Corporation BICC Electronics	Buchanan	Crimptool Products Divi		Corporation 2500 Harbor Blvd.	
	40 Lindeman Drive	1065 Flora Union, NJ			Fullerton, CA 92634	
	Trumbull, CT 06611				Belden Corporation	70903
98410	ETC-Molex, Inc.		Trans-Coil Corporation 1st Avenue	18212	Subsidiary of Cooper Industries, Inc.	
	Subsidiary of Molex, Inc. 5201 Richmond Road		Hill, NY 11419		2000 S. Batavia Avenue Geneva, IL 60134	
	Bedford Heights, OH 44146	AMF, Inc.		77342	•	00001
98734	Hewlett-Packard Company		Brumfield Division	710-12	Bell Industries, Inc. JW Miller Division	96804
80704	Manufacturing Division		and Creek Drive		19070 Reyes Avenue	
	Palo Alto, CA	Princeton,	H44/0/1		P.O. Box 5825 Compton, CA 90224	
99120	Plastic Capacitors, Inc.	AMF, Inc.	ID	89265	Compton, CA 90254	
· 	2623 N. Pulaski Road		l Brumfield Division and Creek Drive		Bergquist Company, Inc., The	55285
	Chicago, IL 60639	Princeton,			5300 Edina Industrial Blvd. Minneapolis, MN 55435	
99167	Sundstrand Aviation Operations	AMP, Inc.		89110	· ·	
	Unit of Sundstrand Corporation 4747 Harrison Avenue	Capitron [
	P.O. Box 7002		lt. Joy Street own, PA 17022			
	Rockford, IL 61125	L. P. COUCHIL	errigist is the			

Bestran Corporation Dilectron Division 2669 So. Myrtle Avenue Monrovia, CA 91016	22701	Cardion Electronics Division of General Signal Controls, Inc. A Unit of General Signal Corporation Long Island Expressway	12909	Department of Army U.S. Army Missile Command Redstone Arsenal, AL 35809	18876
		Woodbury, NY 11797		Designatronics, Inc.	14519
Bethlehern Steel Corporation Shipbuilding Department Room 1000 Martin Tower	70983	Centralab, Inc.	16546	55 S. Denton Avenue New Hyde Park, NY 11040	
Bethlehem, PA 18016		A North American Philips Company 4561 Colorado		Designatronics, Inc.	59076
Birtcher Corporation	18915	Los Angeles, CA 90039		Stock Drive Products Division 55 S. Denton Avenue	
The Industrial Division 4501 N. Arden Drive	10515	Cera-Mite Corporation	60705	New Hyde Park, NY 11040	
P.O. Box 4399		1327 6th Avenue Grafton, WI 53024		Dialight Division	72619
El Monte, CA 91734		Granon, 111 00024		Amperex Electronic Corporation	72015
PP - S. II - 10 1		Cincinnati Electronics Corporation	80045	203 Harrison Place	
Blinn Delbert Company, Inc. The 1678 E. Mission Blvd.	08289	Subsidiary of GEC, Inc. An English Electric Corporation Compar		Brooklyn, NY 11237	
P.O. Box 2007 Pomona, CA 91769 5065		2630 Glendale-Milford Road Cincinnati, OH 45241	עי	Dielectric Products Company, Inc. Jersey City, NJ	72634
1 011011a, CA 3 1703 3003		Cilidinali, Ort43241		dersey Only, No	
Bourns, Inc.	32997	Cornell-Dubilier Electronics	09023	Dixie Chemical Company	15969
Trimpot Division 1200 Columbia Avenue		118 E. Jones Street		3635 W. Dallas Street	
Riverside, CA 92507		Fuquay-Varina, NC 27526		Houston, TX 77019	
		Cornell-Dubilier Electronics	14655	Du Pont E I De Nemours and	
Bourns, Inc.	57921	Division of Federal Pacific Electric		Company, Inc.	22526
Precisions/Controls Division 1200 Columbia Avenue		Company Government Contracts Department		Photo Products Department Berg Electronics Division	
Riverside, CA 92507		150 Ave L		Route 83	
Daving Inc	67000	Newark, NJ 07101		New Cumberland, PA 17070	
Bourns, Inc. Precisions/Controls Division	57922	Coming Glass Works	14674	Dzus Fastener Company, Inc.	72794
1200 Columbia Avenue		Houghton Park	14074	425 Union Blvd.	12134
Riverside, CA 92507		Corning, NY 14830		West Islip, NY 11795	
Bourns, Inc.	57924	Corning Glass Works	24546	Eaton Corporation	00752
Networks Division	575 <u>2</u> 4	550 High Street	24340	AIL Division Lond Island Plants	00752
12155 Magnolia Avenue		Bradford, PA 16701		Commack Road	
Riverside, CA 92503		Crouse-Hinds Arrow Hart Inc.	04009	Deer Park, L.I., NY 11729	
Bourns Instruments, Inc.	80294	Arrow Hart Division	04009	Eaton Corporation	89032
135 Magnolia Avenue		103 Hawthorn Street		Engineered Fasteners Division	
Riverside, CA 92506		Hartford, CT 06105		8700 Brookpark Road P.O. Box 6688	
Breeze-Eastern Corporation	08484	CSI Capacitors	10026	Cleveland, OH 44101	
Subsidiary of Transtechnology		A Division of CSI Technologies, Inc.			
Corporation 700 Liberty Avenue		Del Dios Highway P.O. Box 2052		Electro Motive Corporation Subsidiary of International Electronics	72136
Union, NJ 07083		Escondido, CA 92025		Corporation	
•				Florence, SC	
Bunker Ramo-Eltra Corporation	02660	CTS Corporation	71450	Electronic Applications Company	21317
Amphenol Division 2801 S. 25th Avenue		905 N. West Blvd. Elkhart. IN 46514		4918 Santa Anita Avenue	21317
Broadview, IL 60153				El Monte, CA 91734	
Duanana	74.400	CTS Knights, Inc. 400 Reimann Avenue	75378	Floatrania Laboratani Supply	
Bussmann Division of McGraw-Edison Company	71400	Sandwich, IL 60548		Electronic Laboratory Supply Company	28482
114 Old State Road				7208 Germantown Avenue	
P.O. Box 14460 St. Louis, MO 63178		CTS of Berne, Inc. 406 Parr Road	11236	Philadelphia, PA 19119	
St. Louis, MO 63176		Berne, IN 46711		Electronic Molding Corporation	17117
C and K Components, Inc.	09353	·		96 Mill Street	
15 Riverdale Avenue		Curt Straub Enterprises	50173	Woonsocket, RI 02895	
Newton, MA 02158		444 W. Ocean Blvd. Suite 1106		Eltra Corporation	54904
Cablewave Systems, Inc.	16733	Long Beach, CA 90802		Subsidiary of Allied Chemical Company	
60 Dodge Avenue		Determinate Navy Francis Inc.	00000	Medwec Division 105 Skyport Drive	
North Haven, CT 06473		Dataproducts New England, Inc. Barnes Park North	96238	P.O. Box 417	
Caddock Electronics, Inc.	19647	Wallingford, CT 06492		Scottsbluff, NE 69361	
1717 Chicago Avenue		Defence Electronics Supply Contor	14022	Emhart Industries, Inc.	70494
Riverside, CA 92507		Defense Electronics Supply Center Dayton, OH 45401	14933	Hardware Division	70434
Carborundum Company	72819	•		225 Episcopal Road	
The Electrical Products Division		Delavan Corporation 811 Fourth Street	71895	Berlin, CT 06037	
Globar Plant 3425 Hyde Park Blvd.		P.O. Box 100		Endicott Research Group, Inc.	63312
P.O. Box 339		West Des Moines, IA 50265		2601 Wayne Street	
Niagara Falls, NY 14302				P.O. Box 269 Endicott, NY 13760	
				minute it it it it	

E-T-A Circuit Breakers 7400 N. Croname Road Chicago, IL 60648	06402	Grayhill, Inc. 561 Hillgrove Avenue P.O. Box 10373 La Grange, IL 60525	81073	Illinois Tool Works, Inc. Paktron Division 900 Follin Lane S.E. Vienna, VA 22180	19396
ETC-Molex, Inc. Subsidiary of Molex, Inc. 5201 Richmond Road Bedford Heights, OH 44146	98410	Harrington And King Perforating Company, Inc., The 5655 Fillmore Street Chicago, IL 60644	73988	Incom International, Inc. Boston Gear Division, Inc. 14 Hayward Street Quincy, MA 02171	71041
Fairchild Camera and Instrument Corporation Semiconductor Division Subsidiary of Schlumberger LTD North American Sales	07263	Harris Corporation RF Communications Division 1680 University Avenue Rochester, NY 14610	14304	Intel Corporation 3065 Bowers Avenue Santa Clara, CA 95051	34649
Mail Stop 14-1053 401 Ellis Street P.O. Drawer 7284 Mountain View, CA 94042		Hartwell Corporation 900 S. Richfield Road Placentia, CA 92670	83014	International Rectifier Semiconductor Division 233 Kansas Street El Segundo, CA 90245	59993
Fair-Rite Products Corporation 1 Commercial Row Wallkill, NY 12589	34899	Hewlett-Packard Company Corporate HQ 3000 Hanover Street Palo Alto, CA 94304	28480	International Rectifier 9220 Sunset Bivd. Los Angeles, CA 90069	81483
Federal Screw Products, Inc. 3917 N. Kedzie Avenue Chicago, IL 60618	73734	Hewlett-Packard Company Optoelectronics Division 640 Page Hill Road	50434	Intersil Inc. Subsidiary of General Electric Company 10710 N. Tantau Avenue Cupertino, CA 95014	32293
Fenwal Electronics Division of Kidde Walter and Company, Inc. 63 Fountain Street Framingham, MA 01701	15801	Palo Alto, CA 94304 Hewlett-Packard Company Manufacturing Division Palo Alto, CA	98734	ITT Cannon Electric Division of International Telephone and Telegraph Corporation 10550 Talbert Avenue	71468
Fox Electronics Fox Enterprises, Inc. P.O. Box 1078 Cape Coral, FL 33910	61429	Heyco Molded Products 1750 Blvd. P.O. Box 160 Kenilworth, NJ 07033	28520	P.O. Box 8040 Fountain Valley, CA 92708 ITT Components Division International 1 elephone and	61725
General Connector Corporation Subsidiary of the Union Corporation 80 Bridge Street Newton, MA 02158	25330	High Energy Corporation Subsidiary of Inductotherm Corporation Lower Valley Road Parkesburg, PA 19365	21052	Telegraph Corporation 3201 S. Standard Street P.O. Box 2197 Santa Ana, CA 92707	
General Electric Company Semi-Conductor Products Department W. Genesee Street Auburn, NY 13021	03508	HI-G Company Subsidiary of Nytronics Inc. 101 Locust Street Hartford, CT 06114	02289	ITT Jennings 970 McLaughlin Avenue San Jose, CA 95116 ITT Telecom Products Corporation	73905 21340
General Electric Company Aviation Service Operation/CINTI 333 W. Seymour Avenue Cincinnati, OH 45216	05326	Honeywell, Inc. Micro Switch Division 11 W. Spring Street Freeport, IL 61032	91929	Network Systems Division HWY 137 Suncrest Drive P.O. Box N Carroll Reece Station Johnson City, TN 37601	21040
General Electric Company Seni-Conductor Products Department Power Components Operation W. Genesee Street	09214	Hughes Electronic Devices Corporation 13321 Grass Valley Avenue P.O. Box 185	61587	JFD Electronic Components A Division of Murata Erie North America 112 Mott Street Oceanside, NY 11572	
Auburn, NY 13021 General Electric Company 3135 Easton Turnpike	24446	Grass Valley, CA 95945 Hutchens Industries, Inc. 215 N. Patterson Avenue	92967	Johnson EF Company 299 10th Avenue SW Waseca, MN 56093	74970
Fairfield, CT 06431 General Electronics, Inc. Paterson, NJ	80101	P.O. Box 1427 SSS Springfield, MO 65805 IDI Electric Canada LTD	51144	Keystone Carbon Company 1935 State Street St. Marys, PA 15857	75263
General Instrument Corporation Government Systems Division 600 W. John Street	05828	33 Fuller Road Box 159 Ajax, Ontario Canada L1S 2E1		Kings Electronics Company, Inc. 40 Marbledale Road Tuckahoe, NY 10707	91836
Hicksville, NY 11802 General Instrument Corporation	74276	Illinois Capacitor, Inc. 3757 W. Touhy Avenue Lincolnwood, IL 60645	74840	Kulka Electric Corporation A North American Philips Corporation Mt. Vernon, NY	75382
Lamp Division/Worldwide 4433 N. Ravenswood Avenue Chicago, IL 60640		Illinois Tool Works, Inc. Fastex Division 195 Algonquin Road	02768	Kulka Smith, Inc. A North American Philips Company 1913 Atlantic Avenue	83330
Gochenaur Marine Company Philadelphia, PA	72835	Des Plaines, IL 60016		Manasquan, NJ 08736	

Lapointe Industries, Inc. Electronic Products Division 155 W. Main Street Rockville, CT 06066	94033	McDonnel Douglas Corporation McDonnel Aircraft Company P.O. Box 516 St. Louis, MO 63166	76301	Minnesota Mining and Manufacturing Company Electro Products Division 341 Factory Road	52760
				Addison, IL 60101	
Lee Spring Company, Inc. 1462 62nd Street Brooklyn, NY 11219	84830	Mepco/Electra, Inc. A North American Philips Company P.O. Box 760 Mineral Wells, TX 76067	19701	Minnesota Mining and Manufacturing Company Data Recording Products Division	54254
Leeds and Northrup Company A Unit of General Signal Corporation Sumneytown Pike	31922	Mepco/Electra, Inc. 6071 St. Andrews Road	56699	350 S. Lewis Road Camarillo, CA 93010	
North Wales, PA 19454		Columbia, CS 29210		Minor Rubber Company, Inc. 49 Ackerman Street	76385
Library Efficiency Corporation New York, NY	81249	Mepco/Electra, Inc. 22 Columbia Road Morristown, NJ 07960	80031	Bloomfield, NJ 07003	00540
Licon	04426	Monstown, NO 07960		Mite Corporation	06540
Division of Illinois Tool Works, Inc. 6615 W. Irving Park Road	04420	Metraplex Corporation Berkshire Industrial Park	52559	Amatom Electronic Hardware Division 446 Blake Street New Haven, CT 06515	
Chicago, IL 60634		Bldg. 3 Bethel, CT 06801		Mite Corporation	26344
Litton Industries, Inc.	04386			466 Blake Street	
Litton Systems Inc. Triad-Utrad Division		Midland-Ross Corporation Cambion Division	53373	New Haven, CT 06515	
305 N. Briant Street		Barnstead Road		Molex, Inc.	27264
Huntington, IN 46750		Pittsfield, NH 03263		2222 Wellington Court Lisle, IL 60532	27204
Litton Industries, Inc.	26667	Midland-Ross Corporation	71279	21010, 12 00002	
Triad Distributor Division Huntington, IN	2000.	Cambion Division One Alewife Place	11219	Moto Meter Gauge and Equipment Division	70400
_		Cambridge, MA 02140		Electric Auto Lite Company	76490
Luminescent Systems Inc. Etna Road	32890	Micro Plastics, Inc.	13764	New York, NY	
Grafton County		HWY 178 N.	13/04	Motorola, Inc.	04713
Lebanon, NH 03766		Flippin, AR 72634		Semiconductor Products Sector 5005	04713
LXD	66670	Microtron Co. Inc.	00040	E, McDowell Road	
24500 High Point Road	00070	Microtran Co., Inc. 145 E. Mineola Avenue	00348	Phoenix, AZ 85008	
Cleveland, Ohio 44122		P.O. Box 236 Valley Stream, NY 11582		Murata Erie North America, Inc.	72982
Magna Division	11195	Vaney Sueam, NY 11362		Erie Operations	72902
Vermont American Corporation 1001 West Park Road		Midwest Components, Inc. 1981 Port City Blvd.	50157	645 W. 11th Street Erie, PA 16512	
Elizabethtown, KY 42701		P.O. Box 787		Murato Erie Technological Products	18796
Magnavox Government and Industrial		Muskegon, MI 49443		State College Operations	10/90
Electronics Co.	37695	Mil Spec	81349	1900 W. College Avenue	
1313 Production Road Fort Wayne, IN 46808		Mil Spec	96906	State College, PA 16801	
		·		National Semiconductor Corporation	12040
Magnecraft Electric Company 5575 N. Lynch Avenue	94696	Millen Division Electronic Instrument and Specialty	57285	Commerce Drive P.O. Box 443	
Chicago, ÍL 60630		Corporation 42 Pleasant Street		Danbury, CT 06810	
Magnum Electric Corporation 6385 Dixie HWY	52458	Stoneham, MA 02180		National Semiconductor Corporation	27014
Erie, MI 48133		Mini-Circuits Laboratory	15542	2900 Semiconductor Drive Santa Clara, CA 95051	
Marine Corps.	80372	Division of Scientific Components Corporation		NEC America, Inc.	51984
Navy Annex		2625 E. 14th Street		2741 Prosperity Avenue	
Washington, DC 20380		Brooklyn, NY 11235		Fairfax, VA 22031	
Marson Corp.	10054	Minnesota Mining and Manfacturing		Neilsen Products Company	00758
130 Crescent Avenue Chelsea, MA 02150		Company Industrial Tape Division	26066	Lake Elmo, MN	
		3M Center		Nielsen Hardware Corporation	98003
Masstech Corporation Subsidiary of Transtechnology	94464	St Paul, MN 55101		770 Wethersfield Avenue P.O. Box 568	
Corporation		Minnesota Mining and Manufacturing	20124	Hartford, CT 06141	
Swamp Road RT 313		Company Industrial Coated Abrasives Division	28124	Niagara Straw Company, Inc.	60963
P.O. Box 2001		3M Center		72 Lakeview Avenue	00300
Doylestown, PA 18901		St. Paul, MN 55101		Buffalo, NY 14201	
Matsushita Electric Corporation of		Minnesota Mining and Manufacturing		Nytronics Components Group, Inc.	00213
America	54473	Company	30142	Subsidiary of Nytronics Inc.	
One Panasonic Way P.O. Box 1501		Energy Systems 3M Center Bldg, 551		Orange Street Darlington, SC 29532	
Secaucus, NJ 07094		St. Paul, MN 55101		Comigion, CO 20002	
2234000, 1 to 0, 00 T		GL F GUI, FRE GO (O)			

Ohmite Manufacturing Company 3601 W. Howard Street Skokie, IL 60076	44655	RCA Corporation Solid State Division Crestwood Road Mountaintop, PA 18707	18722	Signetics Corporation Military Products Division 4130 S. Market Court Sacramento, CA 95834	18324
Ordnance Corps	00000	• •		•	
The Defense Logistics Services Center	00000	RCA Corporation 30 Rockerfeller Plaza	49671	Siliconix, Inc. 2201 Laurelwood Road	17856
Palco Connector, Inc.	58167	New York, NY 10020		Santa Clara, CA 95054	
75 Center Street	00.07	11011 1011,111 10020		Carna Ciara, Gri 5000+	
		2010	77000	Other and Electronic Man	
Bristol, CT 06010		RCA Corporation	77609	Silvered Electronic Mica	
		RCA Service Company		Company, Inc.	61306
Panduit Corporation	06383	RTE 38		RT6	
17301 Ridgeland	***************************************				
		Cherry Hill, NJ 08358		Willimantic, CT 06226	
Tinley Park, IL 60477					
		RCD Components, Inc.	56637	Singer Company	22903
PCC Pertec Division	32097	330 Bedford Street		The Link Flight Simulation Division	
Pertec Computer Corporation		Manchester, NH 03101		Advanced Products Operation	
9600 Irondale Avenue		,,		1077 E. Argues Avenue	
Chatsworth, CA 91311		Republic Electronics Corporation	93958	P.O. Box 3484	
Chalaworus, CA 91011		176 E. 7th Street	90900		
				Sunnyvale, CA 94088	
PEM Engineering Company	99256	Paterson, NJ 07524			
Los Angeles, CA				SNC Manufacturing Company, Inc.	83325
		Rockwell International Corporation	13499	101 Waukau Road	
Penn Engineering and Manfacturing		Collins Telecommunications Products		Oshkosh, WI 54901	
Corporation	46384	Division			
Old Easton Road	70007	Defense Electronics Operations		Southco, Inc.	94222
					94222
P.O. Box 1000		855 NE 35th Street		210 N. Brinton Lake Road	
Danboro, PA 18916		Cedar Rapids, IA 52498		Concordville, PA 19331	
Phoenix Specialty Manufacturing		Rogan Corporation	86797	Spectrol Electronics Corporation	02111
Company, Inc.	77264	3455 Woodhead Drive		Subsidiary of Carrier Corporation	
971 Stewart Avenue		Northbrook, IL 60062		17070 E. Gale Avenue	
		14011110100K, 12 00002			
Garden City, LI, NY 11530				P.O. Box 1220	
		Rotron Controls	32284	City of Industry, CA 91749	
PIC Design Corporation	00141	Division Rotron, Inc.			
Division of Wells-Benrus Corporation		Woodstock, NY		Sprague Electric Company	56289
Benson Road		·		87 Marshall Street	
P.O. Box 1004		Rotron, Inc.	82877	North Adams, MA 01247	
Middlebury, CT 06762		Custom Division	OLUT.	110111111101110111111111111111111111111	
Wilder bully, CT 00702		7 Hasbrouck Lane		Stackpole Corporation, The	78488
Diantia Compaitous Inc	00100				70400
Plastic Capacitors, Inc.	99120	Woodstock, NY 12498		201 Stackpole Street	
2623 N. Pulaski Road				St. Marys, PA 15857	
Chicago, IL 60639		Samtec, Inc.	55322		
		810 Progress Blvd.		Stimpson Company, Inc.	57771
Plastiglide Manufacturing Corporation	11897	P.O. Box 1147		900 Sylvan Avenue	
2701 W. El Segundo Blvd.		New Albany, IN 47150		Bayport, NY 11705	
Hawthorne, CA 90250					
		Sanders Associates, Inc.	94117	Stone City Products, Inc.	09166
Poulsen and Wardon, Inc.	77347	Daniel Webster HWY South		1206 7th Street	
Los Angeles, CA		Nashua, NH 03061		P.O. Box 369	
2507111801001071		1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		Bedford, IN 47421	
Dewar Conversion Inc	55002	Sangamo Weston, Inc.	00853	Bodioi 41 11 12 1	
Power Conversion, Inc.	55002		00000	Considerate of Assistant Consentions	00167
495 Boulevard		Sangamo Capacitor Division		Sundstrand Aviation Operations	99167
Elmwood Park, NJ 07407		Subsidiary of Schlumberger LTD		Unit of Sundstrand Corporation	
		Sangamo Road		4747 Harrison Avenue	
Pulse Engineering, Inc.	61735	P.O. Box 128		P.O. Box 7002	
5004 Lehigh Road		Pickens, SC 29671		Rockford, IL 61125	
		,			
College Park, MD 20740		Sargent Art	00493	Switchcraft, Inc.	82389
Describes Division	00000		00430	Subsidiary of Raytheon Company	OLOGO
Pyrofilm Division	03888	Division of Mead Corporation			
Division of KDI Electronics Inc.		Hazleton, PA		5555 N. Elstron Avenue	
60 S. Jefferson Road				Chicago, IL 60630	
Whippany, NJ 07981		Sealectro Corporation	98291		
**		BICC Electronics		T and B/Ansley Corporation	15912
Quam Nichols Company	74199	40 Lindeman Drive		Subsidiary of Thomas and Betts	
	7-1100	Trumbull, CT 06611		Corporation	
218 E. Marquette Road		Hambur, OT 00011		4371 Valley Blvd.	
Chicago, IL 60637		On and the state of a			
	===0.0	Seastrom Manufacturing	00000	Los Angeles, CA 90031	
R A F Electronic Hardware, Inc.	55566	Company, Inc.	86928		00000
95 Silvermine Road		701 Sonora Avenue		Tektronix, Inc.	80009
Seymour, CT 06483		Glendale, CA 91201		4900 SW Griffith Drive	
•		• •		P.O. Box 500	
Raychem Corporation	06090	Shielding Technology, Inc.	59950	Beaverton, OR 97077	
	00000	Subsidiary of Chomerics, Inc.	55550		
300 Constitution Drive				Texas Instruments Inc.	01295
Menio Park, CA 94025		120 Ethel Road W.			01233
		Piscataway, NJ 08854		Semiconductor Group	
RCA Corporation				13500 N. Central Expressway	
11071 Corporation	02735				
Solid State Division	02735	Signal Transformer Company, Inc.	08779	P.O. Box 225012 M/S 49	
Solid State Division	02735		08779		
Solid State Division Route 202	02735	500 Bayview Avenue	08779	P.O. Box 225012 M/S 49	
Solid State Division	02735		08779	P.O. Box 225012 M/S 49	

				To be the section of the Comment	
Texas Instruments, Inc. Equipment Group 13500 N. Central EXPY P.O. Box 660246 WS 3137 Dallas, TX 75266	96214	USM Corporation Subsidiary of Emhart Industries, Inc. USM Fastener Division 510 River Road Shelton, CT 06484	07707	Zierick Manufacturing Company Radio Circle Mt. Kisco, NY 10549	81814
Thermalloy Company, Inc. 2021 W. Valley View Lane P.O. Box 340839 Dallas, TX 75234	13103	USM Corporation Subsidiary of Emhart Industries, Inc. 140 Federal Street Boston, MA 02107	61957		
Thomas and Betts Corporation HWY 218 S. Iowa City, IA 52240	59730	Vaco Products Company 1510 Skokie Blvd. Northbrook, IL 60062	79061		
Thompson Industries Division of W M F Container Corporatio 2501 E. Magnolia Street Phoenix, AZ 85036	32848 n	Varian Associates, Inc. Pulse Engineering Subsidiary 7250 Convoy CT P.O. Box 12235 San Diego, CA 92112	01961		
Toshiba Internation Industrial Division 13131 W. Little York Road P.O. Box 40906 Houston, TX 77041	61802	Varian Associates, Inc. EIMAC Division 301 Industrial Way San Carlos, CA 94070	06980		
Tracor Littelfuse, Inc. 800 E. Northwest HWY Des Plaines, IL 60016	75915	Varian Associates, Inc. Microwave Tube Division 611 Hansen Way Palo Alto, CA 94303	99313		
Triad Transformer Corporation Huntington, IN	16741	Varo, Inc. Electron Devices Division	27777		
Triad-Utrad Division Litton Systems, Inc. National City, CA	81095	2203 Walnut Street P.O. Box 401146 Garland, TX 75040			
TRW, Inc. TRW Cinch Connectors Division 1501 Morse Avenue Elk Grove Village, IL 60007	71785	Varo Semiconductor, Inc. Subsidiary of Varo, Inc. 1000 N. Shiloh Road P.O. Box 40676 Garland, TX 75040	62703		
TRW, Inc. TRW Electronic Components IRC Fixed Resistors Philadelphia Division 401 N. Broad Street Philadelphia, PA 19108	75042	Veeco Instruments, Inc. Lambda Electronics Division 515 Broad Hollow Road Melville, NY 11747	80103		
Union Carbide Corporation Electronics Division HWY 276 SE	31433	Vitramon, Inc. Box 544 Bridgeport, CT 06601	95275		
P.O. Box 5928 Greenville, SC 29606		Wakefield Engineering Company P.O. Box 818 Coeur D Alene, ID 83814	90372		
Uniroyal, Inc. Oxford Management and Research Center Benson Road	61463	Waldes Kohinoor, Inc. 47-16 Austel Place Long Island City, NY 11101	79136		
Middlebury, CT 06749 United Shoe Machinery Corporation Cincinnati, OH	08544	Waterous Company 300 John E. Carroll Avenue E. South St. Paul, MN 55075	7921 8		
Unitrode Corporation 580 Pleasant Street Watertown, MA 02172	12969	Westinghouse Electric Corporation Defense and Electronic Systems Cente Baltimore-Washington Airport P.O. Box 1897 MS 984	97942 r		
U.S. Army Armament Research and Development Command Dover, NJ 07801	19200	Baltimore, MD 21203 WH Brady Company 727 W. Glendale Avenue	95987		
U.S. Army Communications and Electronics Materiel Readiness Command Logistics Engineering Directorate	80063	Milwaukee, WI 53209 Zeus Industrial Products, Inc. Ft. Thompson Street	32039		
Fort Monmouth, NJ 07703 U.S. Army Tank Automotive Command Warren, MI 48090	19207	Raritan, NJ 08869 Zierick Manufacturing Company Radio Circle Mt. Kisco, NY 10549	79963		

Recoverable XD1 (SCARS) Condemn at Depot Nonexpendable Support Equipment, Depot ND2 Nonexpendable Support Nonrecoverable XB3 Condemn at Any Level Organizational and Intermediate NF2 Recoverable XF3 Condemn at Field Recoverable XD2 Condemn at Depot 6th Position ERRC CODE Equipment, z U ⊃ ۵ S RECOVERABILITY Reparable Condemn at Depot Condemn at 3rd Position Level Reparable Condemn at Organizational Special Handling 5th Position Nonreparable JOINT MILITARY SERVICES UNIFORM SMR CODING MATRIX T.O. 00-25-195 ntermediate Condemn at Reparable ⋖ Δ 0 ı 7 Limited Repair at O or F Level Repair at Depot Organizational Repair at Intermediate No Repair Recondition Overhaul at Depot 4th Position No Repair Repair at MAINTENANCE REPAIR 0 ۵ ш. _ 7 ω Remove/Replace at Depot Level Replace at Inter-mediate Level Remove/ Replace at Organizational Level **3rd Position** USE Remove/ 0 Ω Intermediate Kit Requisition NHA Mfg Drawings Insurance Deteriorative Reclamation from IM Organization Organization Intermediate Sustained Life Support Intermediate Support Equipment, Stocked Support Equipment, Nonstocked In Both Kits 2nd Position Depot Kit Stocked Depot **Depot** SOURCE Δ 00 0 ۵ 0 ۵ ∢ 00 U **∀**|∞ G ш Component of a Nonprocured Manufacture Procurable ist Position Repair Kit Assemble Σ ∢ ¥ × ٩

Section II. MAINTENANCE PARTS LIST

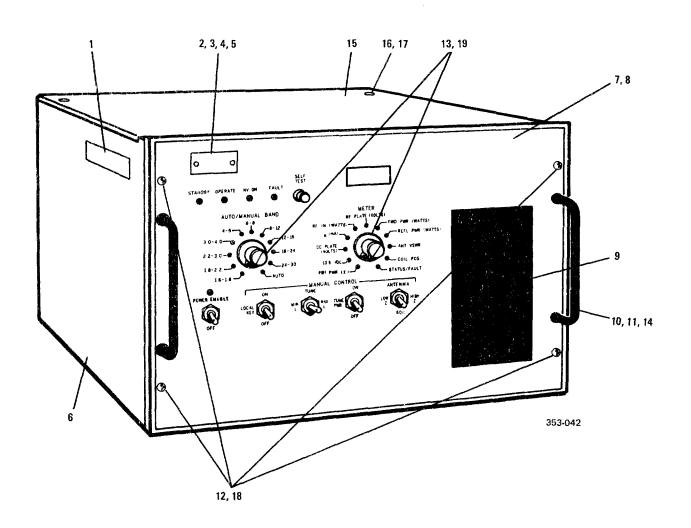


Figure 7-1. 1 KW LPA, AM-7224/URC, Front View

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Per	sable On SMR Code Code
7-1 -	10087-0000 10087-0071 10087-0008 MS51957-14 MS35338-135 MS15795-803 10087-3100 10087-2005 10087-2010 A1013-29 16022-A2 10087-2011 MS91528-1F1B MS24693-C272 10087-3104 AJ4-35-SS SR-4 10087-2012 AN565DC4L4	14304 14304 96906 96906 96906 14304 14304 14304 06540 06540 14304 96906 96906 14304 32039 72794 14304 96906	AMPLIFIER, RF* PLATE, 1DENT NAMEPLATE SCREW, MACHINE (AP) WASHER, LOCK (AP) CHASSIS, ELEC, EQPT PANEL OVERLAY HANDLE BUSHING WASHER, FLAT (AP) KNOB SCREW, MACHINE (AP) RETAINER SCREW, MACHINE (AP) SCREW, MACHINE (AP) SCREW, MACHINE (AP)	1 1 1 2 4 1 1 1 2 4 4 2 4 4 2 4 4 2 4 4 4 4	PEODD MDO MDO PAOZZ PAOZZ PAOZZ PAOLD XB XB PAOZZ XB AOZZ PAOZZ PAOZZ PAOZZ XB XB XB PAOZZ XB XB

^{*}Installation requires Ancillary Kit 10087-0060. See figure 7-3.

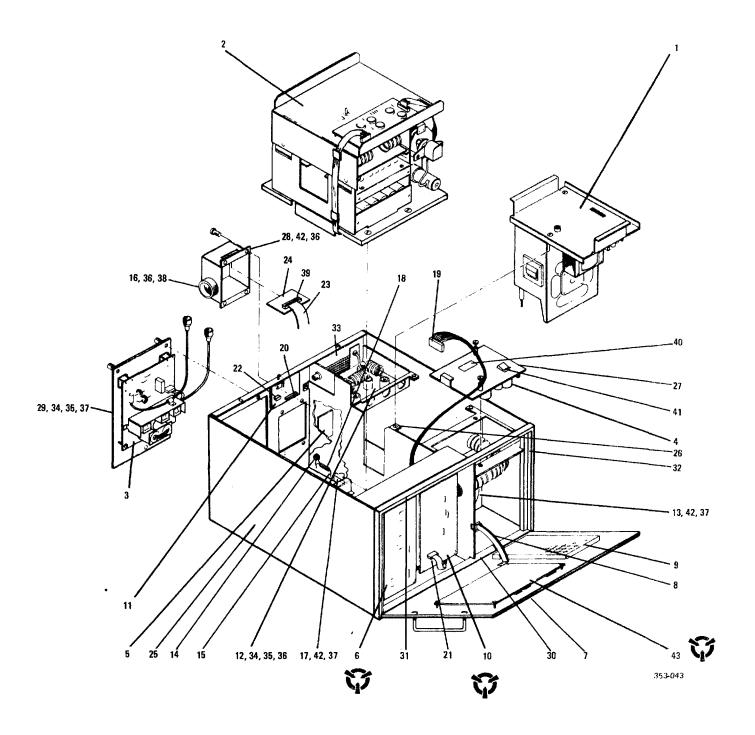


Figure 7-2. 1 KW LPA, AM-7224/URC, Exploded View

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the Illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-2 - 1	10087-3200		ELECTRON TUBE ASSY, A1	1		PAODD
- 2	10087-3700	14304	TRANSFORMER ASSY, RF, A2	1		PAODD
- 3	10087-4600	14304	CIRCUIT CARD ASSY,A3	1		PAODD
- 4	10087-1500	14304	CIRCUIT CARD ASSY, A4	1 1 1		PAOLD
- 5	10086-7200	14304	CIRCUIT CARD ASSY, A5	1		PAODD
- 6	10086-9200	14304	CIRCUIT CARD ASSY, A6	1		PAODD
- 7	10087-2000	14304	PANEL ASSY, A7	1		XВ
- 8	10087-2004	14304	BRACKET, ANGLE	1		XВ
- 9	10087-2008	14304	RETAINER	1 1 1 1 1		XB
- 10	10086-7100	14304	CIRCUIT CARD ASSY, A8	1		PAOLD
- 11	10087-3140	14304	CIRCUIT CARD ASSY, A9	1		PAOLD
- 12	10087-4500	14304	FILTER ASSY, RF, A10	1		PAOLD
- 13	10086-1400	14304	FAN ASSY	1		PAOZZ
- 14	75GA-D25	56289	CAPACITOR, FXD, CER	1		PADZZ
- 15	2994-14-1	17117	SPACER	2		XВ
- 16	MS3102R28-18P	96906	CONNECTOR, RCPT, ELEC	1		PADZZ
- 17	8101FSP-90	01009	CONNECTOR, RCPT, ELEC	1 1 2 2		PADZZ
- 18	5248	96804	TRANSFORMER, RF	1		PADZZ
- 19	22-01-3147	27264	CONNECTOR, PLUG, ELEC	2		PADZZ
- 20	09-91-0600	27264	CONNECTOR, RCPT, ELEC	2		PADZZ
- 21	22-01-3107	27264	CONNECTOR, PLUG, ELEC	1		PADZZ
- 22	22-01-3057	27264	CONNECTOR, RCPT, ELEC	2		PADZZ
- 23	10087-3135	14304	CABLE ASSY, INTERCONNECT			PAOZZ
- 24	10087-3170	14304	CIRCUIT CARD ASSY,A11	1		PAOZZ
- 25	10087-3103	14304	CHASSIS, ELEC, EQPT	1		XB
- 26	SQ-C4-20	32039	CATCH	3 1		XB
- 27	10087-3105	14304	PLATE, MTG	1		XВ
- 28	10087-3109	14304	COVER	1		XB
- 29	10087-3113	14304	PLATE, MTG	1		XВ
- 30	10087-3116	14304	BRACKET, ANGLE	1		XВ
- 31	10087-3117	14304	BRACKET, ANGLE	1 2		XB
- 32	10087-3118	14304	BRACKET ANGLE			XB
- 33	10087-3119	14304	PANEL	1		XB
- 34	MS51957-14	·96906	SCREW, MACHINE (AP)	8		PADZZ
- 35	MS35338-135	96906	WASHER, LOCK (AP)	10		PADZZ
- 36	MS51957-28	96906	SCREW, MACHINE (AP)	14		PADZZ
- 37	MS51957-30	96906	SCREW, MACHINE (AP)	1		PADZZ
- 38	H-6768	14304	NUT, CLINCH (AP)	11.		XB
- 39	250817-1	00779	RETAINER	1.		XB
- 40	MP-0745	14304	LABEL, HIGH VOLTAGE	3		MDO
- 41	3484-1000	54254	CLAMP CABLE	5		PADZZ
- 42	MS15795-806	96906	WASHER, FLAT (AP)	5		PADZZ
- 43	10087-2100	14304	CIRCUIT CARD ASSY, A7A1	11		PAODD

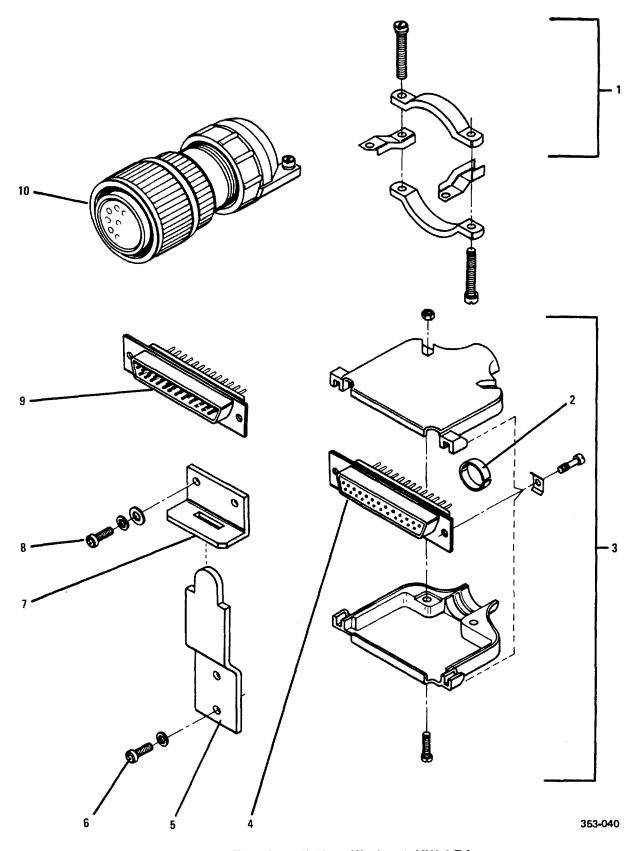
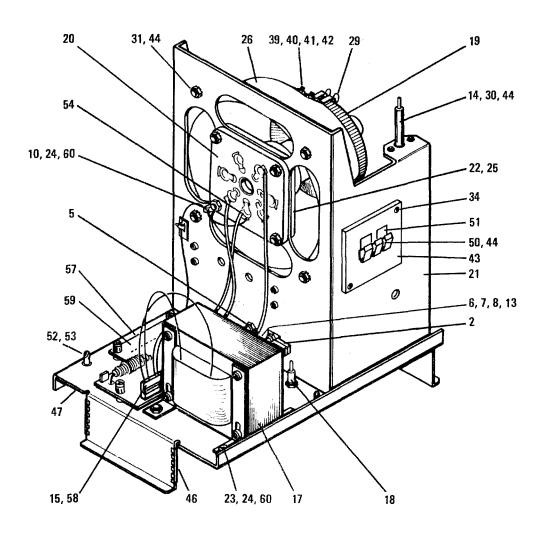


Figure 7-3. Installation Kit for 1 KW LPA

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-3 - - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10	10087-0060 10-36233-243 745508-8 745173-2 17-80250-16 10087-3107 MS51957-30 10087-3106 MS51957-17 DBM25P 10-109628-18S	14304 77820 00779 00779 74868 14304 96906 14304 96906 71468 77820	INSTALLATION KIT . RETAINER . BUSHING . COVER, CONN . CONNECTOR, RCPT, ELEC . BRACKET, ANGLE . SCREW, MACHINE (AP) . BRACKET, ANGLE . SCREW, MACHINE (AP) . CONNECTOR, RCPT, ELEC . CONNECTOR, PLUG, ELEC	1 2 2 2 1 8 16 4 8 1		XB XB PAOZZ PAOZZ XB PAOZZ XB PAOZZ PAOZZ PAOZZ



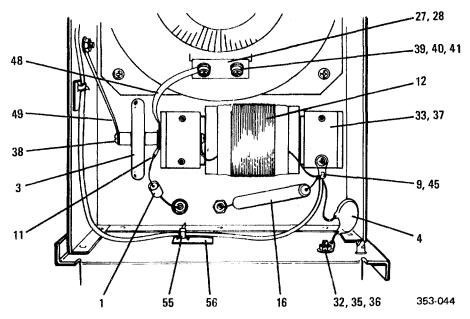


Figure 7-4. Tube Assy, A1

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-4 -	10087-3200	14304	ELECTRON TUBE ASSY, A1	1		PAODD
- 1	HT55T309CB	21052	. CAPACITOR, FXD, CER	ī		PADZZ
$ \overline{2}$	10087-3230	14304	. CAPACITOR, FXD, CER	ī		PADZZ
- 3	10043-0033	14304	. CAPACITOR, FXD, CER	1		PADZZ
- 4	75GA-D25	56289	. CAPACITOR, FXD, CER	1		PADZZ
- 5	CK70AW152M	81349	. CAPACITOR, FXD, CER	1		PADZZ
- 6	M39014/2-1350	81349	. CAPACITOR, FXD, CER	<u>1</u>		PADZZ
- 7	JAN1N5711	81349	. SEMICOND DEVICE, DIO	1		PADZZ
- 8	2308-14-1	17117	. SPACER	1		ХВ
- 9	MS77068-1	96906	. TERMINAL, LUG	3		PADZZ
- 10	MS77068-3	96906	. TERMINAL LUG	1		PADZZ
- 11	MS77068-2	96906	. TERMINAL LUG	2		PADZZ
- 12	8948-3307	14304	. COIL, RF	1		PADZZ
- 13	MS90539-11	96906	. COIL, RF	1		PADZZ
- 14	8101MP	01009	. CONNECTOR, PLUG, ELEC	1		PADZZ
- 15	22-01-3037	27264	. CONNECTOR, PLUG, ELEC	1		PADZZ
- 16	MS313-4994F	19647		1		PADZZ
– 17	10087-3208	14304		1		PADZZ
- 18	A2-61864	00159		1		PADZZ
- 19	8877/3CX1500A7	06980	•	1		PAOZZ
- 20	122-0247-202	74970		1		PADZZ
- 21	10087-3205	14304		1		ХВ
- 22	10019-1310	14304		1		ХВ
- 23	MS51957-44	96906	. SCREW MACHINE	4		PAOZZ
- 24	MS15795-807	96906		8		PADZZ
- 25	5612-18-20	86928		4		PAOZZ
- 26	10087-3204	14304		1		XB
- 27	10019-1308	14304		1		XB
- 28	10019-1309	14304		1		XB
- 29	10019-1307	14304		1		XB
- 30	MS51957-30	96906		2 4 1		PADZZ
- 31	MS51957-29	96906		4		PAOZZ
- 32	MS35649-244	96906				PAOZZ
- 33	391-3314	14304		2 2		XB
- 34 - 35	MS24693-C28 MS35338-135	96906 96906	. SCREW, MACHINE (AP) . WASHER, LOCK (AP)	1		PAOZZ PADZZ
- 35 - 36	MS51957-13	96906	. SCREW MACHINE	1		PAOZZ
- 36 37	MS51957-13	96906		5		PADZZ
- 38	21050	73734		1		PAOZZ
- 39	AN921-6	73734		1 5		PAOZZ
- 40	1384	73734		5		PAOZZ
- 40 - 41	21045	73734		4		PAOZZ
- 41 - 42	MS35649-265	96906		2		PAOZZ
- 43	10087-3206	14304		1		XB
- 44	н-6768	14304		7		XB
- 45	21042	73734		i		PAOZZ
- 46	MS21266-2N	96906		- 2		PADZZ
- 47	3484-1000	54254		1		XВ
- 48	10087-3210	14304		1		XВ
- 49	10087-3209	14304		1		XB
- 50	10087-3211	14304		1		XB

Figure & Index Number	Part Number	FSCM	Description	Units Per Assy	Usable On Code	SMR Code
51 52 53 54 55 56 57 58 59 60	10087-3212 AJ4-505-S SR-4 D-142-50 MS3367-4-9 TC-105A 10087-3213 08-56-0110 10087-3220 H-6767	14304 72794 72794 06090 96906 59730 14304 27264 14304 96906	. CONTACT, ELEC . STUDTURNLOCKFAST . RETAINER . SOLDER SLEEVE . STRAP, TIE DOWN . BASE . SEAL . CONTACT ELECTRICAL . CIRCUIT CARD ASSY, A1A . NUT, CLINCH (AP)	1 3 3 2 2 2 2 1 6		XB PAOZZ XB XB XB XB XB PADZZ XB XB

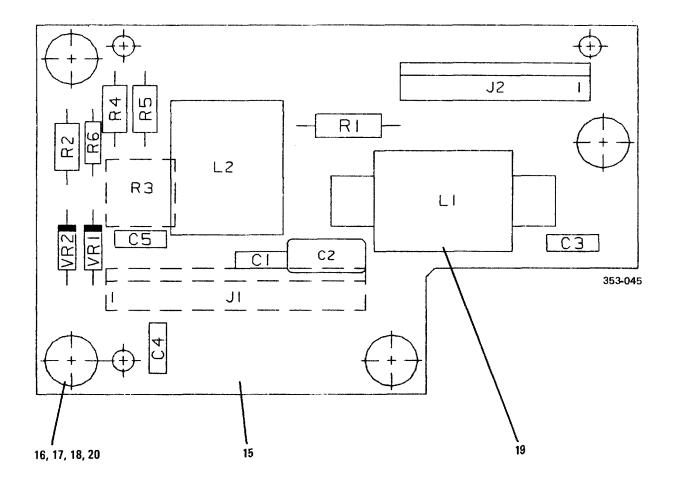


Figure 7-5. Bias/Sample PWB Assy, A1A1

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-5 - - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10 - 11 - 12 - 13 - 14 - 15 - 16 - 17 - 18 - 19 - 20	22-11-2142 22-11-2102 05801 10087-3207 ERD50TJ224 RNC55K5111FS 3386F-1-203 RNC55K1502FS RNC55K1133FS CF07-471J JAN1N751A 10087-3229 6611-0135 10085-5156 MS51957-17	14304 81349 81349 81349 27264 27264 76490 14304 54473 81349 32997 81349 81349 78488 81349 14304 14304 14304 96906 52559 96906	CAPACITOR, FXD, CER CAPACITOR, FXD, MICA CAPACITOR, FXD, CER CONNECTOR, RCPT, ELEC CONNECTOR, RCPT, ELEC TRANSFORMER, RF TRANSFORMER RESISTOR, FXD, COMP RESISTOR, FXD, FILM RESISTOR, FXD, COMP SEMICOND DEVICE, DIO CIRCUIT CARD RETAINER, SCREW BUSHING SCREW, MACHINE (AP) SPACER	1 3 1 1 1 1 1 1 1 1 2 1 4 4 4 4 2 4		XB PADZZ

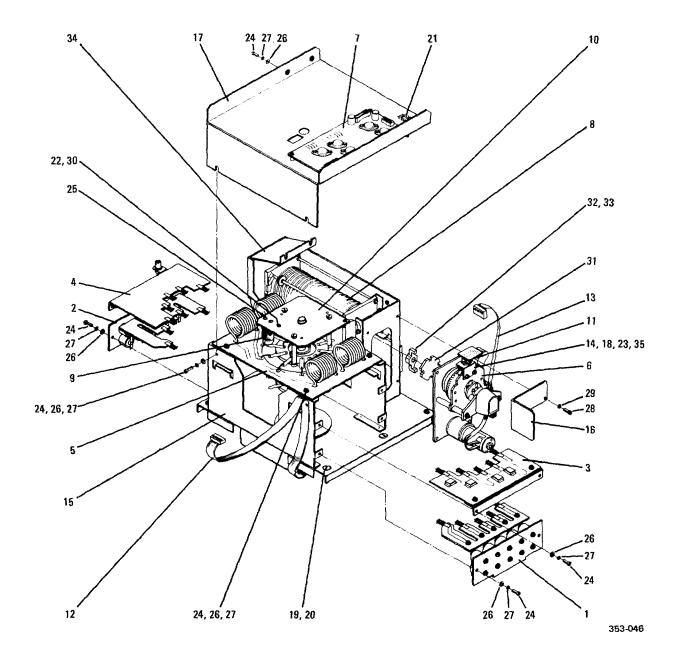


Figure 7-6. Tank Assy, A2, Exploded View

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usabla On Code	SMR Code
7-6 -	10087-3700	14304	TRANSFORMER ASSY, RF, A2	1		PAODD
- 1	10087-3740	14304	. TUNE CAP ASSY, A2A1	1		PADLD
- 2	10087-3750	14304	. TUNE CAP ASSY, A2A2	1		PADLD
- 3	10087-3760	14304	. CIRCUIT CARD ASSY, A2			XB
- 4	10087-3770	14304	. CIRCUIT CARD ASSY, A2			XB
- 5	10087-3780	14304	. CIRCUIT CARD ASSY, A2			ХВ
- 6	10086-3720	14304	. XFMR DRIVE ASSY, A2A6	1		AX
- 7	10086-3730	14304	. CIRCUIT CARD ASSY, A2			XB
- 8 - 9	10087-3709 10087-3785	14304	. TRANSFORMER, RF	1 1		PADZZ PADZZ
	10087-3783	14304 14304	. TRANSFORMER, RF	1		PADZZ
- 10 - 11	7105TV30QE	09353	. SWITCH . SWITCH, TOGGLE	1		PADZZ
- 11 - 12	10086-3799	14304	. SWITCH, TOGGLE . CABLE ASSY, RF	1		XB
- 12 - 13	10087-3819	14304	. CABLE ASSY, RF	1		XB
- 13 - 14	10086-3726	14304	. PLATE, MTG	i		XB
- 15	10087-3705	14304	. CHASSIS, ELEC, EQPT	1		XB
- 16	10087-3706	14304	. PROTECTOR, ELEC	ī		XB
- 17	10087-3703	14304	. COVER	1		XB
- 18	8154-A-440-0	14304	. SPACER	2		XB
- 19	AJ4-35	32039	. STUD	4		ХB
- 20	SR-4	72794	. RETAINER	4		ХB
- 21	MS21266-1N	96906	. GUARD, EDGE	3		PADZZ
- 22	MS51957-13	96906	. SCREW MACHINE	4		PADZZ
- 23	MS35338-135	96906	. WASHER, LOCK (AP)	8		PADZZ
- 24	MS51957-28	96906	. SCREW, MACHINE (AP)	12		PADZZ
- 25	010632B037	13764	. SCREW, MACHINE, NYLON	2		PAOZZ
_ 26	MS15795-805	96906	. WASHER, FLAT (AP)	18		PADZZ
- 27	MS35338-136	96906	. WASHER, LOCK (AP)	22		PAOZZ
- 28	MS51957-44	96906	. SCREW, MACHINE (AP)	2		PADZZ
- 29	MS35338-137	96906	. WASHER, LOCK (AP)	4		PAOZZ
	841-00	92967	. NUT, CLINCH (AP)	1 1		PAOZZ PADZZ
31 - 32	10087-3721 10087-3722	14304	. BRACKET, MTG	1		PADZZ
- 32 - 33	MS51021-22	14304 96906	. WHEEL, INDEX	8		PADZZ
- 33 - 34	10087-3710	14304	. SCREW, MACHINE (AP) . BRACKET, ANGLE	1		YADZZ XB
- 34 - 35	MS51957-15	96906	. SCREW, MACHINE (AP)	2		PADZZ
- 32	H92132/-13	20200	. SCREW, PROBLINE (AP)	2		LWAG

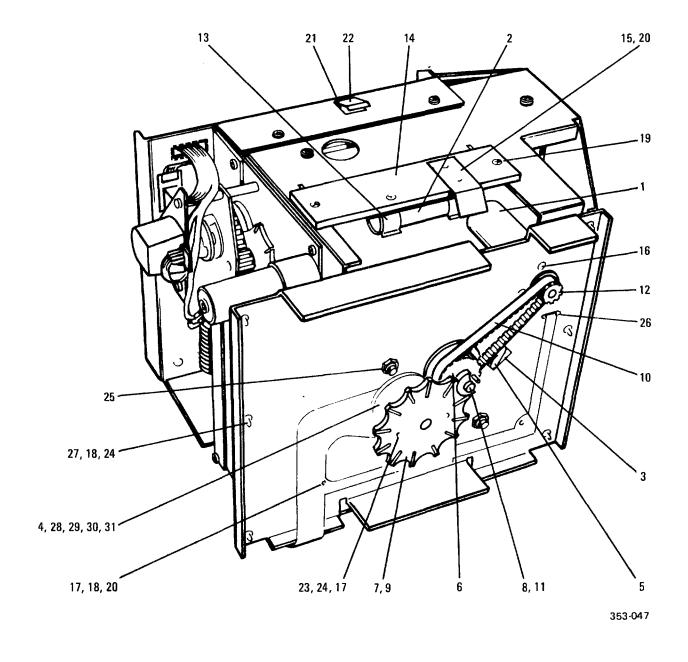


Figure 7-7. Tank Assy, A2, Bottom View

NOTE

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-7 -	10087-3700	14304	TRANSFORMER ASSY, RF, A2	1		PAODD
- 1	10086-3703	14304	. MOTOR, ELEC	1		PADZZ
- 2	885SP22OL	72819	. RESISTOR, FXD, WW	1		PADZZ
- 3	V3-343-D8	91929	. SWITCH SENSITIVE	1		PADZZ
- 4	6628-3460	14304	. SWITCH WAFER	1		PADZZ
- 5	JV-5	91929	. ACTUATOR	1		ХВ
- 6	10086-3806	14519	. PULLEY	1		PADZZ
- 7	10086-3712	14304	. WHEEL, INDEX	1		XB
- 8	43D33	29964	. BLOCK, BEARING	1		XB
- 9	10086-3788	14304	. DISC,MTG	1		XB
- 10	106XL037	61463	. BELT, ENDLESS	1		PADZZ
- 11	5144-25-S-ZD	79136	. RING, RETAINER	1		ХВ
- 12	10086-3709	14304	. SPACER, SHAFT	1		XB
- 13	4521-75-62-1T	86928	. RETAINER	2		XB
- 14	10087-3716	14304	. INSULATOR	1		XВ
- 15	10087-3717	14304	. PROTECTOR, ELEC	1		XB
- 16	MS51959-14	96906	. SCREW, MACHINE (AP)	7		PAOZZ
- 17	MS15795-805	96906	. WASHER, FLAT (AP)	18		PADZZ
- 18	MS51957-27	96906	. SCREW, MACHINE (AP)	10		PADZZ
- 19	MS51959-28	96906	. SCREW, MACHINE (AP)	3		PAOZZ
- 20	н-6768	14304	. NUT, CLINCH (AP)	4		XB
- 21	10087-3211	14304	. PLATE, FINGER STK	1		PADZZ
- 22	10087-3212	14304	. CONTACT, ELECTRICAL	1		PADZZ
- 23	MS51957-28	96906	. SCREW MACHINE	12		PADZZ
- 24	MS35338-136	96906	. WASHER, LOCK (AP)	22		PAOZZ
- 25	н-6767	14304	. NUT, CLINCH (AP)	5		XB
- 26	MS21266-2N	96906	. GUARD, EDGE	3		PADZZ
- 27	P101-447-495	89032	. STUD FRICTION CATCH	2		PAOZZ
- 28	MS15795-803	96906	. WASHER, FLAT (AP)	2 2		PADZZ
- 29	8154-A-440-0	14304	. SPACER			XB
- 30	MS35338-135	96906	. WASHER, LOCK (AP)	8 2		PADZZ
- 31	MS51957-15	96906	. SCREW, MACHINE (AP)			PADZZ

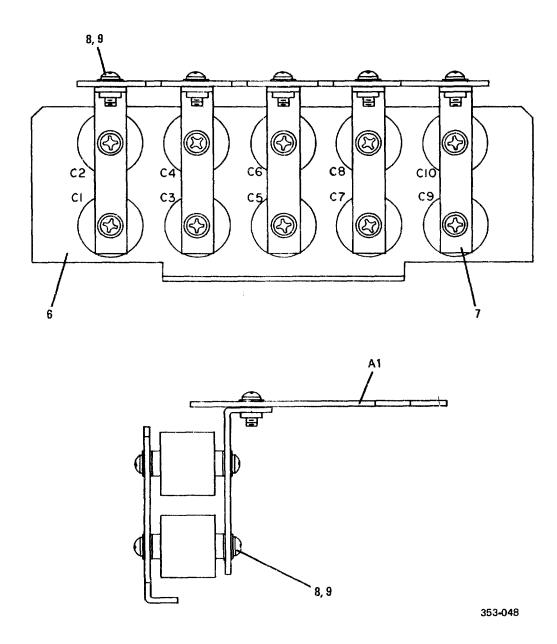


Figure 7-8. Tune Capacitor No. 1 Assy, A2A1

Figure & Index Number		Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-8 -		10087-3740	14304	TUNE CAP ASSY, A2A1	1		PADLD
1	L	10087-3745	14304	. CIRCUIT CARD ASSY	1		XВ
- 2	2	J1HT50UJ141J252	73905	. CAPACITOR, FXD, CER	2		PADZZ
- 3	3	HT50T101JB	21052	. CAPACITOR, FXD, CER	4		PADZZ
_ 4	4	HT50V500JA	21052	. CAPACITOR, FXD, CER	3		PADZZ
_ 5	5	HT50V250JA	21052	. CAPACITOR, FXD, CER	1		PADZZ
- 6	5	10087-3742	14304	. PLATE, MTG	1		ХВ
- 7	7	10087-3743	14304	. PLATE, MTG	5		XВ
- 8	3	MS51957-27	96906	. SCREW, MACHINE (AP)	25		PAOZZ
_ 9)	MS35333-71	96906	. WASHER, LOCK (AP)	45		PAOZZ

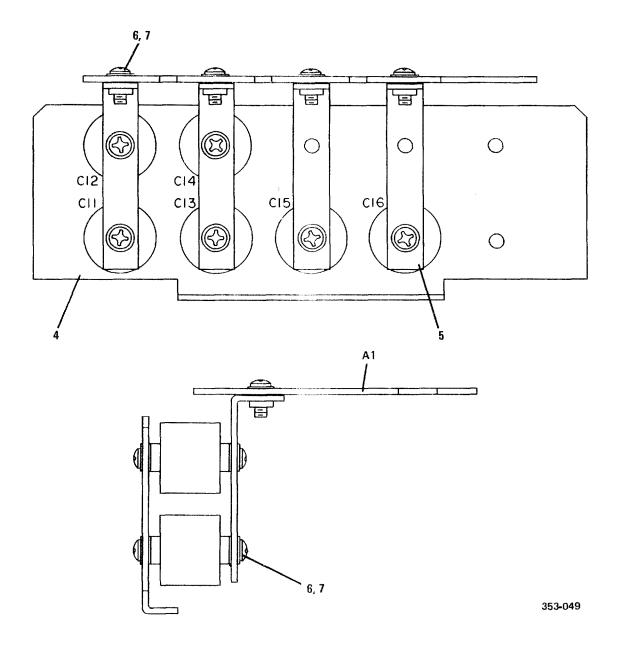


Figure 7-9. Tune Capacitor No. 2 Assy, A2A2

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-9 - - 1 - 2 - 3 - 4 - 5 - 6 - 7	10087-3750 10087-3745 HT50V250JA HT50T050JA 10087-3742 10087-3743 MS51957-27 MS35333-71	14304 14304 21052 21052 14304 14304 96906 96906	TUNE CAP ASSY, A2A2 CIRCUIT CARD ASSY CAPACITOR, FXD, CER CAPACITOR, FXD, CER PLATE, MTG PLATE, MTG SCREW, MACHINE (AP) WASHER, LOCK (AP)	1 1 5 1 1 4 16 28		PADLD PAOZZ PADZZ PADZZ XB XB PADZZ PADZZ

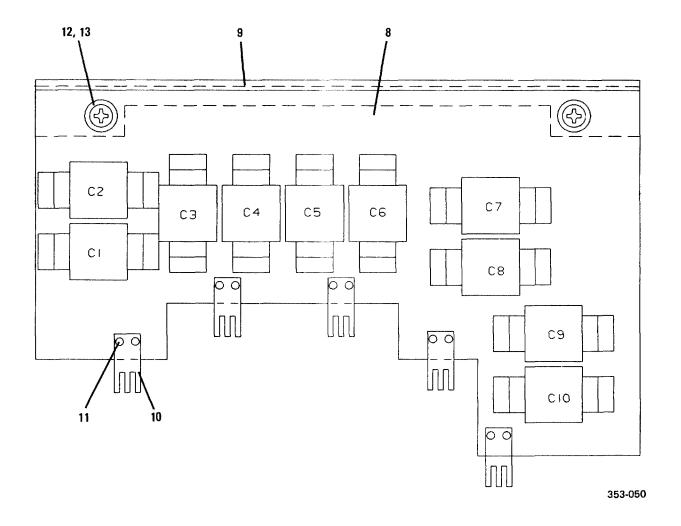


Figure 7-10. Load Capacitor No. 1 Assy, A2A3

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-10- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10	10087-3760 UFP1-110J UFP1-350J UFP1-340J 755017A4514-1 UFP1-100J C11-0004-029 UFP1-290J 10087-3769 10087-3762 10087-3746	14304 73899 73899 73899 14304 73899 14304 73899 14304 14304	CIRCUIT CARD ASSY,A2A3 . CAPACITOR,FXD,CER . CIRCUIT CARD . BRACKET,MTG . CONTACT,ELEC	2 1 3 1 1 1 1 1 1		XB PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ XB XB XB
- 11 - 12 - 13	A1690 MS51957-14 MS35333-70	57771 96906 96906	. EYELET . SCREW, MACHINE (AP) . WASHER, LOCK (AP)	10 2 2		XB PADZZ PAOZZ

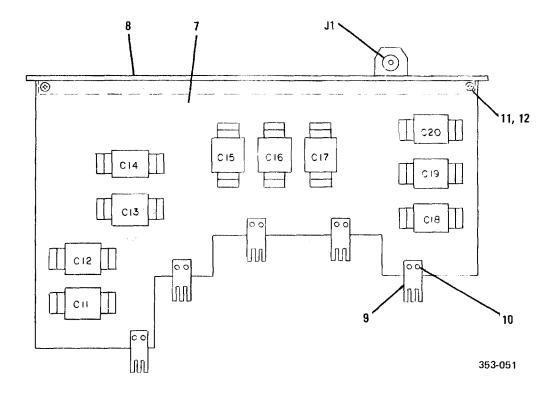


Figure 7-11. Load Capacitor No. 2 Assy, A2A4

NOTE

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-11- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10	10087-3770 UFP1-320J UFP1-680J UFP1-470J C11-0004-037 UFP1-370J M39012/21-0003 10087-3769 10087-3772 10087-3746 A1690	14304 73899 73899 73899 14304 73899 81349 14304 14304 14304 57771	CIRCUIT CARD ASSY, A2A4 . CAPACITOR, FXD, CER . CAPACITOR FXD, CER . CAPACITOR FXD CER . CAPACITOR, FXD, CER . CAPACITOR, FXD, CER . CAPACITOR, FXD, CER . CONNECTOR, RCPT, ELEC . CIRCUIT CARD . BRACKET, MTG . CONTACT, ELEC . EYELET	1 4 2 1 2 1 1 1 1 10 10		XB PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ XA XB PADZZ PADZZ
- 11 - 12	MS51957-14 MS35333-70	96906 96906	. SCREW, MACHINE (AP) . WASHER, LOCK (AP)	2 2		PADZZ PADZZ

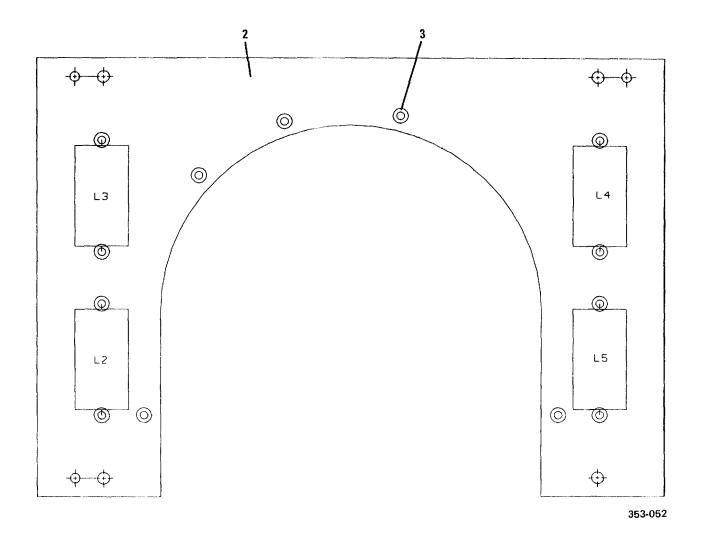


Figure 7-12. Coil PWB Assy, A2A5

Figure & index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-12- - 1 - 2 - 3	10087-3780 10087-3784 10087-3789 10087-3783	14304 14304 14304 14304	CIRCUIT CARD ASSY,A2A5 . TRANSFORMER,RF . CIRCUIT CARD . EYELET	4 1 13		XB PADZZ XB XB

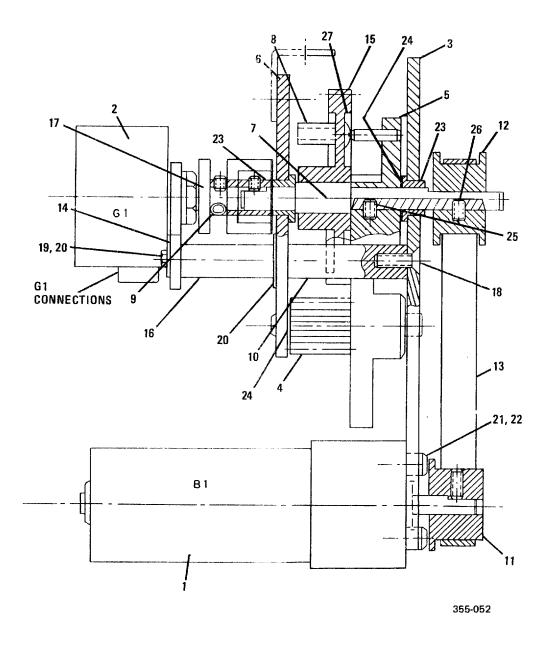


Figure 7-13. Coil Drive Assy, A2A6

NOTE

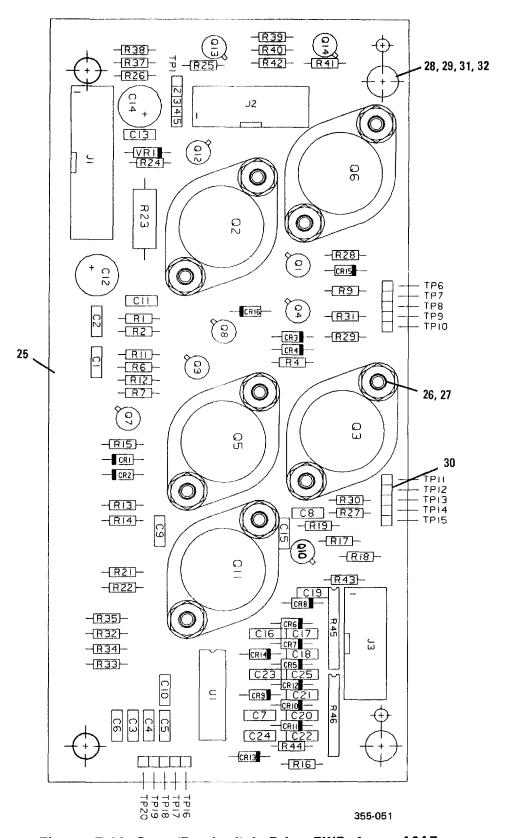


Figure 7-14. Servo/Bandswitch Drive PWB Assy, A2A7

NOTE

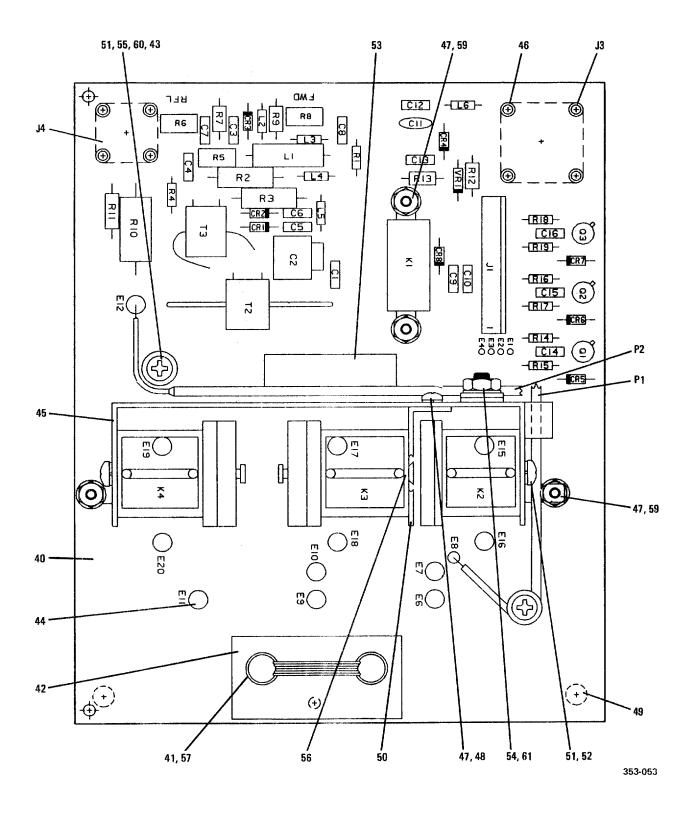


Figure 7-15. VSWR/XFMR PWB Assy, A3

NOTE

Figure				Units	Usable	
& Index	Part Number	FSCM	Description	Per	On	SMR
Number			1 2 3 4 5 6 7	Assy	Code	Code
	40007 4000	4 1 2 2 4		وويترسيط		
7-15-	10087-4600	14304	CIRCUIT CARD ASSY, A3	1		PAODD
- 1	C-11-NPO-5	56289	. CAPACITOR, FXD, CER	1		PADZZ
- 2	MCM01-007EC621G0	61306	. CAPACITOR, FXD, MICA	1		PADZZ
- 3	CK06BX103K	81349	. CAPACITOR, FXD, CER	6		PADZZ
- 4	M39014/02-1337	81349	. CAPACITOR, FXD, CER	1		PADZZ
- 5	M39014/01-1351	81349	. CAPACITOR, FXD, CER	2		PADZZ
- 6	CKO5BX471K	81349	. CAPACITOR, FXD, CER	2.		PADZZ
- 7	CMR05C100D0DR	81349	. CAPACITOR, FXD, MICA	1.		PADZZ
- 8	CMR05E750GODR	81349	. CAPACITOR, FXD, MICA	1		PADZZ
- 9	CK06BX104K	81349	. CAPACITOR, FXD, CER	1		PADZZ
- 10	JAN1N5711	81349	. SEMICOND DEVICE, DIO	4		PADZZ
- 11	JAN1N3611	81349	. SEMICOND DEVICE, DIO	4		PADZZ
- 12	22-11-2142	27264	. CONNECTOR, RCPT, ELEC	1		PADZZ
- 13	M39012/04-0002	81349	. CONNECTOR, RCPT, ELEC	1		PADZZ
- 14	KC-79-123	91836	. CONNECTOR, RCPT, ELEC	1		PADZZ
- 15	2T-4603-1	02289	. RELAY	1		PADZZ
- 16	W88KDX-2	94696	. RELAY	2		PADZZ
- 17	W88UKDX-2	94696	. RELAY	1		PADZZ
- 18	MS90541-05	96906	. COIL, RF	1		PADZZ
- 19	MS75085-7	96906	. COIL, RF	2 2		PADZZ
- 20	MS75083-1	96906	. COIL, RF	2		PADZZ
- 21	MS75085-17	96906	. COIL, RF	1		PADZZ
- 22	M39012/16-007	80131	. CONNECTOR, RCPT, ELEC	$\bar{2}$		PADZZ
- 23	JAN2N2907A	81349	. TRANSISTOR	3		PADZZ
- 24	CF07-103J	78488	. RESISTOR, FXD, COMP	4		PADZZ
- 25	RLR32C56R2FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 26	RLR32C56R0FM	81349	. RESISTOR, FXD, FILM	$\bar{1}$		PADZZ
- 27	CF07-221J	78488	. RESISTOR, FXD, COMP	ī		PADZZ
- 28	3386B-1-202	32997	. RESISTOR, VARIABLE	ī		PADZZ
- 29	3386B-1-203	32997	. RESISTOR, VARIABLE	2		PADZZ
- 30	RNC55K1152FS	81349	RESISTOR, FXD, FILM	ĩ		PADZZ
- 31	RN55D1152F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 32	RCR42G104JS	81349	RESISTOR, FXD, COMP	1		PADZZ
- 32 - 33	ERD50TJ510	54473	RESISTOR, FXD, COMP	1		PADZZ
- 33 - 34	RNC55K6811FS	81349	RESISTOR, FXD, FILM	1		PADZZ
0.5	RNC55K3011FS	81349		1		PADZZ
	CF07-102J		RESISTOR, FXD, FILM			
- 36 - 37	10087-4614	78488	. RESISTOR, FXD, COMP	3		PADZZ
		14304	. TRANSFORMER, RF	6		PADZZ
- 38	10086-4520	14304	. TRANSFORMER, RF	2		PADZZ
- 39	JAN1N750A	81349	. SEMICOND DEVICE, DIO	1		PADZZ
- 40	10087-4609	14304	. CIRCUIT CARD	1		XB
- 41	10087-4611	14304	. TUBING, BRASS	2		XB
- 42	10087-4619	14304	. PLATE	1		XB
- 43	226619-3	00779	. TERMINAL	2		PADZZ
- 44	10087-4613	14304	. EYELET	12		XB

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
- 45	10087-4624	14304	. BRACKET,MTG	1		ХВ
- 46	18099C-B044014A	0.6540	. SPACER	8		XВ
- 47	MS51957-14	96906	. SCREW, MACHINE (AP)	10		PADZZ
- 48	MS35338-135	96906	. WASHER, LOCK (AP)	6		PADZZ
49	18100C-B-0440	06540	. SPACER	2		XB
- 50	10087-4626	14304	. BRACKET, MTG	1		XB
- 51	MS51957-27	96906	. SCREW, MACHINE (AP)	4		PADZZ
- 52	MS35338-136	96906	. WASHER, LOCK (AP)	2		PADZZ
- 53	10087-4608	14304	. CONTACT, ELEC	1		XB
- 54	MS25281R-3	96906	. CLAMP, LOOP	2		PADZZ
55	MS35333-71	96906	. WASHER, LOCK (AP)	2		PADZZ
- 56	MS24693-C26	96906	. SCREW, MACHINE (AP)	1		PADZZ
- 57	MS35489-1	96906	. GROMMET	2		PADZZ
- 58	MS3367-4-9	96906	. STRAP, TIE DOWN	3		PADZZ
- 59	841-00	92967	. NUT, CLINCH (AP)	4		PADZZ
- 60	н-6768	14304	. NUT, CLINCH (AP)	2		XB
- 61	н-6767	14304	. NUT, CLINCH (AP)	2		XB
				11.0		

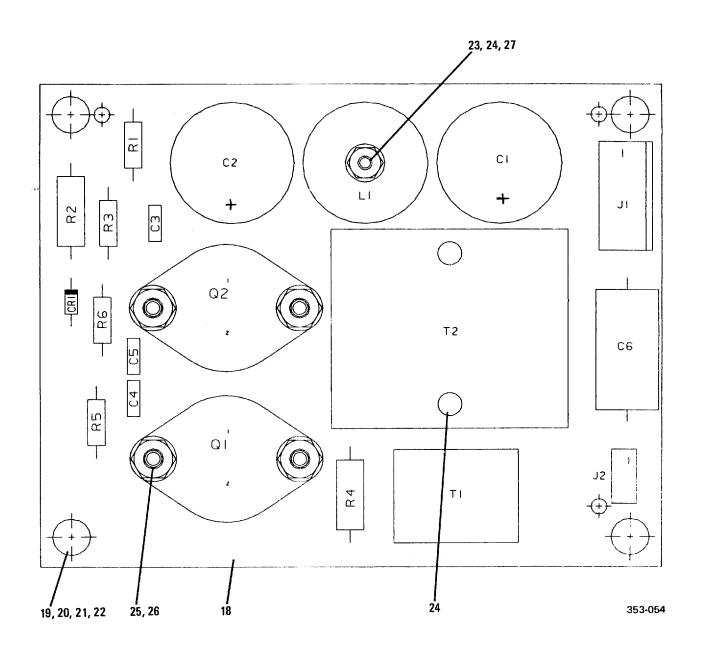


Figure 7-16. Fan Inverter PWB Assy, A4

NOTE

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-16- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9	10087-1500 674D128H025JE5A CK06BX104K M39014/02-1360 CK06BX474K 439P4749220 JAN1N3611 09-65-1061 3-102202-4 L13-0001-101	14304 56289 81349 81349 56289 81349 27264 00779 14304	CIRCUIT CARD ASSY,A4 . CAP,FXD,ELCTLT . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,FILM . SEMICOND DEVICE,DIO . CONNECTOR,RCPT,ELEC . CONL,RF	1 2 1 1 1 1 1 1		PAOLD PADZZ
- 10 - 11 - 12 - 13 - 14 - 15 - 16 - 17 - 18 - 19 - 20 - 21 - 22 - 23 - 24	2N5881 ERD50TJ182 RCR32G2R7JS ERD50TJ101 RCR32G100JS ERD50TJ3R9 10086-1516 10086-1519 10087-1509 6611-0135 10085-5156 MS51957-17 MS35338-135 MS51957-122 841-00	80131 54473 81349 54473 81349 54473 14304 14304 14304 14304 96906 96906 96906 92967	TRANSISTOR RESISTOR, FXD, COMP RESISTOR, FXD, COMP RESISTOR, FXD, COMP RESISTOR, FXD, COMP TRANSFORMER, RF TRANSFORMER, RF CIRCUIT CARD RETAINER, SCREW BUSHING SCREW, MACHINE (AP) WASHER, LOCK (AP) SCREW, MACHINE (AP) NUT, CLINCH (AP)	2 1 1 1 2 1 1 4 4 4 1 3		PADZZ
- 25 - 26 - 27	MS51957-28 H-6768 MS15795-804	96906 14304 96906	. SCREW, MACHINE (AP) . NUT, CLINCH (AP) . WASHER, FLAT (AP)	4 4 1		PADZZ XB PAOZZ

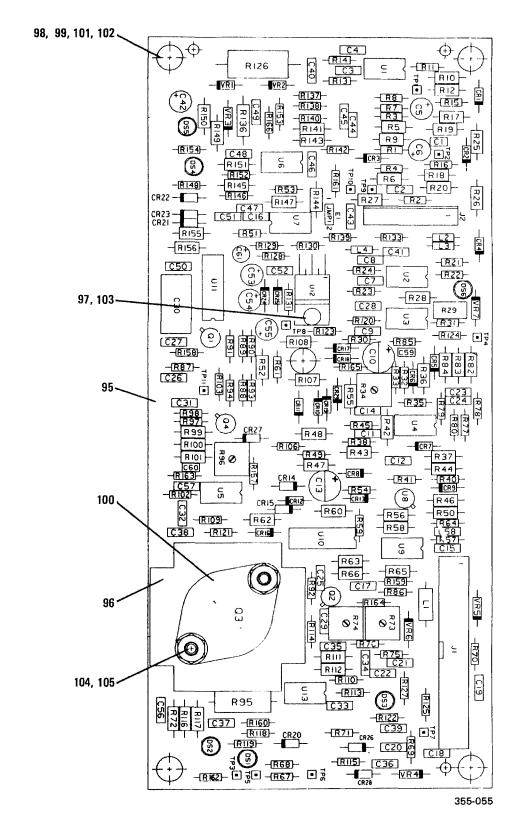


Figure 7-17. Power Control PWB Assy, A5

NOTE

	TOTAL PARIET PWB ASSY IS 17					
Figure	Dort Number	ECCH	Departution	Units	Usable	СИП
& Index	Part Number	FSCM	Description	Per	On	SMR
Number			1 2 3 4 5 6 7	Assy	Code	Code
7-17-	10086-7100	14304	CIRCUIT CARD ASSY, A5	1		PAODD
~ 1	CK05BX471K	81349	. CAPACITOR, FXD, CER	$\bar{2}$		PADZZ
- 2	СКО6ВХ1ОЗК	81349	. CAPACITOR, FXD, CER	40		PADZZ
- 3	T392C105K050AS	31433	. CAP, FXD, ELCTLT	1		PADZZ
- 4	T392C105M050AS	31433	. CAP, FXD, ELCTLT	1		PADZZ
- 5	T392F157M016AS	31433	. CAP, FXD, ELCTLT	2		PADZZ
- 6	CK06BX104K	81349	. CAPACITOR, FXD, CER	7		PADZZ
- Ž	C28OMAH/A1M	25403	. CAPACITOR, FXD, FILM	1		PADZZ
- 8	T392C106M025AS	31433	. CAP, FXD, ELCTLT	4		PADZZ
- 9	M39014/01-1321	81349	. CAPACITOR, FXD, CER	1		PADZZ
- 10	M39014/01-1357	81349	. CAPACITOR, FXD, CER	1		PADZZ
- 11	T392B685K016AS	31433	. CAP, FXD, ELCTLT	$\bar{1}$		PADZZ
- 12	JAN1N5711	81349	. SEMICOND DEVICE, DIO	3		PADZZ
- 13	JAN1N4454	81349	. SEMICOND DEVICE DIO	22		PADZZ
- 14	JAN1N3611	81349	. SEMICOND DEVICE, DIO	4		PADZZ
- 15	5082-4955	01295	. LED	i		PADZZ
- 16	5082-4555	01295	. LED	$\bar{2}$		PADZZ
- 17	5082-4655	01295	. LED	3		PADZZ
- 18	65499–102	22526	. CONNECTOR, RCPT, ELEC	1		PADZZ
- 19	609-4027	59730	. CONNECTOR, RCPT, ELEC	ī		PADZZ
- 20	22-11-2102	27264	. CONNECTOR, RCPT, ELEC	ī		PADZZ
- 21	3720046010	13499	. CONN PLUG ELECTRICA	1		PADZZ
- 22	MS14046-8	96906	. COIL, RF	ī		PADZZ
- 23	MS75085-19	96906	. COIL, RF	$\bar{2}$		PADZZ
- 24	MS75084-3	81349	. COIL, RF	$\bar{1}$		PADZZ
- 25	JAN2N2222A	81349	. TRANSISTOR	2		PADZZ
- 26	JAN2N2907A	81349	. TRANSISTOR	$\bar{1}$		PADZZ
- 27	JAN2N6383	81349	. TRANSISTOR	<u>1</u>		PADZZ
- 28	CF07-100J	78488	. RESISTOR, FXD, COMP	37		PADZZ
- 29	CF07-222J	78488	. RESISTOR, FXD, COMP	9		PADZZ
- 30	RNC55K9762FS	81349	. RESISTOR, FXD, FILM	2		PADZZ
- 31	RN55D9762F	81349	. RESISTOR, FXD, FILM	ī		PADZZ
- 32	CF07-103J	78488	. RESISTOR, FXD, COMP	20		PADZZ
- 33	RNC55K2613FS	81349	. RESISTOR, FXD, FILM	3		PADZZ
- 34	RNC55K4752FS	81349	. RESISTOR, FXD, FILM	4		PADZZ
- 35	CF07-273J	78488	. RESISTOR, FXD, COMP	i		PADZZ
- 36	RNC55K1823FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 37	RNC55K3923FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 38	RN55D2613F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 39	RNC55K9092FS	81349	. RESISTOR, FXD, FILM	2		PADZZ
- 40	CF07-104J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 41	CF07-683J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 42	RN55D4752F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 43	RNC55K4751FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 44	RNC55K7502FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
• • • • • • • • • • • • • • • • • • • •			, , , , , , , , , , , , , , , , , , ,			

Figure & Index	Part Number	FSCM	Description	Units Per	Usable On	SMR
Number	Fait Humbel	I SOM	1 2 3 4 5 6 7	Assy	Code	Code
	2206n 1 202	2000		<u> </u>		
- 45	3386B-1-203	32997	. RESISTOR, VARIABLE	1		PADZZ
- 46	CF07-123J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 47	CF07-223J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 48	3386F-1-104	32997	. RESISTOR, VARIABLE	1		PADZZ
- 49	CF07-101J	78488	. RESISTOR, FXD, COMP	3		PADZZ
- 50	RN55D1002F	81349	. RESISTOR, FXD, FILM	15		PADZZ
- 51	CF07-472J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 52	CF07-105J	78488	. RESISTOR, FXD, COMP	3		PADZZ
- 53	RN55D3923F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 54	RNC55K7151FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 55	CF07-102J	78488	. RESISTOR, FXD, COMP	7		PADZZ
- 56	RNC55K3322FS	81349	. RESISTOR, FXD, FILM	4		PADZZ
- 57	CF07-153J	78488	RESISTOR, FXD, COMP	1		PADZZ
- 58	RN55D3322F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 59	RNC55K2211FS	81349	. RESISTOR, FXD, FILM	3		PADZZ
- 60	RN55D2211F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 61	RNC55K4322FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 62	3386F-1-102	80294	. RESISTOR, VARIABLE	2		PADZZ
- 63	CF07-471J	78488	. RESISTOR, FXD, COMP	3		PADZZ
- 64	RNC55K6812FS	81349	. RESISTOR, FXD, COMP	1		PADZZ
- 65	RN55D2554F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 66	RN55D9092F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 67	CF07-122J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 68	CF07-562J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 69	RWR89S1ROOFS	81349	. RESISTOR, FXD, WW	1		PADZZ
- 70	3386F-1-203	32997	. RESISTOR, VARIABLE	1		PADZZ
- 71	RNC55K4321FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 72	RNC55K1501FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 73	RNC55K1303FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
74	RNC55K5621FS	81349	. RESISTOR, FXD, FILM	2		PADZZ
- 75	RN55D1502F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 76	RCR42G330JS	81349	. RESISTOR, FXD, COMP	1		PADZZ
- 77	CF07-822J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 78	CF07-333J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 79	ERD50TJ151	54473	. RESISTOR, FXD, COMP	1		PADZZ
- 80	CF07-682J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 81	RNC55K2493FS	81349	. RESISTOR, FXD, FILM	2		PADZZ
- 82	RNC55K3481FS	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 83	RN55D5621F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 84	RN55D2491F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 85	65499-101	22526	. CONNECTOR, RCPT, ELEC	11		PADZZ
- 86	MC1558U	04713	. MICROCIRCUIT	9		PADZZ
- 87	2N5566	80131	. TRANSISTOR	1		PADZZ
- 88	SM-A-938092	80063	. MICROCIRCUIT	1		PADZZ
- 89	CD40106BF/3	02735	. MICROCIRCUIT	1		PADZZ
- 90	TDA2002H	04713	. MICROCIRCUIT	1		PADZZ
- 91	JAN1N3825A	81349	. SEMICOND DEVICE, DIO	1		PADZZ
- 92	1N4733A	80131	. SEMICOND DEVICE, DIO	1		PADZZ
- 93	0.5M6.8AZ1	04713	. SEMICOND DEVICE, DIO	1		PADZZ
- 94	JAN1N751A	81349	. SEMICOND DEVICE, DIO	3		PADZZ
- 95	10086-7109	14304	. CIRCUIT CARD	1		XA

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Per	able On SMR code Code
- 96 - 97 - 98 - 99 -100 -101 -102 -103 -104 -105	6051B MS51957-14 MS51957-17 MS35338-135 56-03-2 6611-0135 10085-5156 841-00 H-6768 MS51957-29	13103 96906 96906 96906 13103 14304 14304 92967 14304 96906	. HEATSINK . SCREW, MACHINE . SCREW MACHINE . WASHER, LOCK . INSULATOR PLATE . RETAINER SCREW . BUSHING . NUT, CLINCH . NUT PLAIN HEX . SCREW, MACHINE	1 1 5 1 5 1 2 2	XB PADZZ PADZZ PADZZ XB PADZZ PADZZ PADZZ PADZZ PADZZ XB

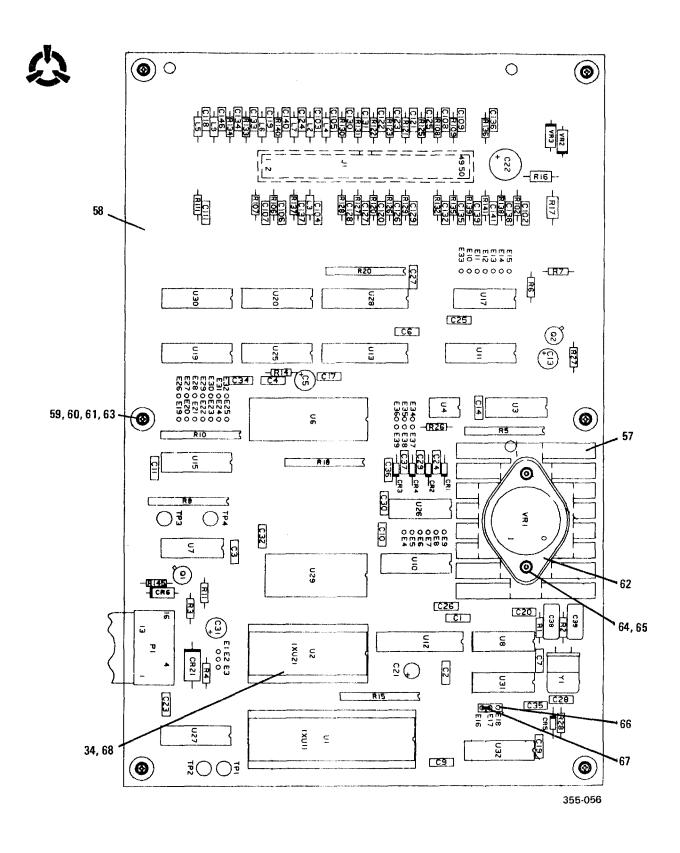


Figure 7-18. Micro Control PWB Assy, A6

NOTE

Figure & Index	Part Number	FSCM	Description	Units Per	Usable On	SMR
Number			1 2 3 4 5 6 7	Assy	Code	Code
7–18–	10086-9200	14304	CIRCUIT CARD ASSY, A6	1		PAODD
- 1	CK06BX103K	81349	. CAPACITOR, FXD, CER	54		PADZZ
- 2	199D476X0025EA2	56289	. CAP, FXD, ELCTLT	2		PADZZ
- 3	CKO6BX104K	81349	. CAPACITOR, FXD, CER	6		PADZZ
- 4	T392B106M010AS	31433	. CAP, FXD, ELCTLT	1		PADZZ
- 5	672D476H040CD5C	56289	. CAP, FXD, ELCTLT	1		PADZZ
- 6	T392F157K010AS	31433	. CAP, FXD, ELCTLT	1		PADZZ
- 7	CMRO5E330GODR	81349	. CAPACITOR, FXD, MICA	1		PADZZ
- 8	CM05ED330J03	81349	. CAPACITOR, FXD, MICA	1		PADZZ
- 9	JAN1N4454	81349	. SEMICOND DEVICE DIO	5		PADZZ
- 10	JAN1N755A	81349	. SEMICOND DEVICE, DIO	1		PADZZ
- 11	1N5817	80131	. SEMICOND DEVICE, DIO	1		PADZZ
- 12	5005027-E	15912	. CONNECTOR, RCPT, ELEC	1 7		PADZZ
- 13	MS75085-2	96906	. COIL, RF			PADZZ
- 14	100869210	14304	. CABLE ASSY,RF	1		XВ
- 15	JAN2N2222A	81349	. TRANSISTOR	2		PADZZ
- 16	CF07-471J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 17	CF07-472J	78488	. RESISTOR, FXD, COMP	2		PADZZ
- 18	CF07-363J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 19	4310R-101-103	32997	. RESISTOR NETWORK	6		PADZZ
- 20	CF07-105J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 21	4310-101-103	32997	RESISTOR NETWORK	1		PADZZ
22	CF07-104J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 23	CF07-223J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 24	RN55D1502F	81349	. RESISTOR, FXD, FILM	1		PADZZ
- 25	RN55D4751F	81349	. RESISTOR, FXD, FILM			PADZZ
- 26	CF07-103J	78488	. RESISTOR, FXD, COMP	1 2		PADZZ
- 27	CF07-102J	78488	. RESISTOR, FXD, COMP	1		PADZZ
- 28	CF07-101J	78488	. RESISTOR, FXD, COMP	37		PADZZ
- 29	1050858001	74970	. JACK, TIP	1		PADZZ
- 30	105-0852-001	74970	. JACK, TIP	1		PADZZ
- 31	1168004P6	94117	. JACK, TIP	1		PADZZ
- 32	105-0857-001	74970	. JACK, TIP	1		PADZZ
- 33	TD8031AH	34649	. MICRÓCIRCUIT	1		PADZZ
- 34	10086-9530	14304	. EPROM, PROGRAMMED	1		PADZZ
- 35	CD4011BD/3	02735	. MICROCIRCUIT	1		PADZZ
- 36	H11L1	03508	. MICROCIRCUIT	1		PADZZ
- 37	ADC0808CCJ	27014	. MICROCIRCUIT	1		PADZZ
- 38	M38510/31004BCB	81349	. MICROCIRCUIT	1		PADZZ
- 39	M38510/30003BCB	81349	. MICROCIRCUIT	1		PADZZ
- 40	SN54LS367AJ	01295	. MICROCIRCUIT	1		PADZZ
- 41	ULQ-2003R	56289	. MICROCIRCUIT	3		PADZZ
- 42	M38510/32502BRB	81349	. MICROCIRCUITS	3		PADZZ
- 43	SN54LS373J	01295	. MICROCIRCUITS	$\bar{1}$		PADZZ
- 44	CD4021BF	02735	. MICROCIRCUIT	1		PADZZ
	-	_ · · · ·				

- 45 MM54C14J 04713 . MICROCIRCUITS 1 - 46 CD4094BF 02735 . MICROCIRCUIT 2 - 47 CD4002BF 02735 . MICROCIRCUIT 1 - 48 M38510/30702BEB 81349 . MICROCIRCUIT 1 - 49 TC5516ADL 61802 . MICROCIRCUIT 1 - 50 M38510/32702BCB 81349 . MICROCIRCUIT 1 - 51 CD4020BF 02735 . MICROCIRCUIT 1	PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ
- 47 CD4002BF 02735 . MICROCIRCUIT 1 - 48 M38510/30702BEB 81349 . MICROCIRCUIT 1 - 49 TC5516ADL 61802 . MICROCIRCUIT 1 - 50 M38510/32702BCB 81349 . MICROCIRCUIT 1	PADZZ PADZZ PADZZ PADZZ
- 48 M38510/30702BEB 81349 . MICROCIRCUIT 1 - 49 TC5516ADL 61802 . MICROCIRCUIT 1 - 50 M38510/32702BCB 81349 . MICROCIRCUIT 1	PADZZ PADZZ PADZZ
- 49 TC5516ADL 61802 . MICROCIRCUIT 1 - 50 M38510/32702BCB 81349 . MICROCIRCUIT 1	PADZZ PADZZ
- 50 M38510/32702BCB 81349 . MICROCIRCUIT 1	PADZZ
51 CD4020RF	
	PADZZ
- 52 UA7805KMQB 07263 . MICROCIRCUIT 1	PADZZ
- 53 JAN1N751A 81349 . SEMICOND DEVICE, DIO 2	PADZZ
- 54 540-AG11D 91506 . SOCKET PLUGIN ELECT 1	PADZZ
– 55 528-AG11D 91506 . SOCKET PLUGIN ELECT 1	PADZZ
- 56 MPO42 71450 . CRYSTAL 1	PADZZ
- 57 330-T0-3 53894 . HEATSINK 1	XB
- 58 10086-9209 14304 . CIRCUIT CARD 1	XA
- 59 6611-0135 14304 RETAINER SCREW 6	PADZZ
- 60 10085-5156 14304 . BUSHING 6	PADZZ
- 61 MS51957-17 96906 . SCREW MACHINE 6	PADZZ
- 62 56-03-2 13103 . MICA, TO-3 1	PADZZ
- 63 MS35338-135 96906 . WASHER, LOCK 6	PADZZ
- 64 MS51957-28 96906 . SCREW, MACHINE 2	PADZZ
- 65 H-6768 14304 . NUT PLAIN HEX 2	XB
- 66 65499-103 22526 . JACK, TIP 1	PADZZ
- 67 65474-001 22526 . CONTACT, ELEC 1	PADZZ
- 68 TD271-28-4 34649 . EPROM, UNPROGRAMMED 1	PADZZ

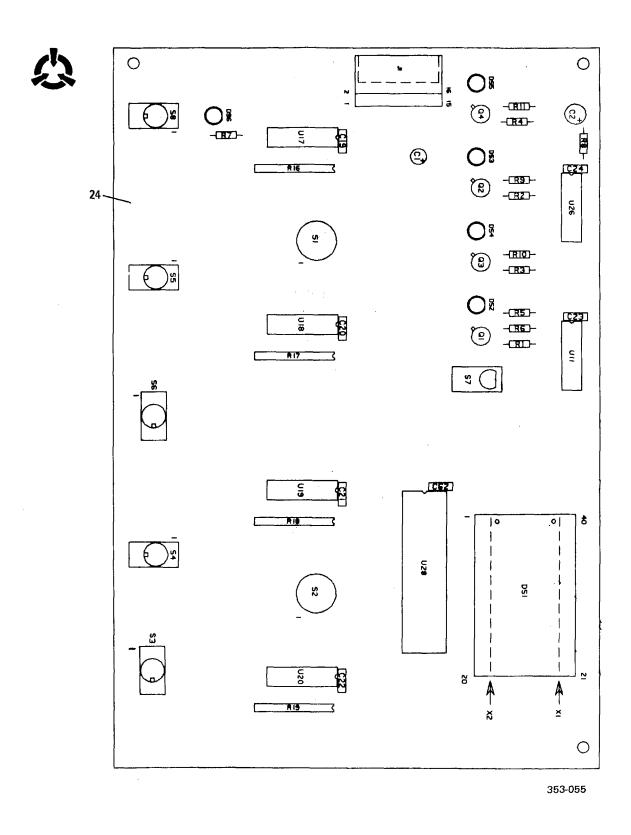


Figure 7-19. Front Panel PWB Assy, A7A1

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-19- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10 - 11 - 12 - 13 - 14 - 15 - 16 - 17 - 18 - 19 - 20 - 21 - 22 - 23 - 24 - 25	10087-2100 T392B106M010AS T392C226M010AS CK06BX103K 44R3F03KGBJ 561-2101-080 561-2301-080 609-1607 JAN2N2222A CF07-271J CF07-103J CF07-472J CF07-223J 4310R-101-103 55DP30011AJNC 7101TV30QE 7105TV30QE 8168SHV30QE SN54LS367AJ CD4021BF CD4094BF HLCD0438AY ESS-120-T/04 10086-2109 7103TV30QE	14304 31433 31433 81349 51984 72619 72619 72619 15912 81349 78488 78488 78488 78488 32997 81073 09353 09353 09353 09353 09353 01295 77609 77609 61587 55322 14304 09353	CIRCUIT CARD ASSY,A7A1 CAP,FXD,ELCTLT CAP,FXD,ELCTLT CAPACITOR,FXD,CER SEMICOND DEVICE SEMICOND DEVICE,DIO SEMICOND DEVICE,DIO SEMICOND DEVICE,DIO CONNECTOR,RCPT,ELEC TRANSISTOR RESISTOR,FXD,COMP RESISTOR,FXD,COMP RESISTOR,FXD,COMP RESISTOR,FXD,COMP SWITCH ROTARY SWITCH TOGGLE SWITCH,TOGGLE SWITCH PUSH MICROCIRCUIT MICROCIRCUIT MICROCIRCUIT SOCKET,LCD CIRCUIT CARD SWITCH TOGGLE	1 1 1 7 1 1 3 1 1 4 5 1 4 1 4 2 3 1 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1		PAODD PADZZ

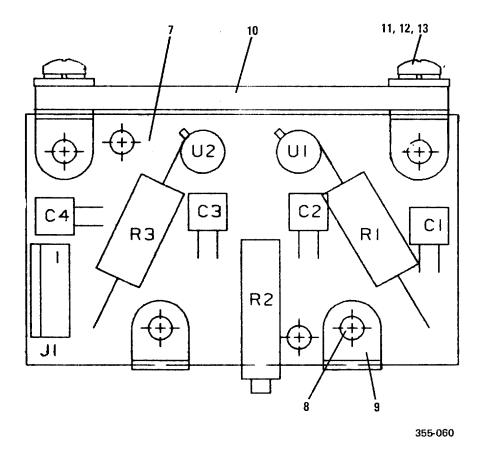


Figure 7-20. Temp Sensor PWB Assy, A8

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-20 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10	10086-7200 8121-050-651-103 22-11-2052 FP69-180ROJ 013334 FP69-180R-5PCT LM135H 10086-7209 AB4-2A 741 10086-7203	14304 72982 27264 14674 31922 14674 27014 14304 10054 79963 14304	CIRCUIT CARD ASSY,A8 . CAPACITOR,FXD,CER . CONNECTOR,RCPT,ELEC . RESISTOR,FXD,FILM . RESISTOR,VARIABLE . RESISTOR,FXD,FILM . MICROCIRCUIT . CIRCUIT CARD . RIVET,BLIND . BRACKET,ANGLE . HONEYCOMB	1 4 1 2 1 1 2 1 4 4		PAOLD PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ XA XB XB XB
- 11 - 12 - 13	MS51957-16 MS15795-803 MS35338-135	96906 96906 96906	. SCREW, MACHINE (AP) . WASHER, FLAT (AP) . WASHER, LOCK (AP)	2 2 2		PAOZZ PADZZ PADZZ

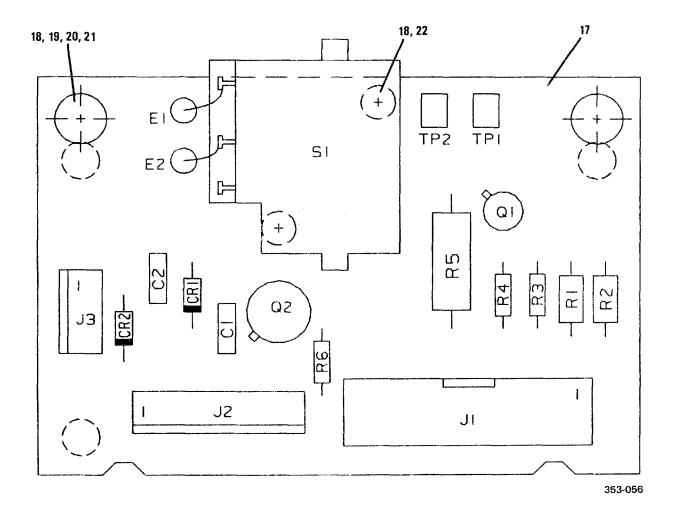


Figure 7-21. Interconnect PWB Assy, A9

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-21- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10 - 11 - 12 - 13 - 14 - 15 - 16 - 17 - 18 - 19 - 20 - 21 - 22	10087-3140 CK06BX103K CK06BX104K JAN1N3611 609-2627 09-65-1061 22-11-2052 JAN2N22907A JAN2N2219A RN55D1152F RNC55K3321FS CF07-472J CF07-102J RCR32G271JS MS16106-4 105-1102-001 105-1108-001 10087-3149 MS35338-135 6611-0135 10085-5156 MS51957-17 MS51957-13	14304 81349 81349 81349 59730 27264 27264 81349 81349 81349 78488 78488 78488 7849 96906 74970 74970 14304 96906 14304 96906	CIRCUIT CARD ASSY, A9 . CAPACITOR, FXD, CER . CAPACITOR, FXD, CER . SEMICOND DEVICE, DIO . CONNECTOR, RCPT, ELEC . CONNECTOR, RCPT, ELEC . CONNECTOR, RCPT, ELEC . TRANSISTOR . TRANSISTOR . RESISTOR, FXD, FILM . RESISTOR, FXD, FILM . RESISTOR, FXD, COMP . RESISTOR, FXD, COMP . RESISTOR, FXD, COMP . SWITCH INTERLOCK . JACK, TIP . JACK TIP . CIRCUIT CARD . WASHER, LOCK (AP) . RETAINER, SCREW . BUSHING . SCREW, MACHINE (AP) . SCREW MACHINE	1 1 1 2 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		PAOLD PADZZ


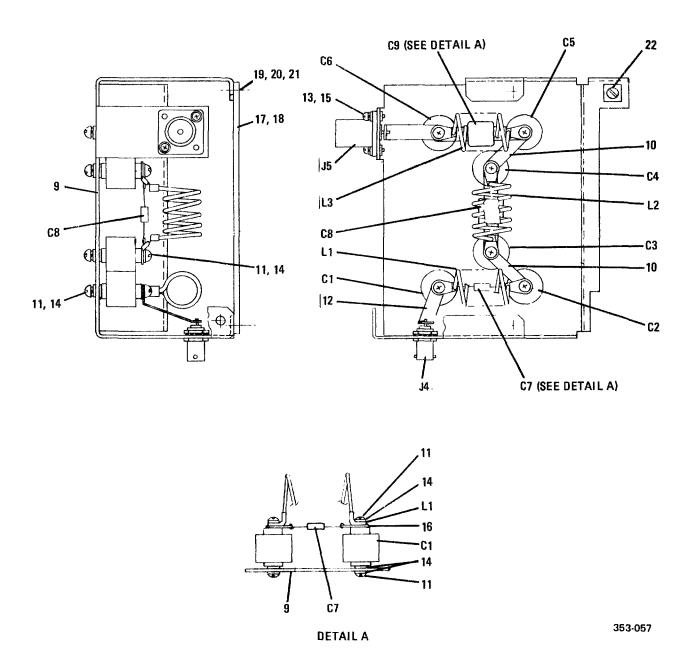


Figure 7-22. Low Pass Filter PWB Assy, A10

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number	Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7-22- - 1 - 2 - 3 - 4 - 5 - 6 - 7 - 8 - 9 - 10 - 11 - 12 - 13 - 14 - 15 - 16 - 17 - 18 - 19 - 20 - 21 - 22	10087-4500 HT50V500JA J1HT50CG620J452 VY81C150 VY81C360J VY81C360 M39012/21-0003 M39012/04-0002 10087-4515 10087-4511 10087-4514 MS51957-26 10087-4516 MS51957-14 MS35333-71 841-00 MS77067-2 10085-4518 MP-0745 MS51957-28 MS15795-806 MS35338-136 SQ-C4-20	14304 21052 73905 95275 95275 95275 80131 80131 14304 14304 14304 96906 14304 96906 96906 92967 96906 14304 14304 14304 14304 96906 96906 96906 96906 96906	FILTER ASSY,RF,A10 . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CAPACITOR,FXD,CER . CONNECTOR,RCPT,ELEC . CONNECTOR,RCPT,ELEC . TRANSFORMER,RF . CASE,MTG . CONTACT,ELEC . SCREW,MACHINE (AP) . CONTACT,ELEC . SCREW,MACHINE (AP) . WASHER,LOCK (AP) . NUT,CLINCH (AP) . TERMINAL,LUG . COVER LPF . LABEL,WARNING . SCREW,MACHINE (AP) . WASHER,FLAT (AP) . WASHER,FLAT (AP) . WASHER,LOCK (AP) . RECEPTOR,CATCH	1 2 4 1 1 1 1 2 12 1 2 18 2 2 1 1 3 3 3 1 1 2 1 1 3 3 3 3 3 3 1		PAOLD PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ PADZZ XB XB PAOZZ XB PAOZZ XB PADZZ XB PADZZ XB XB PADZZ PADZZ XB XB

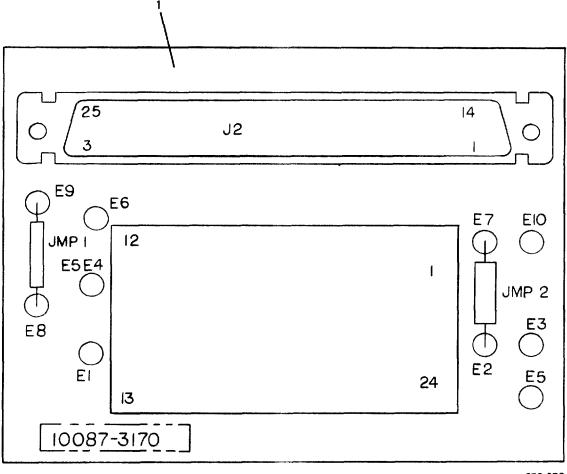

353-058

Figure 7-23. Connector PWB Assy, A11

NOTE

To find index numbers for circuit board components, use the reference designator index at the end of this chapter. The complete reference designator for a circuit board component consists of "1," followed by the assembly designator (A1, A2, etc.), then the reference designator on the illustration. For example, the complete reference designator for R25 on the Front Panel PWB Assy is 1A7A1 R25.

Figure & Index Number		Part Number	FSCM	Description 1 2 3 4 5 6 7	Units Per Assy	Usable On Code	SMR Code
7–23– – – –	1 2 3	10087-3170 DS-25-P07-1E MP-1142 10086-3179	14304 72835 14304 14304	CIRCUIT CARD ASSY,A11 . CONNECTOR,RCPT,ELEC . JUMPER,ELEC . CIRCUIT CARD	1 1 2 1		PAOZZ XA XA XA

Section III. NUMERICAL INDEX

Section III. NOWERICAL INDEX												
Part	Fig	index	Qty per	Part	Flg	Index	Qty per					
Number	No.	No.	End Item	Number	No.	No.	End Item					
A1690	7–10	11	20	CMRO5E470GODR	7-5	2	1					
A2-61864	7-4	18	1	CMROSE750GODR	7-15	8	î					
AB4-2A	7-20	8	4	D-142-50	7-4	54	2					
ADC0808CCJ	7-18	37	i	DBM25P	7–3	9	1					
AJ4-35	7-6	19	4	DS-25-P07-1E	7-23	í	1					
AJ4-505-S	7-4	52	3	ERD50TJ101	7-16	13	1					
AN565DC4L4	7-1	19	4	ERD50TJ151	7-17	79	1					
AN921-6	7-4	39	5	ERD50TJ182	7-16	11	1					
C-11-NPO-5	7-15		1	ERD50TJ224	7-10	8	1					
C11-NP0-3 C11-0004-029	7-10		2		7-16	15	2					
	7-10		3	ERD50TJ3R9			1					
C11-0004-037			1	ERD50TJ510	7–15	33						
C280MAH/A1M	7-17			ESS-120-T/04	7-19	23	2					
CD4002BF	7-18	47	1	FB-46-2	7-13	9	2					
CD40106BF/3	7-17	89	1	FP69-180R-5PCT	7-20	5	2					
CD4011BD/3	7-18		1	FP69-180R0J	7-20	3	2					
CD4020BF	7–18		1	н-6767	7-7	25	7					
CD4021BF	7-19		6	н-6768	7-4	44	39					
CD4094BF	7-19		3	H11L1	7–18	36	1					
CF07-100J	7-17		39	HLCD0438AY	7–19	22	1					
CF07-101J	7-17		5	HT50T050JA	7–9	3	1					
CF07-102J	7-14		20	HT50T101JB	7-8	3	4					
CF07-103J	7-14		37	HT50V250JA	7–8	5	6					
CF07-104J	7–17		3	HT50V500JA	7–8	4	5					
CF07-105J	7–17		5	HT55T309CB	7-4	1	1					
CF07-122J	7–17	67	1	J1HT50CG620J452	7-22	2	4					
CF07-123J	7-17	46	1	J1HT50UJ141J252	7–8	2	2					
CF07 -153J	7-17	57	1	JAN1N3611	7-15	11	11					
CF07-183J	7-14	18	1	JAN1N3825A	7-17	91	1					
CF07-221J	7-15	27	1	JAN1N4454	7-14	6	43					
CF07-222J	7-14	21	14	JAN1N5711	7-4	7	8					
CF07-223J	7-19	13	3	JAN1N750A	7-15	39	1					
CF07-270J	7-14		1	JAN1N751A	7-5	14	7					
CF07-271J	7-19		5	JAN1N752A	7-14	24	1					
CF07-273J	7-17		3	JAN1N755A	7-18		$ar{1}$					
CF07-333J	7-17		1	JAN2N2219A	7-14	13	$\bar{2}$					
CF07-363J	7-18		ī	JAN2N2222A	7-14	12	12					
CF07-3033 CF07-471J	7-10	13	7	JAN2N2907A	7-14		9					
CF07-4713 CF07-472J	7-14		21	JAN2N2307A JAN2N6383	7-14		3					
CF07-4723 CF07-562J	7-14		1	JAN2N6648	7-14		3					
CF07-3623 CF07-681J	7-14		1	JV-5	7-14	5	1					
	7-14		4	V-5 KC-79-123	7-7 7-15	ر 14	1					
CF07-682J	7-17		1		7-15		1					
CF07-683J	7-17 7-17		1	L13-0001-101	7-10							
CF07-822J	7-17		2	LM135H	7-20 7-18		2 1					
CK05BX471K	7-13		23	M38510/30003BCB			1					
CK06BX103K			23 5	M38510/30702BEB	7-18		1					
CKO6BX104K	7-5	1		M38510/31004BCB	7-18	38						
CKO6BX472K	7-14		2	M38510/32502BRB	7-18		3					
CKO6BX474K	7-16		2	M38510/32702BCB	7–18		1					
CK70AW152M	7-4	5	1	M39012/04-0002	7-15		2					
CM05ED330J03	7-18		2	M39012/16-007	7-15		2					
CMRO5C100D0DR	7-15		1	м39012/21-0003	7–11	6	2					
CMRO5E330GODR	7–18	7	2	Į.								
	الاستجارة	المتتحد بالأراد										

Part Number	Fig No.	Index No.	Qty per End Item	Part Number	Fig No.	index No.	Qty per End Item
	5 X						
M39014/01-1321	7-17 7-15		1	MS51957-29	7-4	31	6
M39014/01-1351 M39014/01-1357	7-13		6 2	MS51957-30 MS51957-44	7-3 7-4	6	19
M39014/01-1337 M39014/02-1332	7-17		2	MS51957-44 MS51959-14		23	8 7
M39014/02-1337	7-1 4 7-15		1	MS51959-14 MS51959-28	7-7	16 19	
M39014/02-1337 M39014/02-1338	7-13 7-5	3	130	MS51959-28 MS51959-44	7-7	19	3 2 2
M39014/02-1360	7-16		2	MS75083-1	7–13 7–15	20	2
M39014/02-1300 M39014/2-1350	7-10 7-4	6	20	MS75084-3	7-13	24	1
MC14028BBEBS	7-4 7-14		1	MS75084-3 MS75085-17	7-17 7-15	24 21	1
MC14028BBBBB MC1558U	7-14		9	MS75085-17 MS75085-19	7-17	23	2
MCM01-007EC621G0	7-17		1	MS75085-19	7-17	13	2 7
MM54C14J	7-18		1	MS75085-7	7-15	19	2
MP-0745	7-22		1	MS77067-2	7-13	16	2
MP-1142	7-23		2	MS77068-1	7-22	9	2 5
MPO42	7–18		1	MS77068-2	7-4	11	4
MS14046-8	7–17		ī İ	MS77068-3	7-4	10	1
MS15795-803	7-7	28	4	MS90539-11	7-4	13	1
MS15795-804	7–16		26	MS90541-05	7-15	18	ī
MS15795-805	7-7	17	20	P101-447-495	7-7	27	2
MS15795-806	7-22		3	RCR32G100JS	7–16	14	1
MS15795-807	7-4	24	8	RCR32G271JS	7-21	13	1
MS16106-4	7-21		1	RCR32G2R7JS	7-16	12	1
MS21266-1N	7-6	21	33	RCR32G470JS	7-14	19	1
MS21266-2N	7-4	46	5	RCR42G104JS	7–15	32	1
MS24693C26	7-15	56	4	RCR42G330JS	7–17	76	1
MS24693-C28	7–4	34	2	RLR32C56R0FM	7–15	26	2 2
MS25281R-3	7-15		2	RLR32C56R2FS	7–15	25	2
MS3102R28-18P	7-2	16	1	RN55D1002F	7–17	50	17
MS313-4994F	7-4	16	1	RN55D1152F	7–15	31	2
MS3367-4-9	7–4	55	45	RN55D1502F	7-17	75	3 2 3
MS35333-70	7–10	_	7	RN55D2211F	7–17	60	2
MS35333-71	7–8	9	93	RN55D2491F	7–17	84	
MS35333-72	7-13		4	RN55D2554F	7-17	65	1
MS35338-135	7-4	35	3	RN55D2613F	7-17	38	2
MS35338-136	7-6	27	24	RN55D3322F	7-17	58	2
MS35338-137	7-6	29	4	RN55D3923F	7–17	53	2
MS35489-1	7-15		2	RN55D4751F	7-18	25	3
MS35649-244	7-4	32	1	RN55D4752F	7-17	42	2
MS35649-265	7-4	42	2 10	RN55D5621F RN55D9092F	7–17 7–17	83 66	2 2
MS51021-22	7-13 7-13		10 2	RN55D9092F RN55D9762F	7-17 7-17	31	2
MS51021-23	7-13		1	RNC55K1133FS	7-17 7-5	12	1
MS51021-32 MS51957-122	7-13		1	RNC55K1133FS RNC55K1152FS	7-3 7-15	30	3
MS51957-122 MS51957-13	7-10	36	7	RNC55K1303FS	7-13 7-17	30 73	1
MS51957-13 MS51957-14	7-4 7-4	37	7	RNC55K1503FS	7-17	73 72	2
MS51957-14 MS51957-15	7-13		3	RNC55K1501F3	7-17 7-5	11	3
MS51957-16	7-13		. 2	RNC55K1823FS	7-17	36	1
MS51957-17	7-20	8	31	RNC55K2211FS	7-17	59	5
MS51957-26	7-22		12	RNC55K2493FS	7-17	81	2
MS51957-27	7-8	8	60	RNC55K2613FS	7-17		3
MS51957-28	7-14		42	RNC55K3011FS	7-15		1
	,						

T.O. 31R2-2URC-123

Part	Fig	Index	Qty per	Part	Ele.	Inday	Otymor
Number	No.	No.	End Item	Number	Fig No.	index No.	Qty per End Item
RNC55K3011FS	7–15	35		en in de la companya			
RNC55K3321FS	7-13	35 10	1 1	Z06-0008-001	7–13	17	1
RNC55K3322FS	7-21 7-17	56	4	0.5M6.8AZ1	7–17	93	1
RNC55K3481FS	7-17			010632B037	7-6	25	2
RNC55K3923FS	7-17 7-17	82	1	013334	7-20	4	1
RNC55K4321FS		37	2	05801	7–5	6	2
RNC55K4321FS RNC55K4322FS	7-17	71	1	08-56-0110	7–4	58	49
	7-17	61	1	09-65-1061	7–16	7	2
RNC55K4751FS	7-17	43	2	09-91-0600	7-2	20	2
RNC55K4752FS	7–17	34	4	10-109628-18S	7–3	10	2
RNC55K5111FS	7-5	9	1	10-36233-243	7–3	1	2 1
RNC55K5621FS	7-17	74	2	10019-1307	7-4	29	
RNC55K6811FS	7–15	34	1	10019-1308	7-4	27	1
RNC55K6812FS	7-17	64	1	10019-1309	7-4	28	. 1
RNC55K7151FS	7-17	54	1	10019-1310	7-4	22	1
RNC55K7502FS	7–17	44	1	10043-0033	7-4	3	1
RNC55K9092FS	7–17	39	2	10085-4518	7-22	17	1
RNC55K9762FS	7–17	30	3	10085-5156	7–5	17	23
RVR89S1ROOFS	7–17	69	1	10086-1400	7-2	13	1
SM-A-938092	7-17	88	1	10086-1516	7–16	16	1
SN54LS367AJ	7-19	19	3	10086-1519	7-16	17	1
SN54LS373J	7–18	43	2	10086-2109	7-19	24	1
SQ-C4-20	7–22	22	1	10086-3179	7-23	3	1
SR-4	7-4	53	9	10086-3703	7-13	1	2 .
T392B106M010AS	7–19	1	3	10086-3709	7-13	11	1
T392B685K016AS	7–17	11	1	10086-3712	7-7	7	1
T392C105K050AS	7-17	3	2	10086-3719	7-13	15	1
T392C105M050AS	7–17	4	2	10086-3720	7-6	6	1
T392C106M025AS	7-17	8	4	10086-3721	7-13	3	2
T392C226M010AS	7–19	2	3	10086-3722	7–13	4	2
T392F157K010AS	7–18	6	1	10086-3723	7-13	5	1
T392F157M016AS	7–17	5	2	10086-3724	7-13	6	ī
TC-105A	7–4	56	8	10086-3725	7-13	7	$\bar{1}$
TC5516ADL	7–18	49	1	10086-3726	7-6	14	ī l
TD271-28-4	7–18	68	1	10086-3727	7–13	14	1
TD8031AH	7–18	33	1	10086-3730	7-6	7	ĩ
TDA2002H	7–17	90	1	10086-3739	7-14	25	ī
UA7805KMQB	7-18	52	1	10086-3787	7–13	2	1
UFP1-100J	7–10	5	2	10086-3788	7-7	9	1
UFP1-110J	7–10	1	2	10086-3799	7-6	12 ́	1
UFP1-290J	7–10	7	2	10086-3806	7-7	6	3
UFP1-320J	7–11	1	4	10086-4520	7-15	38	2
UFP1-340J	7–10	3	3	10086-7100	7-2	5	1
UFP1-350J	7–10	2	1	10086-7109	7-17	95	1
UFP1-370J	7–11	5	2	10086-7200	7-17	10	1
UFP1-470J	7–11	3	1	10086-7203	7-20	10	1
UFP1-680J	7–11	2	2	10086-7209	7-20	7	1
ULQ-2003R	7–18	41	3	10086-9200	7-20 7-2	6	1
V3-343-D8	7–7	3	1	10086-9209	7-2 7-18	58	1
VY81C150	7-22	3	1	10086-9210	7–18	14	1
VY81C360	7-22	5	1	10086-9530	7-18	14 34	1
VY81C360J	7-22	4	1	10080-9530	7-18 7-X	34 0	1
W88UKDX-2	7-15	17	2	10087-0000	/ - A	U	T

Part Number	Fig No.	index No.	Qty per End Item	Part Number	Fig No.	Index No.	Qty per
							End Item
250817-1	7-2	39	1	609–1627	7-14	8	2
2994-14-1	7–2	15	2	609–2627	7-14	7	2
2N5566	7-17	87	1	609-4027	7-17	19	1
2N5881	7–16	10	2	65474-001	7–18	67	3
2T-4603-1	7–15	15	1	65499–101	7-17	85	11
3-102202-4	7–16	8	1	65499-102	7–17	18	3
330-то-3	7–18	57	1	65499-103	7–18	66	1
3386B-1-202	7–15	28	1	65499–105	7-14	30	4
3386B-1-203	7–15	29	3	6611-0135	7-5	16	23
3386F-1-102	7–17	62	2	6628-3460	7-7	4	1
3386F-1-104	7–17	48	1	672D476H040CD5C	7-18	5	3
3386F-1-203	7–5	10	2	672D686H025CD5C	7-14	5	2
3484–1000	7-4	47	10	674D128H025JE5A	7–16	1	2
3720046010	7–17	21	3	6A3-12H3706	7–13	12	2
391–3314	7-4	33	2	7101TV30QE	7–19	16	3
4310-101-103	7–18	21	2	7103TV30QE	7–19	25	1
4310R-101-103	7-19	14	4	7105TV30QE	7-6	11	2
439P4749220	7-16	5	1	741	7–20	9	4
43D33	7-7	8	1	745173-2	7–3	3	2
44R3F03KGBJ	7–19	4	1	745508-8	7–3	2	2
4521-75-62-1T	7–7	13	2	750-83-R4.7K	7-14	22	2
500-5027-E	7–18	12	1	755017A4514-1	7–10	4	2
5082-4555	7-17	16	2	75GA-D25	7-4	4	2
5082-4655	7-17	17	3	801591-31	7-14	4	2
5082-4955	7–17	15	1	8101FSP-90	7-2	17	1
5144-25-S-ZD	7–7	11	1	8101MP	7-4	14	1
5248	7-2	18	3	8121-050-651-103	7–20	1	4
528-AG11D	7–18	55	1	8154-A-0440-0	7–13	8	1
540-AG11D	7–18	54	1	8154-A-440-0	7-6	18	2
55DP30011AJNC	7–19	15	2	8168SHV30QE	7–19	18	1
56-03-2	7–17	100	2	841–00	7–6	30	11
561-2101-080	7–19	5	1	8519-A-0832-16	7–13	16	2
561-2201-080	7–19	7	1	885SP220L	7-7	2	1
561-2301-080	7–19	6	3	8877/3CX1500A7	7-4	19	1
5612-18-20	7-4	25	4	8948-3307	7-4	12	1
5804-128-1	7–13	24	2	904–380	7-5	19	2
6051B	7–17	96	1	90KL037	7–13	13	1
609–1607	7–19	8	1	9817-A-0832-16	7–13	10	2

Section IV. REFERENCE DESIGNATOR INDEX

Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	index No.	Reference Designation	Fig No.	Index No.
1A1	7–2	1	1A2A1C6	7–8	4	1A2A7C1	7-14	1
1A1A1	7-4	59	1A2A1C7	7–8	3	1A2A7C2	7-14	
1A1A1C1	7~5	í	1A2A1C8	7-8	4	1A2A7C3	7-14	วั
1A1A1C2	7-5	2	1A2A1C9	7-8	5	1A2A7C4	7-14	3
1A1A1C3	, 5 7-5	2 1	1A2A1C10	7-8	4	1A2A7C5	7-14	3 3 3
1A1A1C4	7-5 7-5	ī	1112111010	7-0	7	1A2A7C6	7-14	3
1A1A1C5	7-5 7-5	3	1A2A2	7-6	2	1A2A7C7	7-14	3 3
1A1A1J1	7-5 7-5	4	1A2A2A1	7-9	1	1A2A7C8	7-14	3
1A1A1J2	-5	5	1A2A2C11	7-9	2	1A2A7C9	7-14	3
1A1A1L1	7-5	5 6	1A2A2C12	7-9	2	1A2A7C10	7-14	2
1A1A1L2	7~5	7	1A2A2C12	7-9 7-9	2	1A2A7C10	7-14	3 3
1A1A1R1	7-5 7-5	8	1A2A2C13	7-9 7-9	2	1A2A7C11	7-14	3 4
1A1A1R2	7-5	9	1A2A2C14 1A2A2C15	7-9 7-9	2	1A2A7C12	7-14	
	7-5 7-5	10	1A2A2C15	7-9 7-9	3	1A2A7C13		3 5
1A1A1R3			IAZAZCIO	7-9	3		7-14	
1A1A1R4	7~5	11	14040	7.	_	1A2A7C15	7-14	3
1A1A1R5	7-5	12	1A2A3	7-6	3	1A2A7C16	7-14	3
1A1A1R6	7-5	13	1A2A3C1	7-10	1	1A2A7C17	7-14	3
1A1A1VR1	7~5	14	1A2A3C2	7-10	1	1A2A7C18	7–14	3
1A1A1VR2	7-5	14	1A2A3C3	7–10	2	1A2A7C19	7–14	3
1A1C2	7-4	1	1A2A3C4	7-10	3	1A2A7C20	7–14	7.1.3
1A1C3	7-4	2	1A2A3C5	7–10	3	1A2A7C21	7–14	3
1A1C4	7-4	3	1A2A3C6	7–10	3	1A2A7C22	7–14	3
1A1C5	7-4	4	1A2A3C7	7–10	4	1A2A7C23	7–14	3 3 3
1A1C6	7-4	5	1A2A3C8	7-10	5 6	1A2A7C24	7–14	3
1A1C7	7-4	6	1A2A3C9	7–10	6	1A2A7C25	7–14	3
1A1CR1	7-4	7	1A2A3C10	7-10	7	1A2A7CR1	7-14	6
1A1E1	7-4	8			. 1	1A2A7CR2	7-14	6
1A1E2	7-4	9	1A2A4	7-6	4	1A2A7CR3	7-14	6
1A1E3	7-4	10	1A2A4C11	7-11	1	1A2A7CR4	7-14	6 ·
1A1E4	7-4	9	1A2A4C12	7–11	1	1A2A7CR5	7-14	6
1A1E5	7-4	11	1A2A4C13	7-11	1	1A2A7CR6	7-14	6
1A1E6	7-4	11	1A2A4C14	7-11	1	1A2A7CR7	7-14	6
1A1E7	7-4	9	1A2A4C15	7-11	2	1A2A7CR8	7-14	6
1A1L1	7-4	12	1A2A4C16	7-11	2	1A2A7CR9	7-14	6
1A1L2	7-4	13	1A2A4C17	7-11	3	1A2A7CR10	7-14	6
1A1P1	7-4	14	1A2A4C18	7-11	4	1A2A7CR11	7-14	6
1A1P2	7-4	15	1A2A4C19	7-11	5	1A2A7CR12	7–14	6
1A1R1	7_4	16	1A2A4C2O	7-11	5	1A2A7CR13	7-14	Ğ
1A1T1	7-4	17	1A2A4J1	7–11	6	1A2A7CR14	7-14	ě
1A1TP1	7_4	18			· I	1A2A7CR15	7–14	ŏ
1A1V1	7-4	19	1A2A5	7–6	5	1A2A7CR16	7-14	ŏ
1A1XV1	7-4	20	1A2A5L2	7-12	1	1A2A7J1	7-14	7
TUTUAT	,	40	1A2A5L3	7-12 7-12	1	1A2A7J2	7-14	8
1A2	7–2	2	1A2A5L4	7–12 7–12	1	1A2A7J3	7-14	8
1A2 1A2A1	7-2 7-6	1	1A2A5L5	7-12 7-12	1	1A2A7Q1	7-14	9
1A2A1 1A2A1A1	7-8 7-8		エロクロンロン	1-12	τ	1A2A7Q1 1A2A7Q2	7-14	10
1A2A1A1 1A2A1C1		1	1A2A6	7–6	6	1A2A7Q2 1A2A7Q3	7-14 7-14	11
	7–8	2	1A2A6 1A2A6B1	7-6 7-13	1	1A2A7Q3	7-14 7-14	9
1A2A1C2	7-8	3 3			2	1A2A7Q4 1A2A7Q5	7-14 7-14	
1A2A1C3	7-8	3	1A2A6G1	7–13				10
1A2A1C4	7-8	3	1 4 2 4 7	7 (_	1A2A7Q6	7-14	11
1A2A1C5	7–8	2	1A2A7	7–6	7	1A2A7Q7	7-14	9
I .								
						7		

Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	Index No.
1A2A7Q8	7-14	9	1A2L1	7–6	8	1A3Q1	7–15	23
1A2A7Q9	7-14	12	1A2L6	7–6	9	1A3Q2	7–15	
1A2A7Q10	7-14	12	1A2R1	7-7	2	1A3Q3	7-15	
1A2A7Q11	7-14	10	1A2S1	7-6	10	1A3R1	7-15	
1A2A7Q12	7-14	13	1A2S3	7–7	3	1A3R2	7-15	
1A2A7Q13	7-14	12	1A2S4	7–6	11	1A3R3	7-15	
1A2A7Q14	7-14	12	1A2W1	7-6	12	1A3R4	7-15	
1A2A7R1	7-14	14	1A2W1S2	7-7	4	1A3R5	7-15	
1A2A7R2	7-14	15	1A2W2	7-6	13	1A3R6	7-15	
1A2A7R4	7-14	16	1A2W2	7-6	14	1A3R7	7-15	30
1A2A7R6	7-14	14			- '	1A3R8	7-15	29
1A2A7R7	7-14	15	1A3	7–2	3	1A3R9	7-15	31
1A2A7R9	7-14	16	1A3C1	7–15	1	1A3R10	7-15	32
1A2A7R11	7-14	14	1A3C2	7-15	2	1A3R11	7-15	33
1A2A7R12	7-14	15	1A3C3	7-15	3	1A3R12	7–15	34
1A2A7R13	7-14	14	1A3C4	7-15	4	1A3R13	7-15	35
1A2A7R14	7-14	15	1A3C5	7–15	5	1A3R14	7-15	36
1A2A7R15	7-14	15	1A3C6	7–15	6	1A3R15	7-15	24
1A2A7R16	7-14	17	1A3C7	7-15	6	1A3R16	7-15	36
1A2A7R17	7-14	15	1A3C8	7–15	6	1A3R17	7-15	24
1A2A7R18	7-14	14	1A3C9	7-15	3	1A3R18	7-15	36
1A2A7R19	7-14	16	1A3C10	7-15	3	1A3R19	7–15	24
1A2A7R21	7-14	18	1A3C11	7–15	7	1A3T1	7–15	37
1A2A7R22	7-14	14	1A3C12	7–15	8	1A3T2	7–15	38
1A2A7R23	7-14	19	1A3C13	7–15	9	1A3T3	7-15	38
1A2A7R24	7-14	20	1A3C14	7–15	8 9 3 3	1A3VR1	7-15	39
1A2A7R25	7-14	15	1A3C15	7–15				
1A2A7R26	7-14	15	1A3C16	7–15	3	1A4	7–2	4
1A2A7R27	7-14	21	1A3CR1	7-15	10	1A4C1	7–16	1
1A2A7R28	7-14	21	1A3CR2	7-15	10	1A4C2	7–16	1
1A2A7R29	7-14	21	1A3CR3	7–15	10	1A4C3	7-16	2
1A2A7R30	7-14	21	1A3CR4	7-15	10	1A4C4	7–16	3
1A2A7R31	7-14	21	1A3CR5	7–15	11	1A4C5	7-16	4
1A2A7R32	7-14	16	1A3CR6	7-15	11	1A4C6	7-16	5
1A2A7R33	7-14	16	1A3CR7	7-15	11	1A4CR1	7-16	6
1A2A7R34	7-14	16	1A3CR8	7-15	11	1A4J1	7-16	7
1A2A7R35	7-14	16	1A3J1	7- 15	12	1A4J2	7-16	
1A2A7R37	7-14	14	1A3J3	7-15	13	1A4L1	7-16	9
1A2A7R38	7-14 7-14	14 14	1A3J4	7-15	14	1A4Q1 1A4Q2	7-16 7-16	10
1A2A7R39 1A2A7R40	7-14 7-14	14 15	1A3K1	7-15 7-15	15 16	1A4Q2 1A4R1	7-16 7-16	10 11
1A2A7R40 1A2A7R41	7-14 7-14	14	1A3K2 1A3K3	7-15 7-15	17	1A4R1 1A4R2	7-16	11
1A2A7R41 1A2A7R42	7-14 7-14	15	1A3K3 1A3K4	7-15 7-15	17 17	1A4R2 1A4R3	7-16	13
1A2A7R42 1A2A7R43	7-14 7-14	15	1A3K4 1A3L1	7-15 7-15	18	1A4R3 1A4R4	7-16	13 14
1A2A7R43	7-14 7-14	15	1A3L2	7-15 7-15	19	1A4R5	7-16	15
1A2A7R45	7-14	22	1A3L3	7-15 7-15	19	1A4R6	7-16	15
1A2A7R46	7-14	22	1A3L4	7-15 7-15	20	1A4R0 1A4T1	7-16	16
1A2A7K40 1A2A7U1	7-14	23	1A3L5	7-15	20	1A4T2	7-16	17
1A2A7VR1	7-14	24	1A3L6	7-15	21		,10	± /
TUSUL ATIT	, 1	. →	1A3P1	7-15	22	1A5	7-2	5
1A2B1	7-7	1	1A3P2	7-15	22	1A5C1	7-17	ĭ
1	• •	-]			I	,	-
1								

Reference	Fig	Index	Reference	Fig	Index	Reference	Fig	Index
Designation	No.	No.	Designation	No.	No.	Designation	No.	No.
1A5C2	7–17	1	1A5C53	7–17	8	1A5Q1	7–17	
1A5C3	7–17	2	1A5C54	7–17	8	1A5Q2	7-17	
1A5C4	7–17	2	1A5C55	7–17	8	1A5Q3	7–17	27
1A5C5	7–17	3	1A5C56	7–17	2	1A5Q4	7–17	
1A5C6	7–17	4	1A5C57	7–17	2	1A5R1	7–17	
1A5C7	7–17	2	1A5C58	7–17	2	1A5R2	7–17	28
1A5C8	7–17	2	1A5C59	7–17	9	1A5R3	7–17	29
1A5C9	7–17	2	1A5C60	7–17	10	1A5R4	7–17	29
1A5C10	7–17	5	1A5C61	7–17	11	1A5R5	7–17	30
1A5C11	7–17	2	1A5CR1	7–17	12	1A5R6	7-17	
1A5C12	7–17	6	1A5CR2	7–17	12	1A5R7	7–17	
1A5C13	7–17	5 2	1A5CR3	7–17	13	1A5R8	7–17	
1A5C14	7–17	2	1A5CR4	7–17	13	1A5R9	7–17	33
1A5C15	7–17	2	1A5CR5	7-17	13	1A5R10	7–17	34
1A5C16	7–17	2	1A5CR6	7–17	13	· 1.A5R11	7–17	35
1A5C17	7–17	2	1A5CR7	7–17	13	1A5R12	7–17	31
1A5C18	7–17	2	1A5CR8	7–17	13	1A5R13	7–17	28
1A5C19	7-17	2 2 2	1A5CR9	7–17	13	1A5R14	7–17	28
1A5C20	7–17	2	1A5CR10	7–17	13	1.A5R15	7–17	28
1A5C21	7–17	2	1A5CR11	7-17	13	1A5R16	7–17	28
1A5C22	7–17	2	1A5CR12	7–17	13	1A5R17	7–17	36
1A5C23	7–17	2	1A5CR13	7–17	13	1A5R18	7–17	37
1A5C24	7-17	2	1A5CR14	7–17	13	1A5R19	7–17	38
1A5C25	7–17	2	1A5CR15	7-17	12	1A1R20	7-17	39
1A5C26	7–17	2	1A5CR16	7–17	13	1A5R21	7–17	40
1A5C27	7–17	2	1A5CR18	7-17	13	1A5R22	7–17	41
1A5C28	7-17	2	1A5CR19	7-17	13	1A5R23	7–17	28
1A5C29	7-17	2	1A5CR20	7–17	13	1A5R24	7–17	28
1A5C30	7-17	7	1A5CR21	7–17	13	1A5R25	7–17	42
1A5C31	7-17	2	1A5CR22	7–17	13	1A5R26	7-17	43
1A5C32	7–17	2	1A5CR23	7–17	13	1A5R27	7-17	38
1A5C33	7–17	6	1A5CR24	7–17	14	1A5R28	7–17	44
1A5C34	7–17	2	1A5CR25	7–17	14	1A5R29	7-17	45
1A5C35	7–17	2	1A5CR26	7–17	14	1A5R30	7-17	28
1A5C36	7-17	2	1A5CR27	7-17	13	1A5R31	7-17	29
1A5C37	7-17	2	1A5CR28	7-17	14	1A5R32	7-17	46 47
1A5C38	7-17	2	1A5CR29	7-17	13 15	1A5R33	7-17	
1A5C39	7-17	2	1A5DS1	7-17 7-17	15 16	1A5R34	7-17	48
1A5C40 1A5C41	7–17 7–17	6	1A5DS2 1A5DS3	7-17 7-17		1A5R35	7-17	49 50
1A5C41 1A5C42	7-17 7-17	6 8	1A5DS3 1A5DS4	7-17 7-17	16 17	1A5R36 1A5R37	7-17	50 50
1A5C42 1A5C43	7-17 7-17	2	1A5DS4 1A5DS5	7-17 7-17	17 17	1A5R37 1A5R38	7–17 7–17	50 28
1A5C43	7-17 7-17	2	1A5DS5 1A5DS6	7-17 7-17	17	1A5R38 1A5R40	7-17 7-17	28 51
1A5C45	7-17 7-17	2	1A5DS6 1A5E1	7-17 7-17	18	1A5R40 1A5R41	7-17 7-17	52
1A5C45 1A5C46	7–17 7–17	2	1A5L1 1A5J1	7-17 7-17	19	1A5R41 1A5R42	7–17 7–17	52 50
1A5C46 1A5C47	7-17 7-17	2	1A5J1 1A5J2	7-17	20	1A5R42 1A5R43	7-17 7-17	50 50
1A5C47	7-17 7-17	6	1A5JMP1	7-17	21	1A5R44	7-17 7-17	50 50
1A5C48	7-17 7-17	2	1A5L1	7-17	22	1A5R45	7-17	28
1A5C50	7-17 7-17	6	1A5L2	7-17	23	1A5R46	7-17	
1A5C50	7–17 7–17	2	1A5L3	7-17	23	1A5R47	7-17	50
1A5C51	7–17 7–17	6	1A5L4	7-17	24	1A5R48	7-17 7-17	54
1115052	, 1,	•	1.1.J.1T	, -1	27	1/1/21/40	,-1,) ,

T.O. 31R2-2URC-123

Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	Index No.
1A5R49	7–17	55	1A5R101	7-17	73	1A5R157	7-17	
1A5R50	7-17	56	1A5R102	7-17	28	1A5R158	7-17	
1A5R51	7-17	57	1A5R103	7-17	32	1A5R159	7-17	
1A5R52	7-17	58	1A5R106	7-17	32	1A5R160	7-17	
1A5R53	7-17	28	1A5R107	7-17	74	1A5R161	7-17	
1A5R54	7-17	32	1A5R108	7-17	50	1A5R162	7-17	
1A5R55	7-17	59	1A5R109	7-17	32	1A5R163	7-17	28
1A5R56	7–17	60	1A5R110	7-17	32	1A5R164	7-17	32
1A5R57	7-17	28	1A5R111	7-17	50	1A5R165	7-17	
1A5R58	7–17	42	1A5R112	7-17	75	1A5R166	7-17	
1A5R59	7–17	32	1A5R113	7-17	28	1A5TP1	7–17	
1A5R60	7–17	32	1A5R114	7–17	28	1A5TP2	7–17	
1A5R61	7–17	32	1A5R115	7–17	28	1A5TP3	7–17	
1A5R62	7-17	61	1A5R116	7–17	50	1A5TP4	7-17	
1A5R63	7-17	42	1A5R117	7–17	50	1A5TP5	7-17	
1A5R64	7-17	28	1A5R118	7-17	51	1A5TP6	7-17	
1A5R65	7-17	58	1A5R119	7-17	55	1A5TP7	7-17	
1A5R66	7-17	58	1A5R120	7-17	28	1A5TP8	7-17	
1A5R67	7–17	29	1A5R121	7-17	28	1A5TP9	7-17	
1A5R68	7-17	55	1A5R122	7-17	28	1A5TP10	7-17	
1A5R69	7-17	28	1A5R123	7-17	32	1A5TP11	7-17	
1A5R70	7-17 7-17	28 28	1A5R124	7-17	55	1A5U1	7-17 7-17	
1A5R71	7-17 7-17	28 60	1A5R125	7-17	29	1A5U2		
1A5R72 1A5R73	7-17 7-17	62	1A5R126	7-17	76	1A5U3 1A5U4	7-17 7-17	•
1A5R73	7-17 7-17	62 62	1A5R127	7-17	55	1A5U4 1A5U5	7-17 7-17	
1A5R74 1A5R75	7-17 7-17	28	1A5R128 1A5R129	7-17 7-17	28 77	1A5U6	7-17	
1A5R75	7-17 7-17	28	1A5R129 1A5R130	7-17 7-17	77 78	1A5U7	7-17	
1A5R70	7-17	49	1A5R130 1A5R131	7-17	29	1A5U8	7-17	
1A5R78	7-17	63	1A5R131 1A5R133	7-17	28	1A5U9	7-17	
1A5R79	7-17	63	1A5R136	7-17	79	1A5U10	7-17	
1A5R80	7-17	49	1A5R137	7-17	80	1A5U11	7-17	
1A5R82	7-17	64	1A5R138	7-17	80	1A5U12	7-17	90
1A5R83	7-17	65	1A5R139	7-17	32	1A5U13	7-17	
1A5R84	7-17	66	1A5R140	7-17	32	1A5VR1	7-17	
1A5R85	7-17	52	1A5R141	7–17	50	1A5VR2	7-17	
1A5R86	7–17	28	1A5R142	7-17	28	1A5VR3	7-17	
1A5R87	7–17	32	1A5R143	7-17	81	1A5VR4	7-17	
1A5R88	7-17	28	1A5R144	7-17	50	1A5VR5	7-17	
1A5R89	7–17	32	1A5R145	7-17	50	1A5VR6	7-17	94
1A5R90	7-17	32	1A5R146	7–17	52	1		
1A5R91	7-17	32	1A5R147	7–17	50	1A6	7-2	6
1A5R92	7-17	47	1A5R148	7-17	55	1A6C1	7-18	
1A5R93	7-17	67	1A5R149	7-17	82	1A6C2	7-18	
1A5R94	7-17	68	1A5R150	7-17	83	1A6C3	7-18	
1A5R95	7-17	69 70	1A5R151	7-17	50	1A6C4	7-18	
1A5R96	7-17	70	1A5R152	7-17	40	1A6C5	7-18 7-18	
1A5R97	7-17 7-17	29 29	1A5R153	7-17	28 55	1A6C6 1A6C7	7-18	
1A5R98	7-17 7-17	71	1A5R154	7-17	55 84	1A6C7 1A6C9	7-18	
1A5R99 1A5R100	7-17 7-17	71 72	1A5R155	7–17 7–17	84 50	1A6C9	7-18	
TWOTIOO	,-1,	12	1A5R156	/ - I /	UC	INOCIO	,-10	´

Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	Index No.	Reference Designation	Fig No.	index No.
1A6C11	7–18	1	1A6C136	7–18	1	1A6R120	7-1	8 28
1A6C11	7-18 7-18	2	1A6C137	7-18	1	1A6R120	7-1 7-1	
1A6C13	7-18 7-18	1	1A6C138	7-18	1	1A6R121 1A6R122	7-1 7-1	
	7–18 7–18	1	1A6C139	7-18				
1A6C17			1A6C140		1	1A6R123	7–1	
1A6C19	7-18	1		7-18	1	1A6R125	7-1	
1A6C2O	7-18	3	1A6C141	7-18	1	1A6R126	7-1	
1A6C21	7–18	4	1A6C146	7-18	1	1A6R127	7-1	
1A6C22	7–18	5	1A6CR1	7–18	9.	1A6R128	7-1	
1A6C23	7–18	1	1A6CR2	7–18	9	1A6R129	7-1	
1A6C24	7–18	3 1	1A6CR3	7–18	9	1A6R130	7 -1	
1A6C25	7–18		1A6CR4	7-18	9	1A6R131	7-1.	
1A6C26	7–18	1	1A6CR5	7–18	9	1A6R132	71	
1A6C27	7–18	1	1A6CR6	7–18	10	1A6R133	7-1	
1A6C28	7–18	3 3	1A6CR21	718	11	1A6R134	7-1	
1A6C29	7–18		1A6J1	7-18	12	1A6R135	7-1	
1A6C30	7-18	1	1A6L2	7-18	13	1A6R136	7-1	
1A6C31	7-18	6	1A6L3	718	13	1A6R137	7-1	
1A6C32	7-18	1	1A6L4	7-18	13	1A6R138	7–1	
1A6C34	7-18	1	1A6L5	7-18	13	1A6R139	7-1	
1A6C35	7-18	1	1A6L6	7-18	13	1A6R140	71	
1A6C36	7-18		1A6L7	7-18	13	1A6R141	71	
1A6C37	7-18	3	1A6L9	7-18	13	1A6R145	7-1	
1A6C38	7-18	7	1A6P1	7-18	14	1A6TP1	7–1	
1A6C39	7–18	8	1A6Q1	7-18	15	1A6TP2	7-1	
1A6C102	7-18	ĭ	1A6Q2	7-18	15	1A6TP3	7-1	
1A6C102	7-18	î	1A6R1	7-18	16	1A6TP4	7-1	
1A6C103	7-18	1	1A6R2	7-18	16	1A6U1	7-1	
1A6C104	7-18	î	1A6R3	7-18	17	1A6U2	7-1	
1A6C105	7-18	1	1A6R4	7-18	18	1A6U3	7-1 7-1	
1A6C100	7-18	1	1A6R5	7-18	19	1A6U4	7-1 7-1	
1A6C107	7-18	1	1A6R6	7-18	20		7-1 7-1	
	7-18	1	1A6R7	7-18 7-18	20	1A6U6 1A6U7	7-1 7-1	
1A6C109	7-18	1	1A6R8					
1A6C111		1		7–18	21	1A6U8	7-1	
1A6C118	7–18		1A6R10	7-18	21	1A6U10	7-1	
1A6C119	7–18	1	1A6R11	7-18	22	1A6U11	71	
1A6C120	7-18	1	1A6R14	7-18	23	1A6U12	7-1	
1A6C121	7-18	1	1A6R15	7-18	21	1A6U13	7-1	
1A6C122	7–18	1	1A6R16	7-18	24	1A6U15	7-1	
1A6C123	7–18	1	1A6R17	7–18	25	1A6U17	7-1	
1A6C124	7–18	1	1A6R18	7–18	21	1A6U19	7-1	
1A6C125	7–18	1	1A6R20	7–18	21	1A6U2O	7-1	
1A6C126	7–18	1	1A6R26	7–18	26	1A6U25	7-1	
1A6C127	718	1	1A6R27	7–18	17	1A6U26	7-1	
1A6C128	7–18	1	1A6R28	7–18	27	1A6U27	7-1	
1A6C129	7-18	1	1A6R101	7–18	28	1A6U28	7-1	
1A6C130	7–18	1	1A6R102	7–18	28	1A6U29	7-1	
1A6C131	7-18	1	1A6R106	7-18	28	1A6U30	7-1	
1A6C132	7-18	1	1A6R107	7-18	28	1A6U31	7-1	
1A6C133	7-18	1	1A6R108	7-18	28	1A6U32	7-1	8 51
1A6C134	7–18	1	1A6R109	7-18	28	1A6VR1	7-1	
1A6C135	7-18	ī	1A6R111	7-18	28	1A6VR2	7-1	
			A.		. –			_
•								3 1 2 9 4 7 2 1 2 2 3 2 3 2 3 2 3 2 3 2 3 2 3 2 3 2


Reference	Fig	Index	Reference	Flg	Index	Reference	Flg	Index
Designation	No.	No.	Designation	No.	No.	Designation	No.	No.
1A6VR3	7-18	53	1A7A1S2	7-19	15	1A9R3	7-21	11
1A6XU1	7-18	54	1A7A1S3	719	25	1A9R4	7-21	12
1A6XU2	7-18	55	1A7A1S4	7-19	16	1A9R5	7-21	13
1A6Y1	7-18	56	1A7A1S5	7-19	16	1A9R6	7-21	12
		3	1A7A1S6	7-19	17	1A9S1	7-21	14
1A7	7-2	7	1A7A1S7	7-19	18	1A9TP1	7-21	15 15
1A7A1	7-2	43	1A7A1S8	7-19	16	1A9TP2	7-21	16
1A7A1C1	7–19	1	1A7A1U11	7-19	19		,	
1A7A1C2	7-19	2	1A7A1U17	7-19	2Ó	1A10	7-2	12
1A7A1C19	7-19	3	1A7A1U18	7-19	20	1A10C1	7-22	1
1A7A1C20	7-19	3	1A7A1U19	7–19	20	1A10C2	7-22	2
1A7A1C21	7-19	3	1A7A1U2O	7-19	20	1A10C3	7-22	2
1A7A1C22	7-19	1 2 3 3 3 3 3 3 3	1A7A1U26	7-19	21	1A10C4	7-22	2 2
1A7A1C23	7-19	3	1A7A1U28	7-19	22	1A10C5	7-22	$\tilde{2}$
1A7A1C24	7-19	3	1A7A1X1	7-19	23	1A10C6	7-22	ī i
1A7A1C62	7–19	3	1A7A1X2	7-19	23	1A10C7	7-22	3
1A7A1DS1	7–19	4 5 6 7 6	1A7A1X2	7-19	23	1A10C8	7-22	4
1A7A1DS2	7-19	5		_		1A10C9	7-22	4 5
1A7A1DS3	7-19	6	1A8	7-2	10	1A10J4	7-22	6
1A7A1DS4	7-19	7	1A8C1	7-20	1	1A10J5	7-22	7
1A7A1DS5	7-19	6	1A8C2	7-20	1	1A10L1	7-22	8
1A7A1DS6	7-19	6	1A8C3	7-20	ī	1A10L2	7-22	8
1A7A1J1	7–19	8	1A8C4	7-20	ī	1A10L3	7-22	8
1A7A1Q1	7-19	9	1A8J1	7-20	2	1131023	7 44	Ŭ
1A7A1Q2	7–19	6 8 9 9	1A8R1	7-20	3	1B1	7-2	13
1A7A1Q3	7-19	9	1A8R2	7-20	4	1C10	7-2	14
1A7A1Q4	7-19	9	1A8R3	7-20	5	1E13	7-2	15
1A7A1R1	7–19	10	1A8U1	7-20	6	1E14	7-2	15
1A7A1R2	7-19	10	1A8U2	7-20	6	1J1	7-2	16
1A7A1R3	7-19	10			·	1J3	7-2	17
1A7A1R4	7-19	10	1A9	7-2	11	1JMP1	7-23	2
1A7A1R5	7-19	11	1A9C1	7-21	1	1JMP2	7-23	2
1A7A1R6	7–19	12	1A9C2	7-21	$\bar{2}$	11.1	7-2	18
1A7A1R7	7-19	10	1A9CR1	7-21	3	1P1	7-2	19
1A7A1R8	7-19	13	1A9CR2	7-21	3	1P3	7-2	19
1A7A1R9	7–19	12	1A9J1	7-21	4	1P4	7-2	20
1A7A1R10	7–19	12	1A9J2	7-21	5	1P7	7-2	21
1A7A1R11	7-19	12	1A9J3	7-21	6	1.P8	7-2	22
1A7A1R16	7-19	14	1A9Q1	7-21	7	1P10	7-2	20
1A7A1R17	7–19	14	1A9Q2	7-21	8	1P11	7-2	22
1A7A1R18	7–19	14	1A9R1	7-21	9	1W1	7-2	23
1A7A1R19	7-19	14	1A9R2	7-21	10	1W1J2	7-23	1
1A7A1S1	7–19	15				-11-02	, , , ,	


CHAPTER 8

FOLDOUT DRAWINGS

LIST OF 1 KW LPA FOLDOUT DRAWINGS


FO-1	Family Tree 1 KW LPA
FO-2	Interconnection Diagram
FO-3	Tube Assy, A1
FO-4	Tank Assy, A2
FO-5	Servo/Bandswitch Drive PWB Assy, A2A
FO-6	VSWR/XFMR PWB Assy, A3
FO-7	Fan Inverter PWB Assy, A4
FO-8	Power Control PWB Assy, A5
FO-9	Micro Control PWB Assy, A6
FO-10	Front Panel PWB Assy, A7A1
FO-11	Interconnect PWR Assy A9

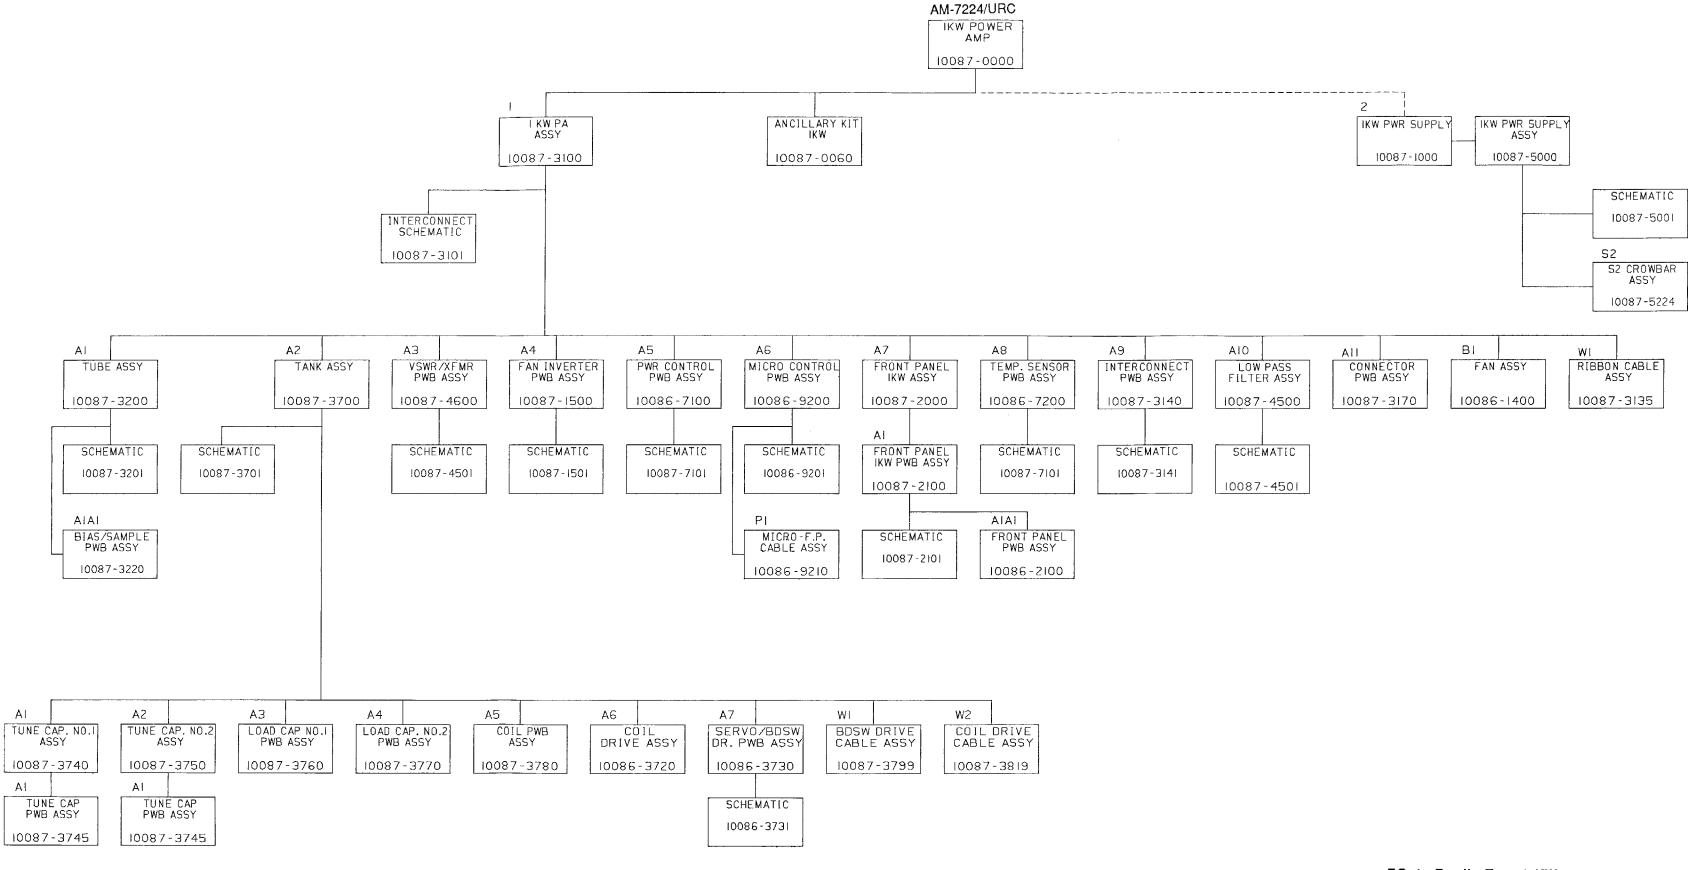

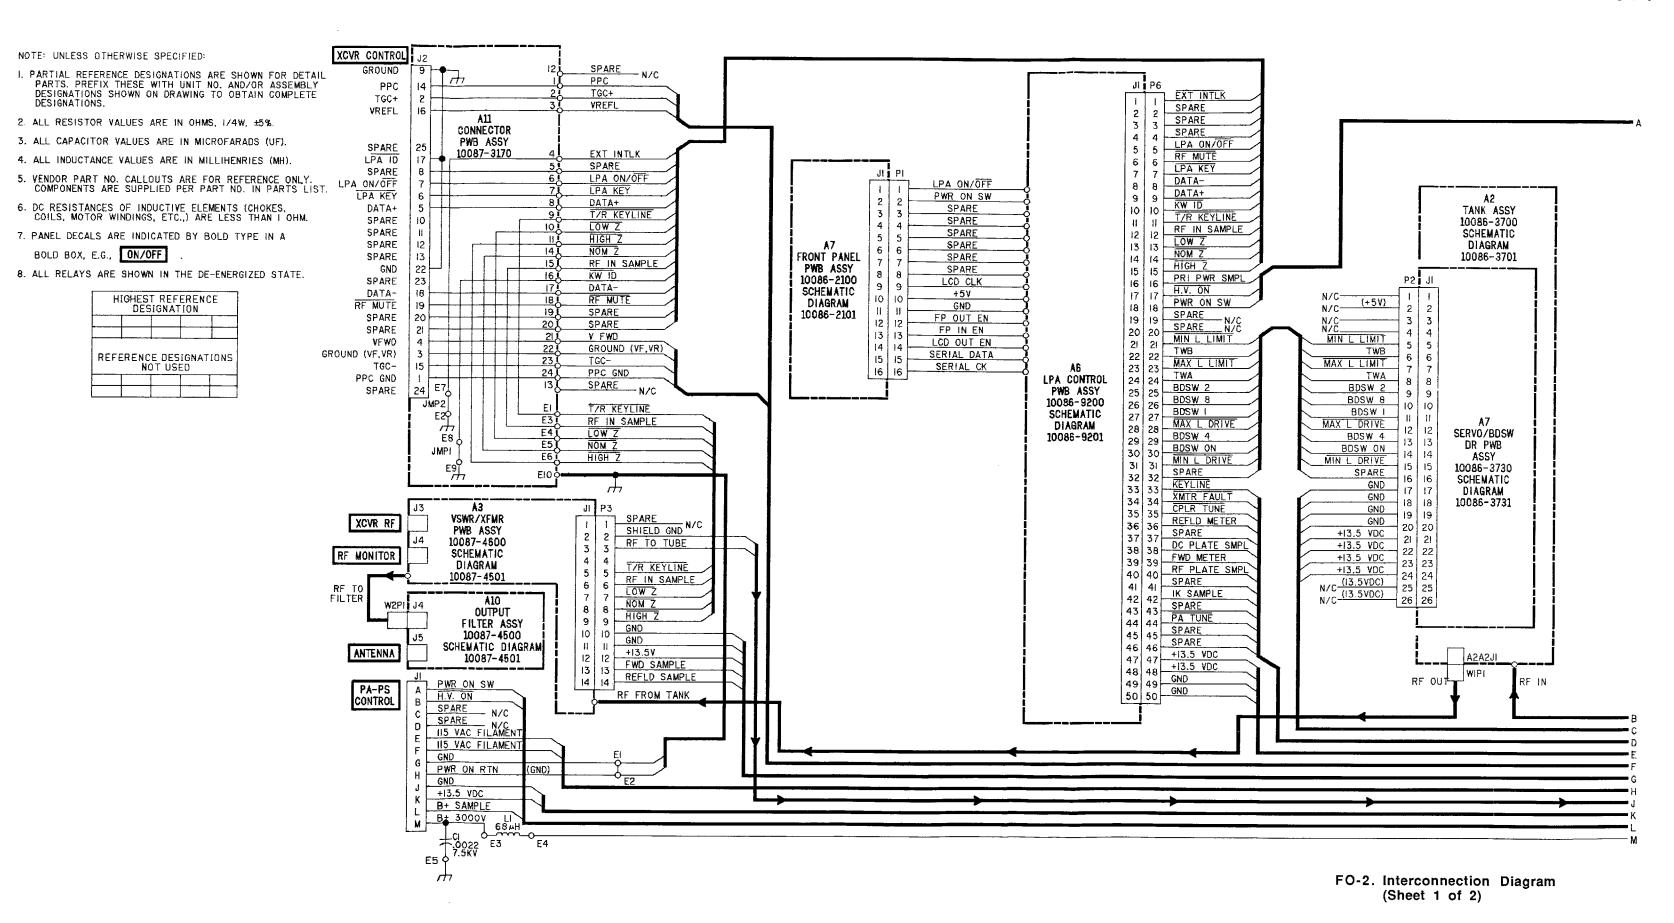

FP-3/(FP-4 Blank)

T O 31R2-2URC-123

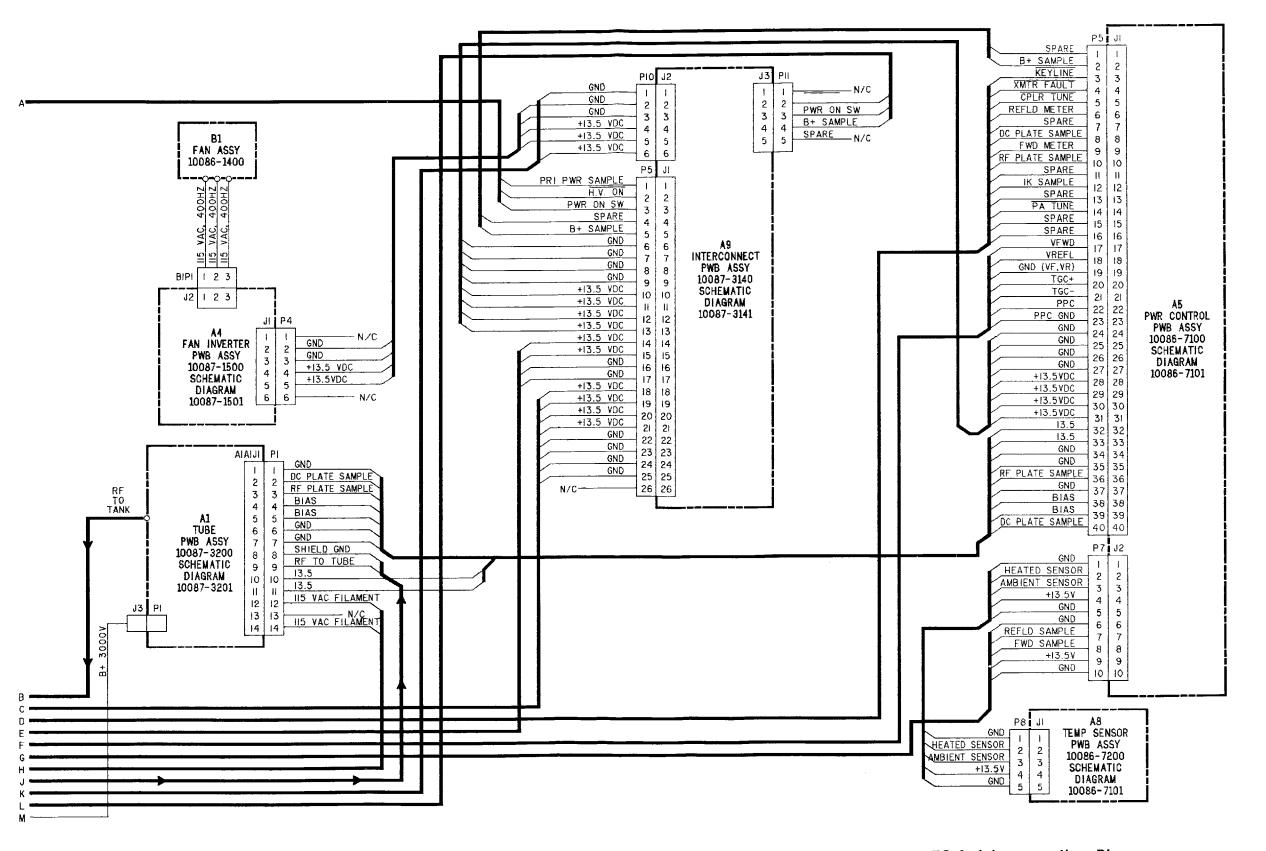


FO-2. Interconnection Diagram (Sheet 2 of 2)

T O 31R2-2URC-123

NOTE: UNLESS OTHERWISE SPECIFIED:

- PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- 5. VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY. COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.) ARE LESS THAN I OHM.
- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE
 IN A BOLD BOX, E.G., ON/OFF .
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.

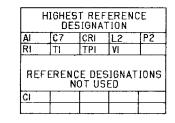




5.25 VA



2 IV≡IKV(PEAK)




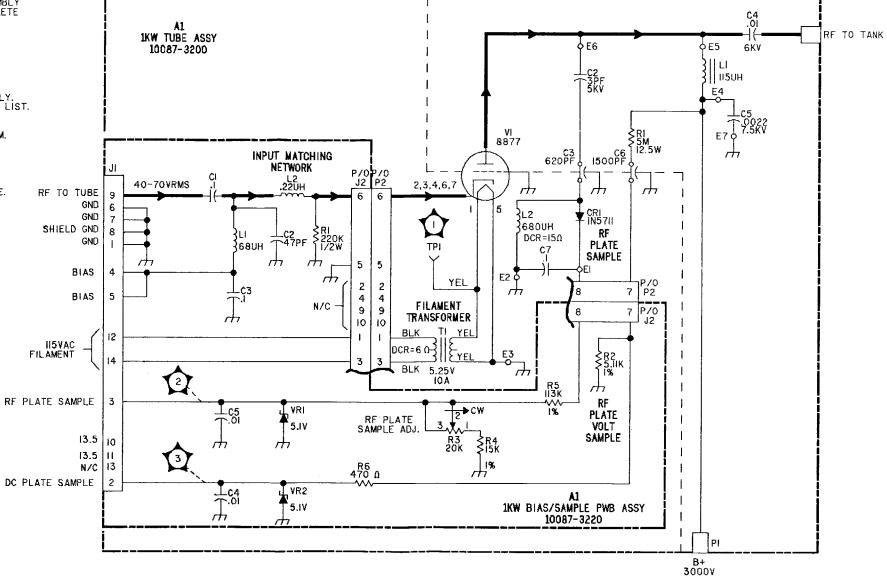

FO-3. Tube Assy, A1

FP-7/(FP-8 Blank)


T O 31R2-2URC-123

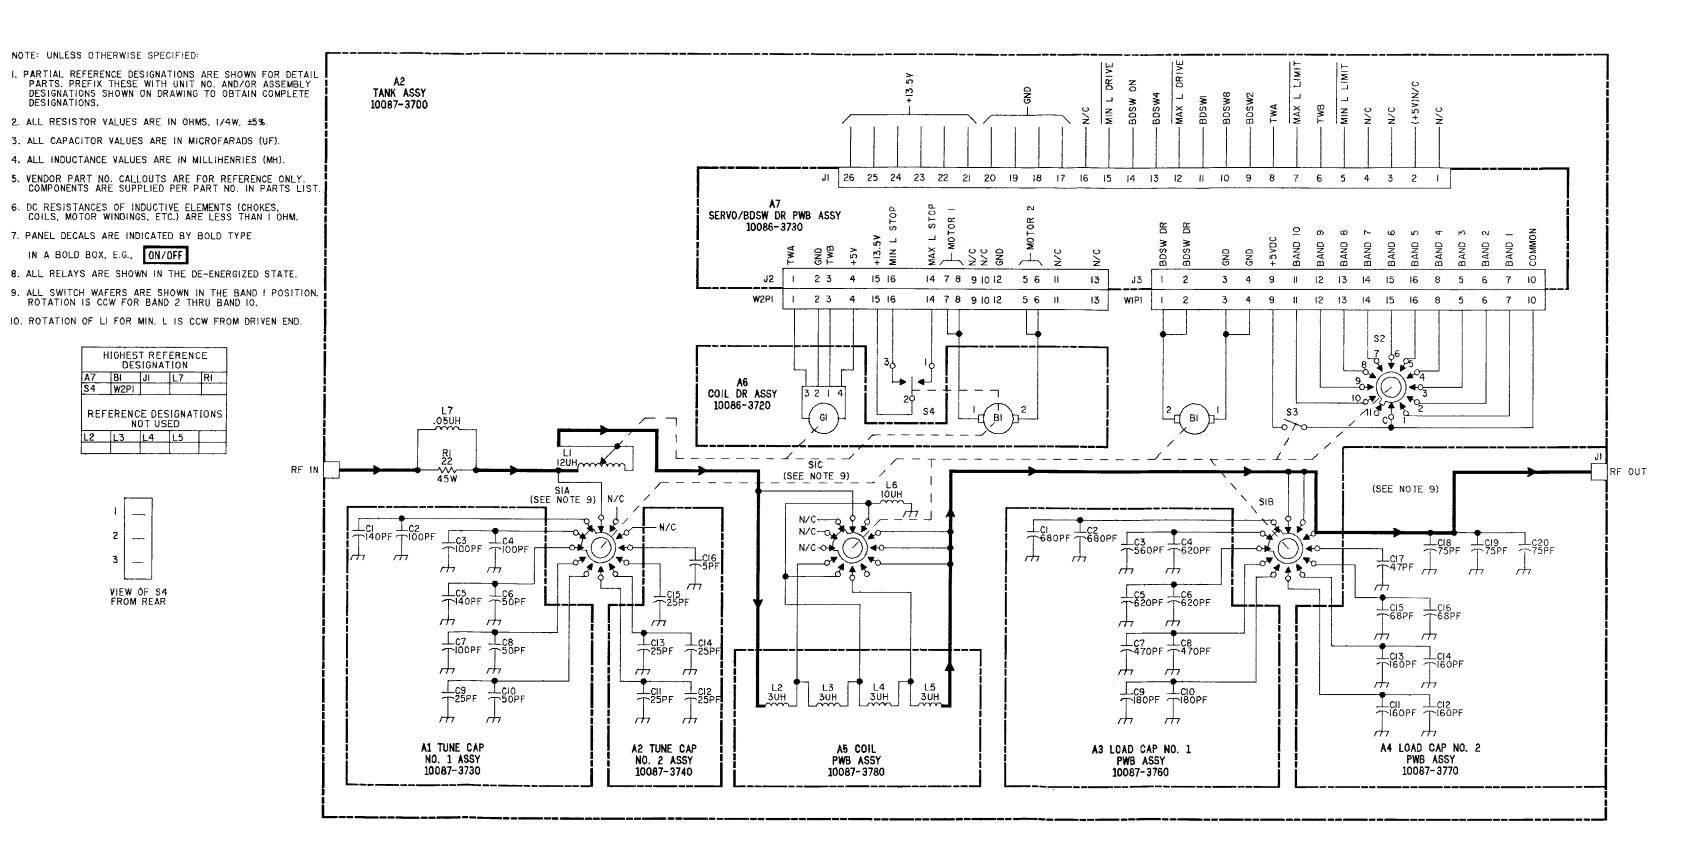


FO-4. Tank Assy, A2

NOTE: UNLESS OTHERWISE SPECIFIED:

- I. PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY. COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC..) ARE LESS THAN I OHM.
- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE IN A
 BOLD BOX, E.G., ON/OFF .
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.
- 9. PART NO.'S OF CRI THRU CRI4 ARE IN4454.

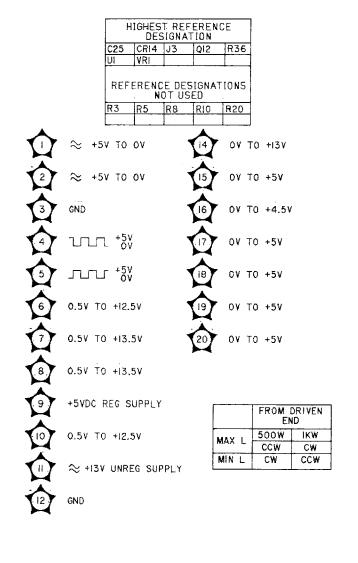

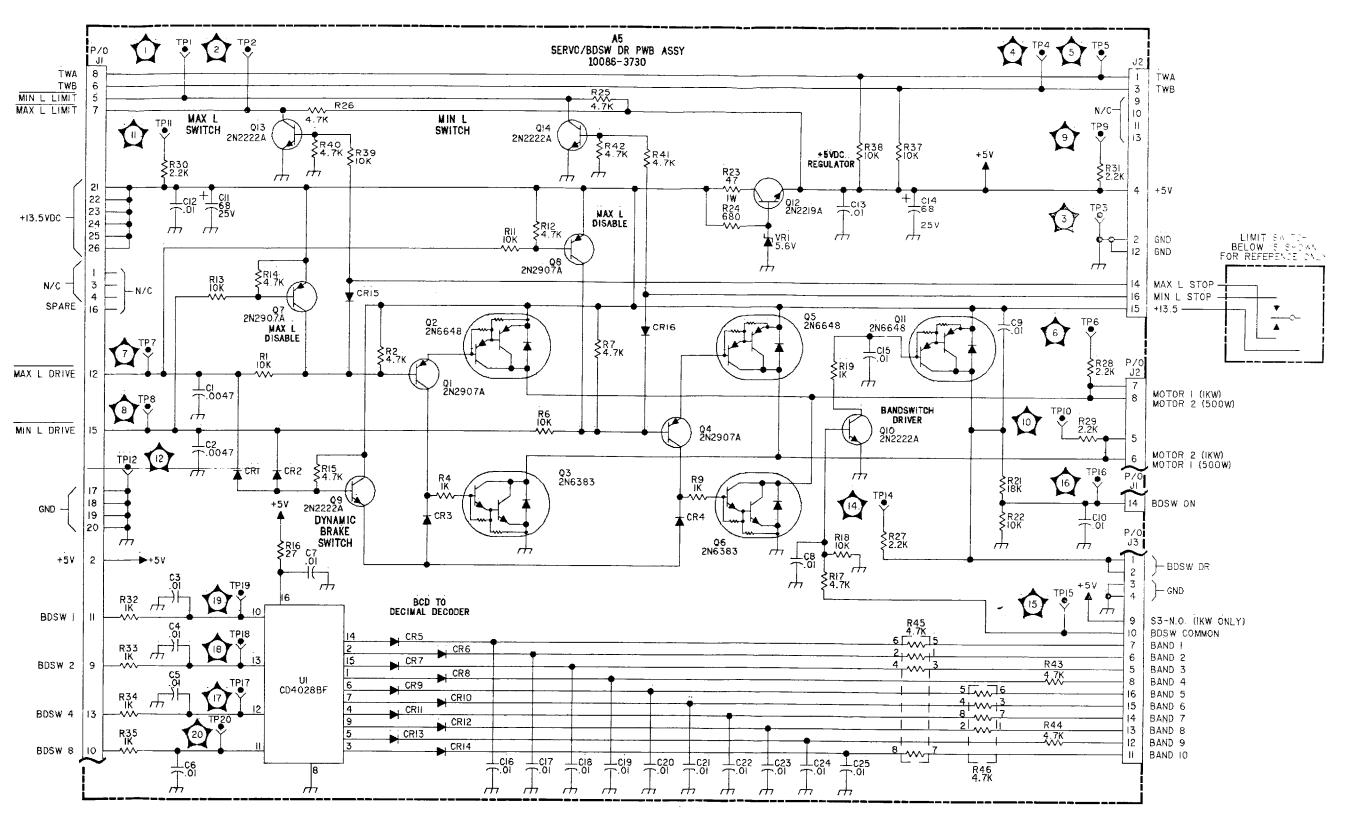


FO-5. Servo/Band Switch Drive PWB Assy, A2A7


FP-11/(FP-12 5lank)


NOTE: UNLESS OTHERWISE SPECIFIED:

  - I. PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- 5. VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY.
 COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.) ARE LESS THAN I OHM.
- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE
- IN A BOLD BOX, E.G., ON/OFF
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.

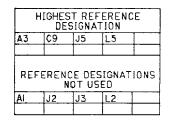

 













5V = 250W 3.16V = 100W

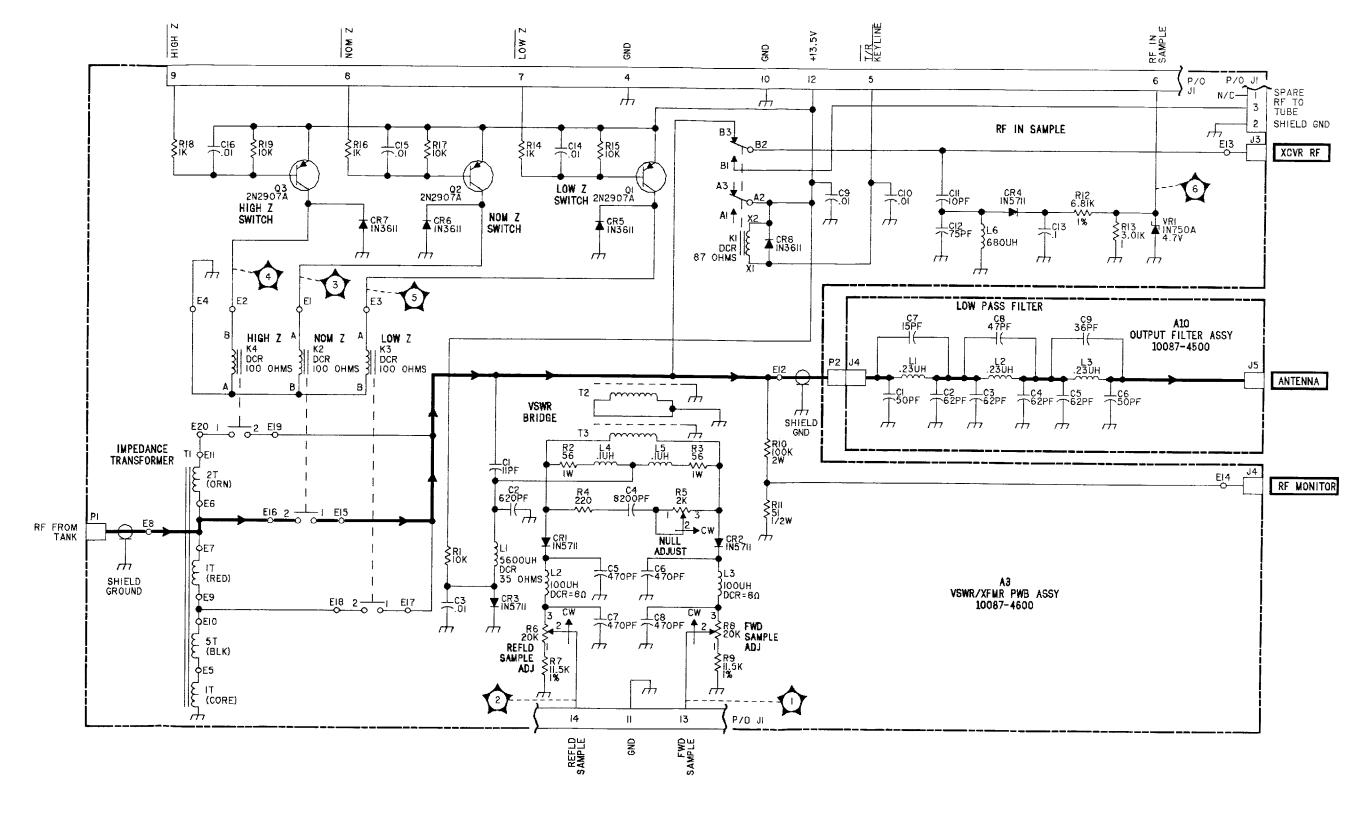



FO-6. VSWR/XFMR PWB Assy, A3

NOTE: UNLESS OTHERWISE SPECIFIED:

- PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (MF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY. COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.) ARE LESS THAN I OHM.
- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE
 IN A BOLD BOX, E.G., ON/OFF
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.

HIGHEST REFERENCE DESIGNATION					
¢6	CRI	J2	LI	Q2	
R6	T2				
REFERENCE DESIGNATIONS NOT USED					
		, ,			

 

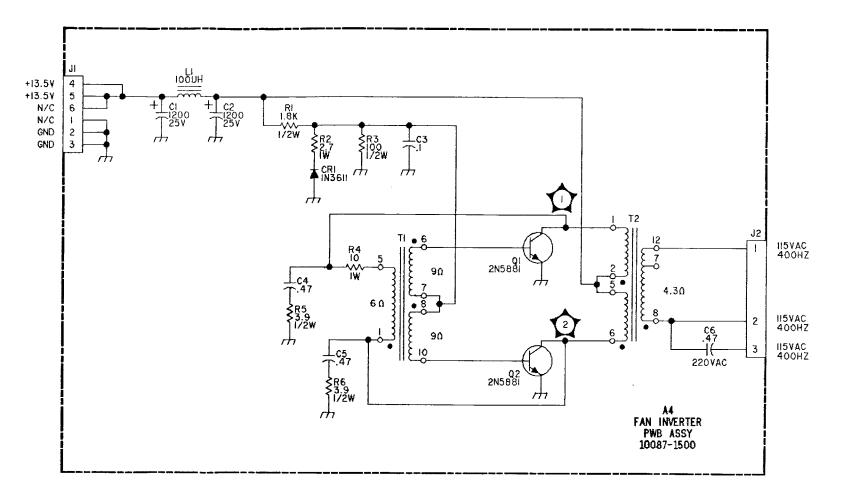

FO-7. Fan Inverter PWB Assy, A4

FP-15/(FP-16 Blank)

NOTE: UNLESS ÖTHERWISE SPECIFIED:

- I. PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS A8/AIO REF DESIGNATORS ARE AT ZONE 7E ON SHEET 4 OF 4. PREFIX ALL OTHER COMPONENTS WITH A5.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL DIODES ARE TYPE IN4454.
- 4. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 5. ALL IC'S ARE TYPE MCI558U.
- 6. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- 7. VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY. COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 8. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.,) ARE LESS THAN I OHM.
- 9. PANEL DECALS ARE INDICATED BY BOLD TYPE IN A BOLD BOX, E.G., ON/OFF
- 10. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.

HIGHEST REFERENCE DESIGNATION							
C61	CR29	DS6	JZ	LI			
Q4	R166	TPH	013	VR7			
REFERENCE DESIGNATIONS NOT USED							
CR17	CR26	R35	R81	R104			
R105							

7V = FULL POWER

77 = FULL REVERSE PWR

UNKEY = 24VDC, KEYED (500W LPA = 5VDC), KEYED (IKW LPA = 10VDC)

8V = FULL PWR

5 8V = PWR SET

6 0 TO 5V = NORMAL, >5V = EXCITER CUTBACK




.8. -BV UNREG

AT 21°C (70°F) AMBIENT 'FAULT' AT 18°C ± 3° (180MV ± 30MV) GREATER THAN TPIO


TPIO VOLTAGE = IOMV/DEGREE KELVIN 0°C = 273° KELVIN = 2.73VDC 100°C = 373° KELVIN = 3.73VDC 150°C = 423° KELVIN = 4.23VDC

II. LOW = FAULT, +5V = NORMAL

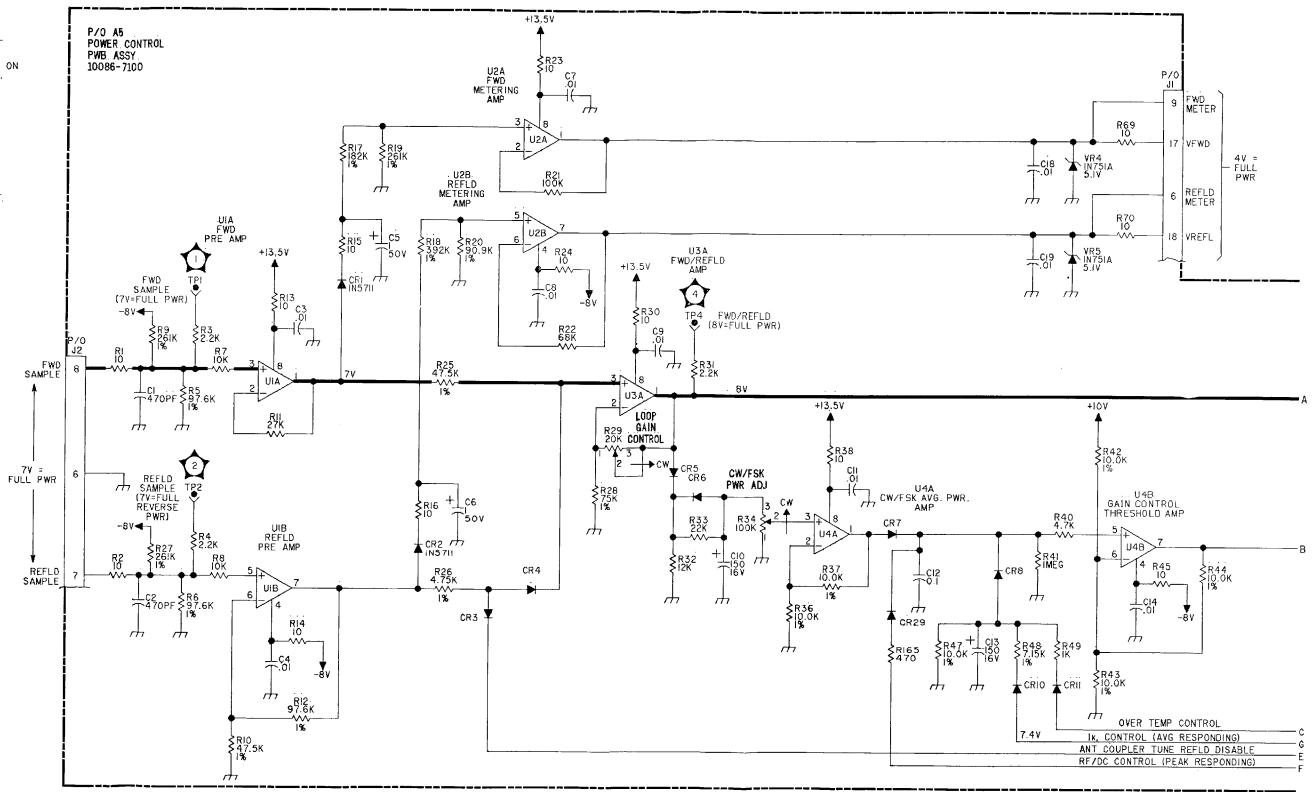


FO-8. Power Control PWB Assy, A5 (Sheet 1 of 4)


FP-17/(FP-18 Blank)

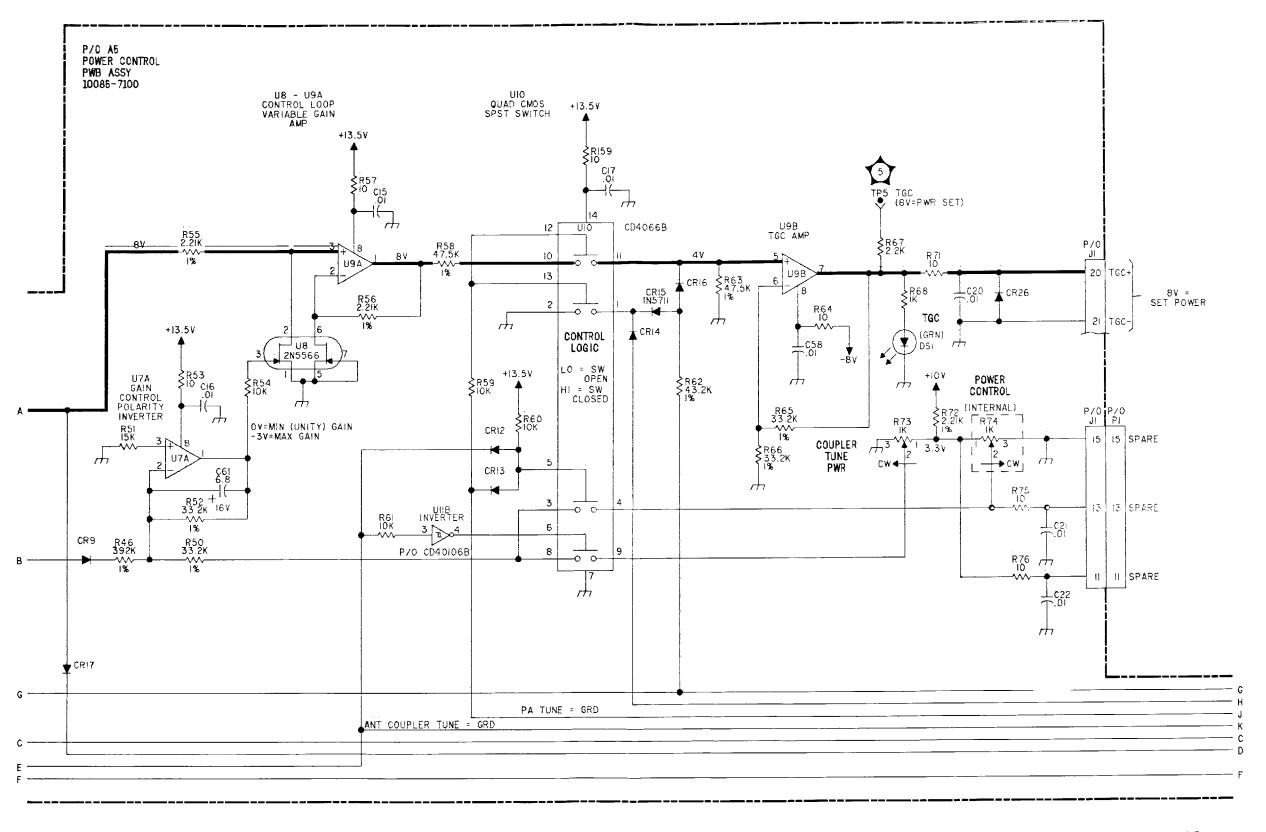


FO-8. Power Control PWB Assy, A5 (Sheet 2 of 4)

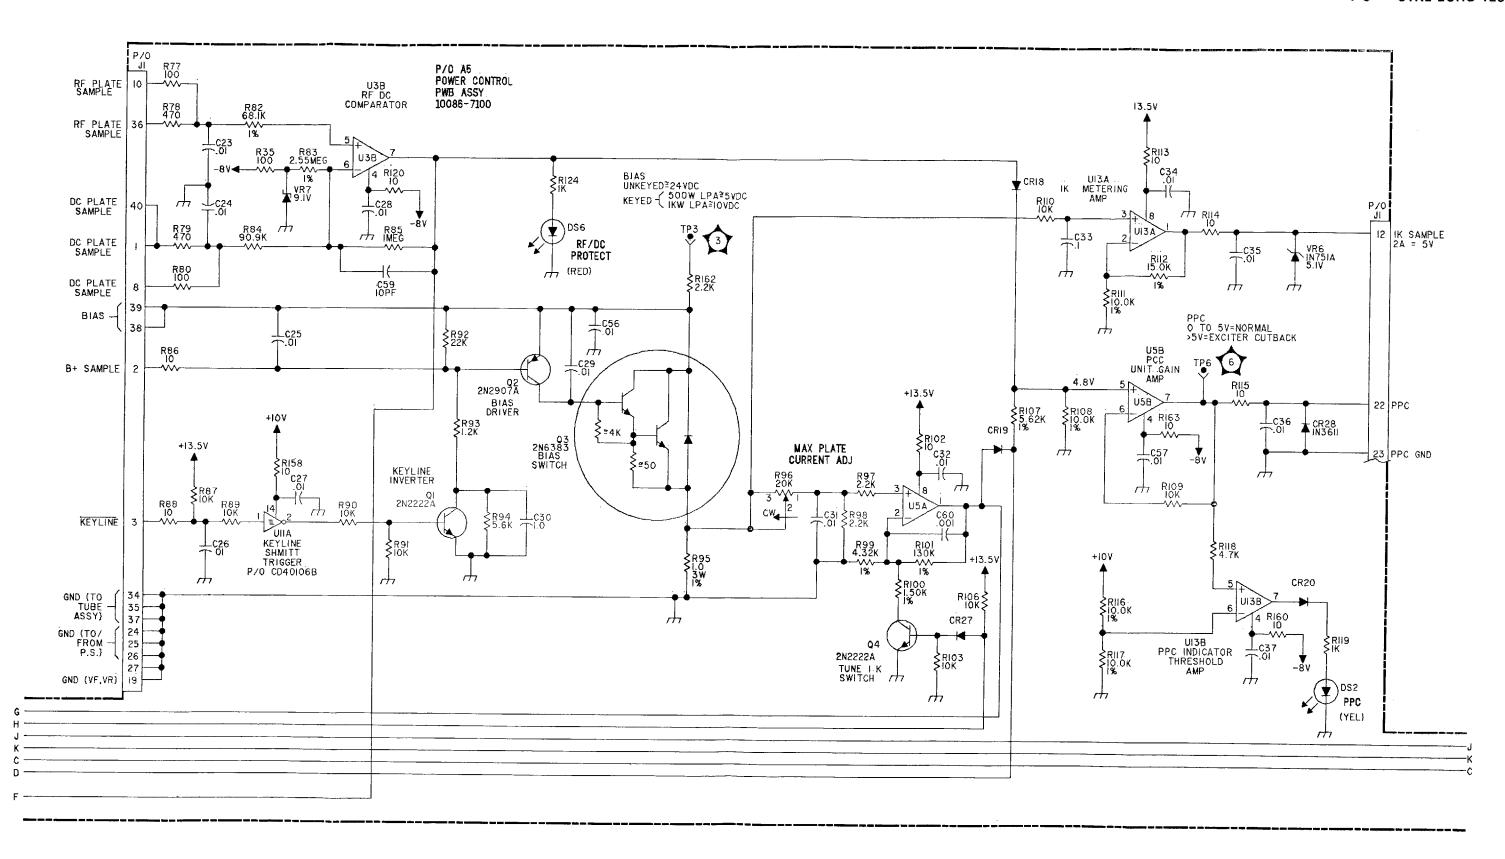

FO-8. Power Control PWB Assy, A5 (Sheet 3 of 4)

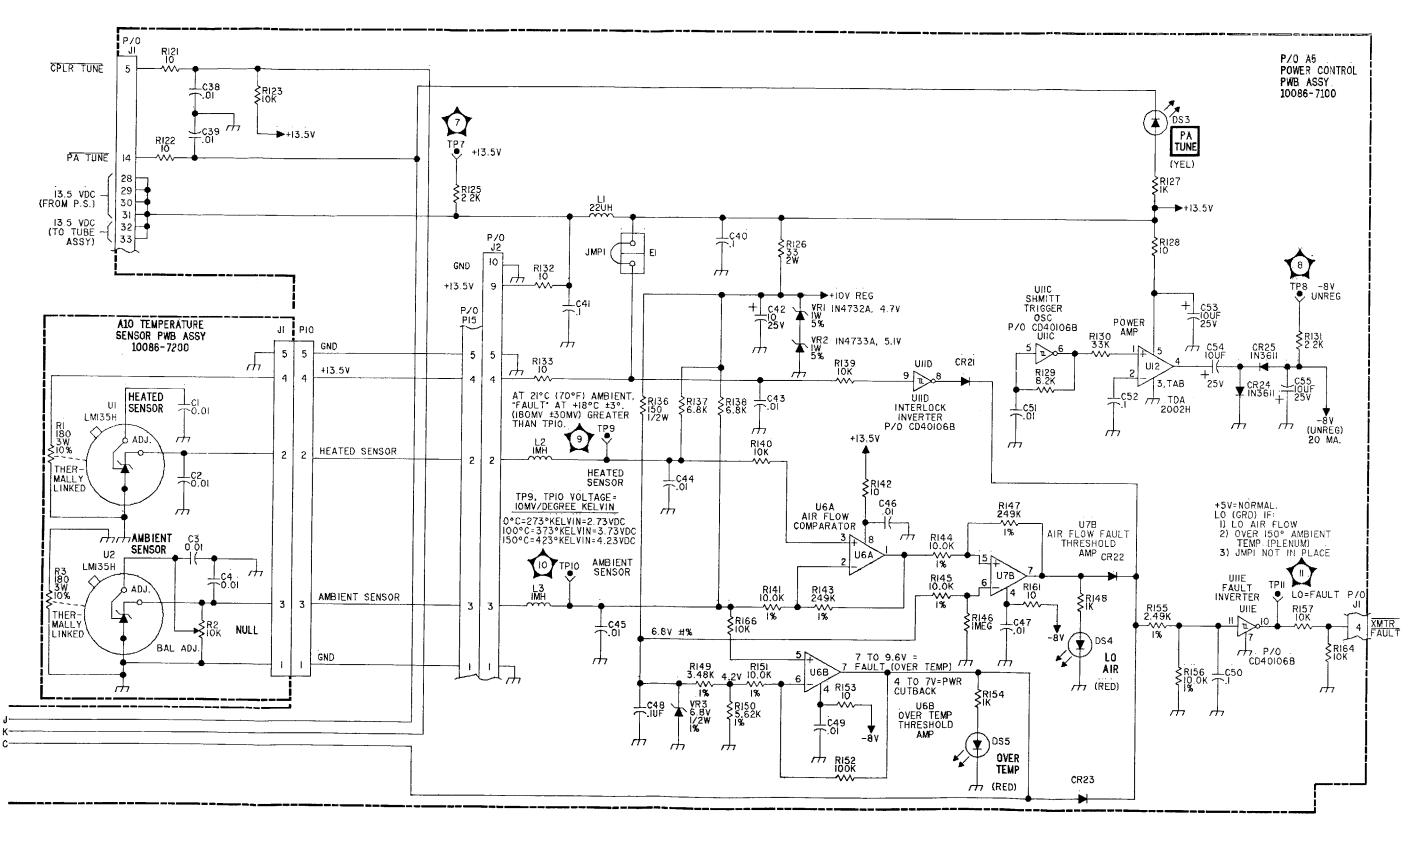


FO-8. Power Control PWB Assy, A5 (Sheet 4 of 4)

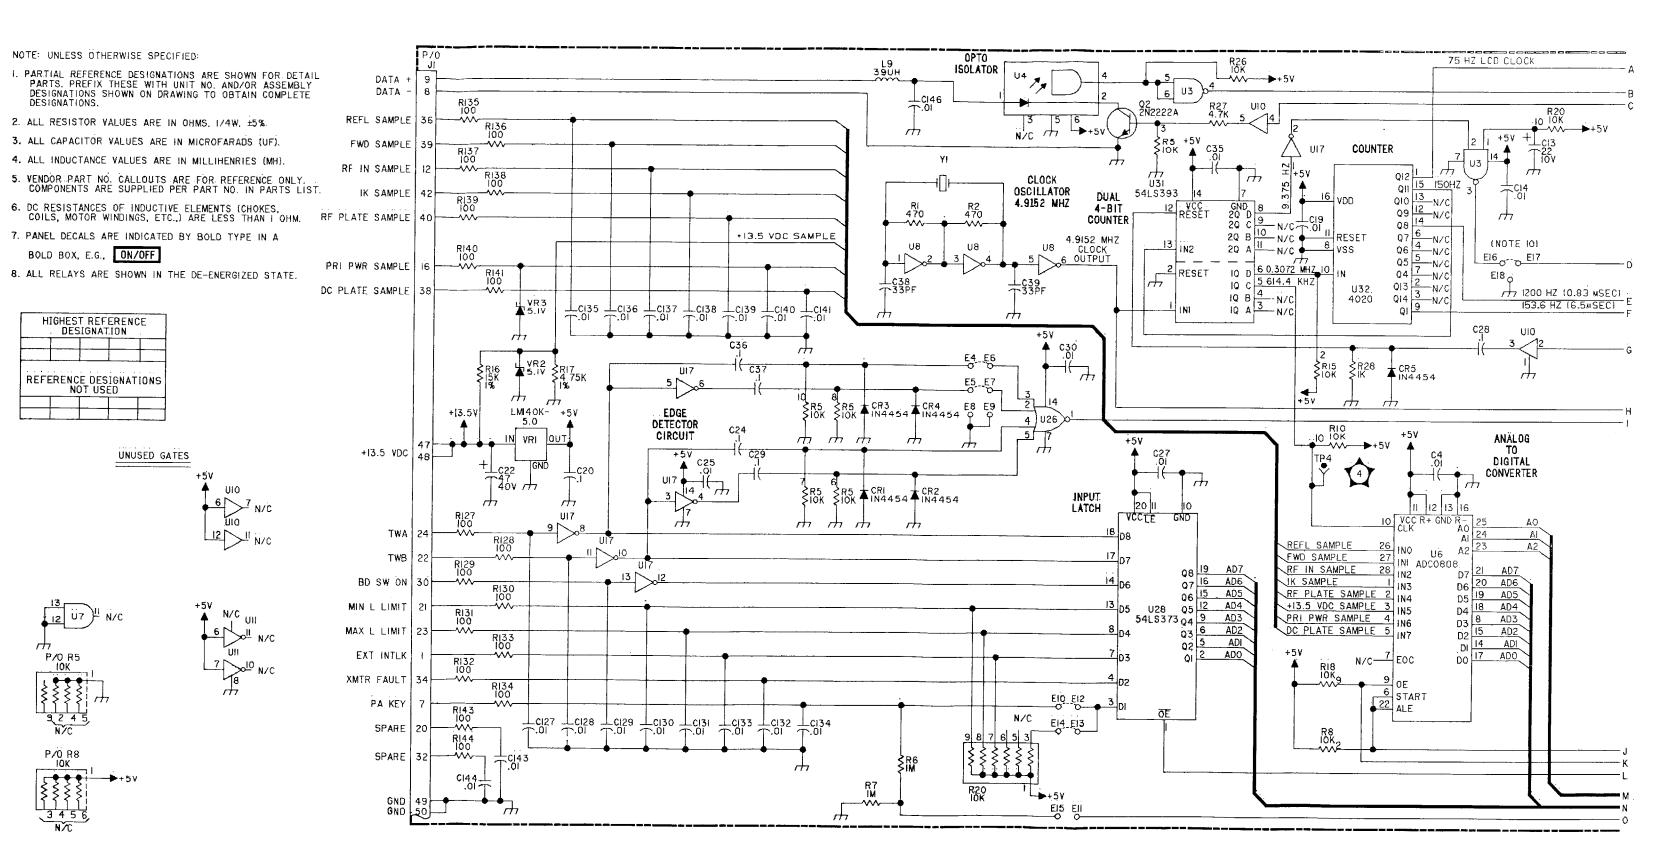


FO-9. Micro Control PWB Assy, A6 (Sheet 1 of 3)

FP-25/(FP-26 Blank)

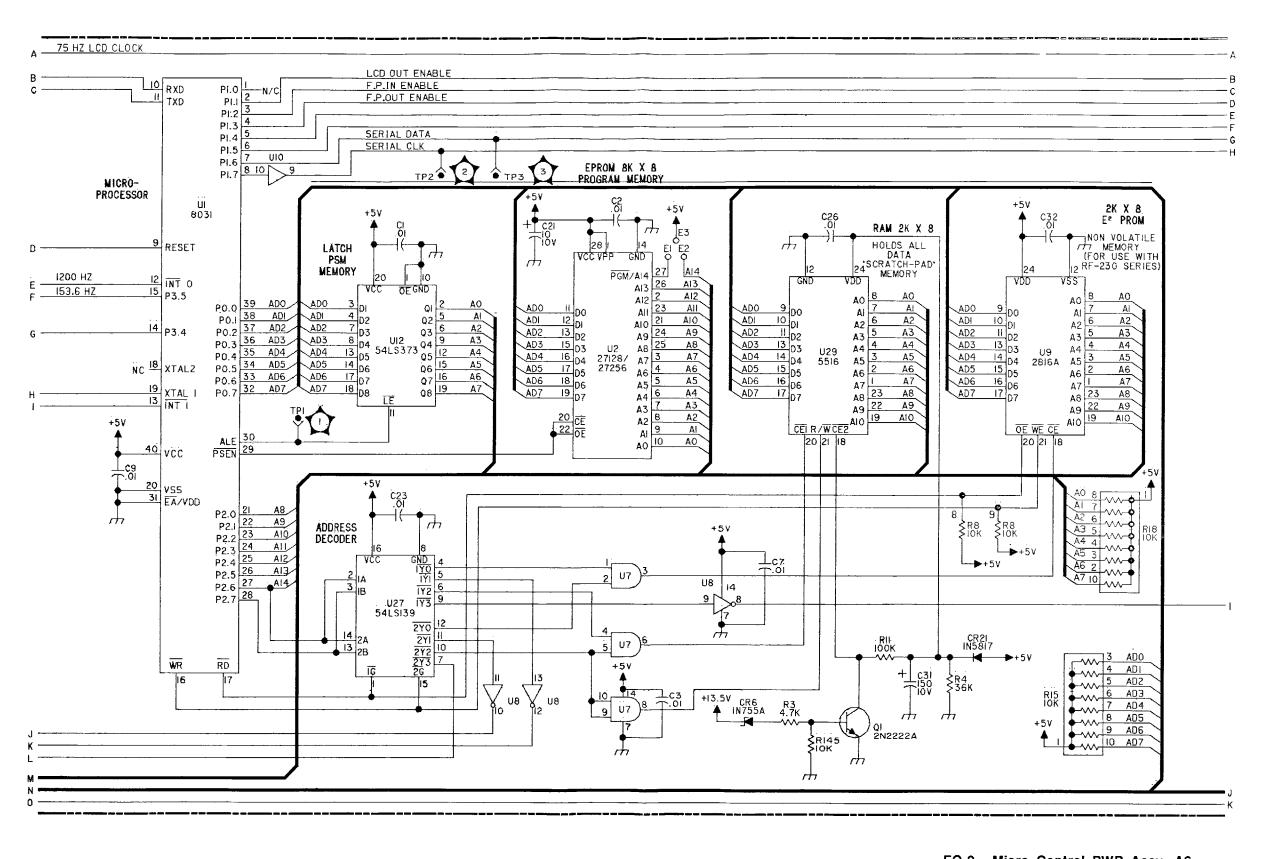

FO-9. Micro Control PWB Assy, A6 (Sheet 2 of 3)


FP-27/(FP-28 Blank)

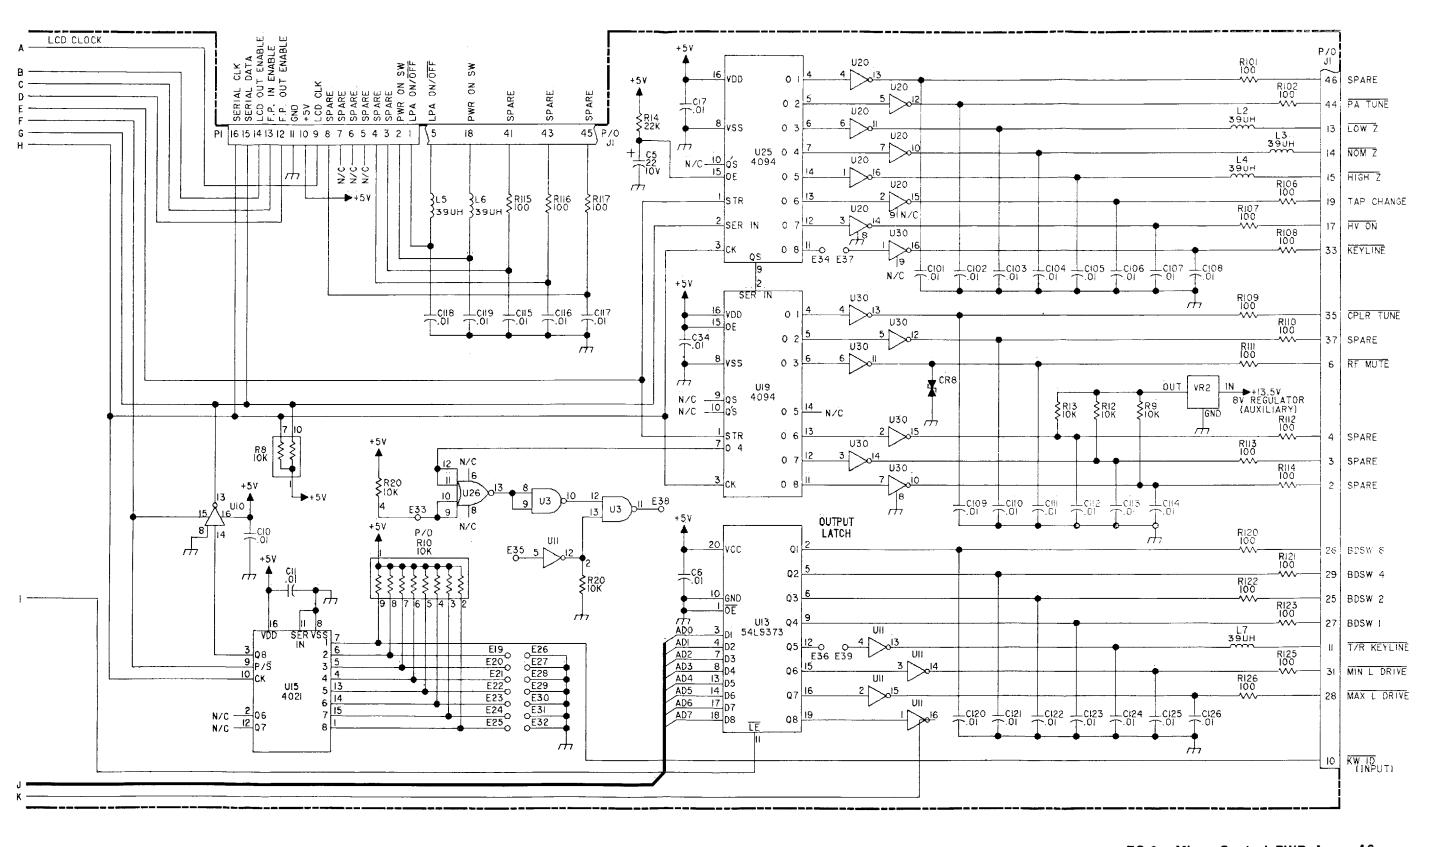


FO-9. Micro Control PWB Assy, A6 (Sheet 3 of 3)

NOTE: UNLESS OTHERWISE SPECIFIED:


- L PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- 5. VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY.
 COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.,) ARE LESS THAN I OHM.
- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE IN A BOLD BOX, E.G., ON/OFF
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.

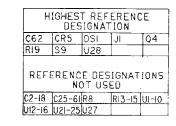

UNUSED GATES

 

9. S3 ANTENNA SWITCH IS NOT USED ON 10086-2100 ASSY. IT IS PRESENT ON 10087-2100.

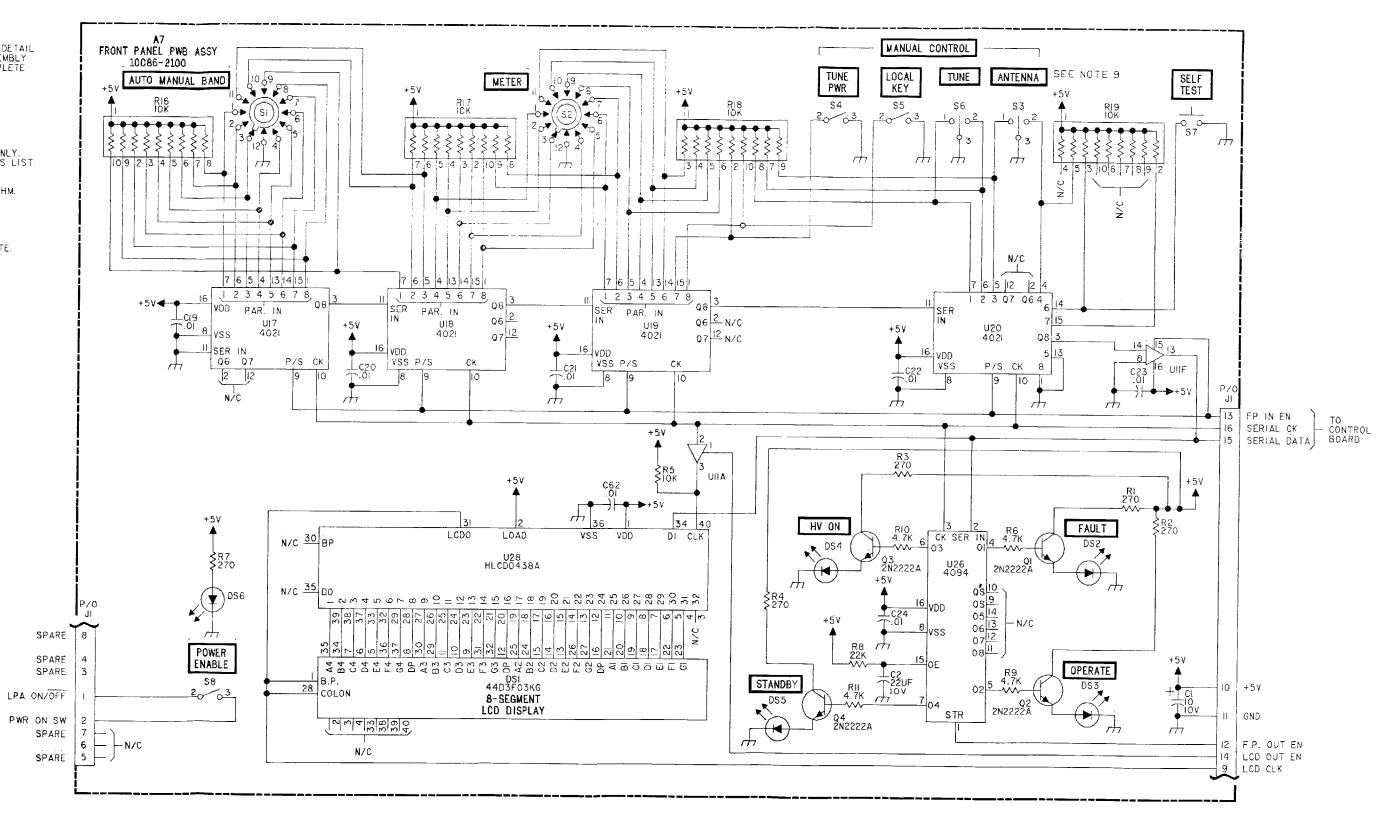

FO-10. Front Panel PWB Assy, A7A1

FP-31/(FP-32 Blank)


NOTE: UNLESS OTHERWISE SPECIFIED:

- I. PARTIAL REFERENCE DESIGNATIONS ARE SHOWN FOR DETAIL PARTS. PREFIX THESE WITH UNIT NO. AND/OR ASSEMBLY DESIGNATIONS SHOWN ON DRAWING TO OBTAIN COMPLETE DESIGNATIONS.
- 2. ALL RESISTOR VALUES ARE IN OHMS, 1/4W, ±5%.
- 3. ALL CAPACITOR VALUES ARE IN MICROFARADS (UF).
- 4. ALL INDUCTANCE VALUES ARE IN MILLIHENRIES (MH).
- 5. VENDOR PART NO. CALLOUTS ARE FOR REFERENCE ONLY.
 COMPONENTS ARE SUPPLIED PER PART NO. IN PARTS LIST.
- 6. DC RESISTANCES OF INDUCTIVE ELEMENTS (CHOKES, COILS, MOTOR WINDINGS, ETC.,) ARE LESS THAN I OHM.
- BOLD BOX, E.G., ON/OFF
- 8. ALL RELAYS ARE SHOWN IN THE DE-ENERGIZED STATE.


HIGHEST REFERENCE DESIGNATION						
J3	Q2	R6	TP2			
			1			
REFERENCE DESIGNATIONS NOT USED						
	1					





 

- 7. PANEL DECALS ARE INDICATED BY BOLD TYPE IN A

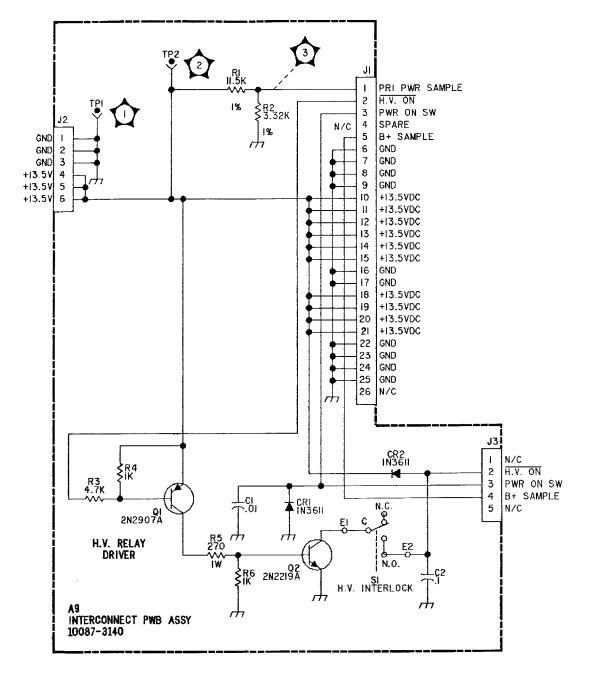

FO-11. Interconnect PWB Assy, A9

FP-33/(FP-34 Blank)