CIRCULATE TO: SERVICE MGR. X RECEPTION X WORKSHOP X PARTS X

TestBook Information



SUBJECT Issue 2

SUBJECT 05/06/96

Market Programming BeCM TB008/96/EN

MODEL
New Range Rover

LP LH AFFECTED VEHICLES
316176 onwards

DETAIL

The BeCM programming detailed is for Rest of World, Australia and Gulf markets and is applicable to 1996 and 1997 Model year vehicle's.

LJ LD

Testbook disc version DRF 0007 has a number of changes to increase the market options for those markets identified above, the changes include :-

- 1. Selecting or.
- 2. Deselecting of Passive immobilisation and Emergency key access code function for those vehicles. For certain Gulf markets the option to switch off the overspeed warning buzzer may now be carried out providing they **DO NOT** have a legal requirement for the feature, by selecting middle east market will give Gulf market functionality

Note: This bulletin supersedes the TB008/96 as the information in the process section has been amended

ACTION REQUIRED

Information only:- Optional BeCM programming for Rest of World, Australia and Gulf markets only!

PARTS	INFOR	MATION

Not applicable


PROCEDURE

Overspeed warning.

- 1. From Welcome Screen select Diagnostic System.
- 2. Enter Vehicle Type.
- 3. Enter Vin number
- 4. Select BeCM programming.
- 5. Choose Market Selection.
- 6. Select Model Year
- 7. Select Middle East.
- 8. After confirmation of successful programming press continue.
- 9. Press EXIT to return to Welcome Screen.

Passive Immobilisation and EKA code.

- 1. From the Welcome Screen select Diagnostic System.
- 2. Enter Vehicle Type.
- 3. Enter Vin number.
- 4. Select BeCM programming.
- 5. Choose Market Seclection.
- 6. Select Model Year.
- 7. Select Australia/Rest of World.
- 8. Select YES/NO to Passive Immobilisation and EKA Code.
- 9. After confirmation of successful programming press continue.
- 10. Press EXIT to return to Welcome Screen.

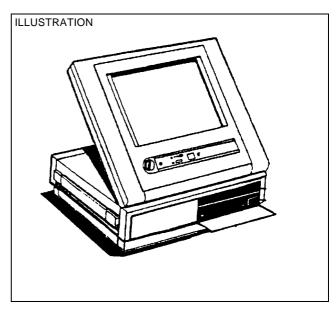

WARRANTY

Normal warranty policy and procedures apply

COMP. CODE Refer to individual complaint codes

SRO

Refer to Bulletin TB006/96 for Diagnostic times