



# 80TK Thermocouple Module

Instruction Sheet

## Introduction

The Fluke 80TK is a thermocouple converter for use with any K-type thermocouple and a digital multimeter. The 80TK accepts the output of any K-type thermocouple and converts it to 1 millivolt per degree (Celsius or Fahrenheit).

A three-position switch acts as a power switch as well as selecting Fahrenheit or Celsius scaling for the output. In addition, the OFF position of the power switch allows you to read the battery condition via the external multimeter. The thermocouple input accepts wire leads or standard minithermocouple connectors.

Temperature is measured by exposing or attaching the thermocouple to the surface to be measured. The multimeter displays the temperature directly in degrees Fahrenheit or Celsius.

# Specifications

### Electrical

Measurement Range: -50 to 1000 degrees Celsius -58 to 1832 degrees Fahrenheit Resolution:

0.1° C/F in 200 mV range
1.0° C/F in 2V range
0.1 C/F in 300 mV range
1.0 C/F in 3V range
0.1° C/F in 400mV range
1.0° C/F in 4V range

Note: Ignore decimal point on 2V, 3V, or 4V range. **Maximum Voltage at Thermocouple Input:** 60V DC, 24V AC

**RF Field**: Exposure to an RF field interferes significantly with this module's capacity to accurately measure temperature with thermocouples. The interference is temporary and the module suffers no harm when exposed to an RF field of 3 V/m. Accurate temperature measurement capability is completely restored when the module is removed from the RF field.

Common sources of RF fields are handheld 2-way radios and cellular telephones. If such a source is suspected of interfering with this module, either turn off the transmitter or increase the separation between the transmitter and the module.

## Environmental

Ambient Operating Range: 0 to 50°C

Storage Temperature:	-40 to 60°C
•	-40 to 140°F
Humidity:	0% to 90% (0 to 35°C)
-	0% to 70% (35 to 50°C)

Basic Accuracy: (@ 23 ±5°C Calibration)\*

(Applies for one year after purchase or recalibration) RANGE ACCURACY  $\pm$  (% of reading +

RANGE	ACCURACY $\pm$ (% of degrees), 1 year
-20 to 350°C	0.5% ± 2°C
-4 to 662°F	0.5% ± 3.6°F
351 to 500°C†	1.75% ± 2°C
664 to 932°F†*	1.75% ± 3.6°F
501 to 1000°C	2.0% ± 2°C
933 to 1832°F	2.0% ± 3.6°F
-50 to -21°C -58 to -5.8°F	$2.5\% \pm 2^{\circ}C$ typical $2.5\% \pm 3.6^{\circ}F$ typical

#### **Temperature Coefficient:**

- \* 0°C to 18°C and 28°C to 50°C ambient, multiply the basic accuracy specification by 0.1 for each degree above 28 or below 18.
- $\dagger\,$  For accuracy enhancement between 351°C to 500°C, subtract 3 degrees from the reading. The accuracy is now 0.75%  $\pm\,$  2°C.
- $\uparrow^*$  For accuracy enhancement between 663°F and 932°F, subtract 5.4 degrees from the reading. The accuracy is now 0.75%  $\pm$  3.6°F.

#### Note

The basic accuracy specification does not include the error of the probe or the DMM. Please refer to the probe accuracy specification for additional details.

### General

Weight: 4.5 ounces, 126 grams

Overall length: 4 5/8 inches, 11.75 mm

Battery: Standard 9V Battery (NEDA #1604, 6F22, 006P)

Battery Life: 1600+ hours, 6.5V minimum

**Output:** 3/4 inch spaced banana plugs, 10 megohm minimum load resistance

### Accessories

**80PK-1 (included)**: Bead Probe 4 foot K-type thermocouple bead probe, with Teflon tape insulation. Maximum insulation temperature:  $260^{\circ}$ C. Accuracy:  $\pm 2.2^{\circ}$ C or  $\pm 0.75\%$  (whichever is greater) from 0 to 800°C.

**80PK-2A**: Immersion Probe (8" or 20.32 cm from tip to probe handle)

80PK-3A: Surface Probe (for flat or curved surfaces)

**80PK-4A**: Air Probe (protected by stainless steel baffle)

**80PK-5A**: Piercing Probe (suitable for food use, liquids and gels)

**80PK-6A**: Exposed Junction Probe (exposed bead attached to 6" sheath)

©1985, 1995, 1996 , 2000 Fluke Corporation. All rights reserved. Printed in USA All product names are trademarks of their respective companies.

#### 80PK-7: Industrial Surface Probe

**80PK-8** Pipe Clamp Probe (For pipe diameter 1/4" to 1 7/8") **80CK-M**: Male Mini-Connector (for attachment of K-type thermocouple wire)

# Use and Operation

Thermocouples rely upon the difference in temperature between the measuring junction and a reference junction. Traditionally the reference junction is another thermocouple placed in an ice bath, however, the 80TK uses an electronic reference junction. The converter (80TK) must be operated in a thermal environment consistent with its specifications.

## Measuring Technique

Making accurate temperature readings using a thermocouple is a matter of identifying and minimizing the causes of error. The largest contributor to errors is the thermal interface between the measurement surface and the thermocouple. The next largest contributor is the temperature difference between the thermocouple probe and its environment.

Here are some suggestions for improving the accuracy of your temperature measurements. Ensure that there is a good connection between the probe and the surface you are measuring. You can do this in many ways:

- 1. Increase the mounting pressure.
- 2. Use an interface agent (such as silicone grease) between the thermocouple probe and the surface you are measuring.
- 3. Use a thermal epoxy to attach the thermocouple.

When measuring temperatures higher than ambient, adjust the connection of the probe to the surface until you get the highest temperature reading. Use any of the suggestions given above to do so.

When measuring temperatures lower than ambient, adjust the connection of the probe to the surface until you get the lowest temperature reading. Use any of the suggestions given above to do so.

When measuring temperatures near ambient, make the reading when the multimeter display is most stable.

#### Warning

To avoid electrical shock, do not use this instrument when voltages exceeding 24V ac or 60V dc are present. The probe tip is electrically connected to the output terminals.

## Temperature Measurement

Follow this procedure to correctly use the 80TK.

- 1. Plug the 80TK into the multimeter. Ensure that the banana plug with the red dot above it plugs into the voltage input and the other plug is in the COM input.
- Set the multimeter to the 200, 300, or 400 millivolt range. This setting will read temperatures equal to the number of millivolts the range has (i.e., 320°C or F if the millivolt range reads 320 mV.
- 3. Use the dc volt setting and ignore the decimal for higher temperatures than can be accomodated by the millivolt range. Less resolution is available when using the volt range.
- 4. Plug the thermocouple into the 80TK thermocouple input connector. If the thermocouple does not have a plug attached, connect the thermocouple wires to the thermocouple input screws inside the 80TK. The yellow coded wire (chromel) connects to the screw marked "+".

- 5. Turn on the 80TK and the multimeter.
- 6. Adjust the thermal connection between the measurement surface and the thermocouple as described previously.
- 7. Read the temperature on the multimeter.

## **Open Thermocouple Reading**

If the thermocouple probe has open circuited (i.e. is broken), the mulimeter will read a steady, constant voltage. The voltage readings are:

Range	Reading
С	≥ 1.0V
F	≥ 2.2V

## **Battery Condition Test**

- 1. Set the power switch to the OFF position.
- 2. Connect the 80TK to the multimeter.
- 3. Set the multimeter to the 200, 300, or 400 mV dc range.
- 4. Read the battery test voltage on the multimeter. A minimum reading of 75 mV is acceptable and indicates that approximately 100 hours of battery life remain.

### **Battery Replacement**

#### Warning

To avoid electrical shock, remove the thermocouple from the measurement surface, or disconnect the thermocouple from the instrument before opening the case. Totally reassemble the instrument before attempting to use it.

- 1. Set the power switch to the OFF position.
- 2. Disconnect the 80TK from the multimeter.
- 3. Unplug or disconnect the thermocouple
- Turn the 80TK so the power switch is facing down. Remove the single screw located between the banana plugs.
- 5. Grasp one case half in each hand. Pull the two halves apart, beginning at the end with the banana plugs.
- 6. Remove and replace the battery.
- 7. Reassemble the 80TK.
- 8. To reassemble, mate the two case halves at the end with the thermocouple connector, then "hinge" the two halves together.

## 80TK Self Test

The following test is an easy way to verify proper operation of the 80TK:

- 1. Follow the Battery Replacement Procedure to open the case.
- 2. Using a short piece of bare wire, short the input thermocouple terminals together.
- 3. Plug the 80TK into the multimeter.
- 4. Turn the multimeter and the 80TK on. Set the multimeter to 200, 300, or 400 mV range.
- 5. The multimeter should read the ambient room temperature.

# 80TK Calibration Procedure

A calibration cycle of 1 year is recommended to maintain the 80TK within specifications. The required equipment is listed below. Use Calibration Procedure 1 to calibrate the 80TK for use with any K-type thermocouple. Use Calibration Procedure 2 if the 80TK will be used exclusively with one Ktype thermocouple. Always calibrate the Celsius function before calibrating the Fahrenheit function.



#### Location of Calibration Adjustments

### Calibration Procedure 1.

Use this procedure to calibrate the 80TK:

- 1. Verify the condition of the battery as described above and replace the battery if necessary. Follow the Battery Replacement procedure to disassemble the 80TK, but do not remove the battery or reassemble the 80TK.
- Allow 80TK and the room-temperature water bath to stabilize at room temperature, away from drafts, for at least 30 minutes before proceeding with calibration. Place the reference thermometer into the room temperature water bath. Allow the reading to stabilize.
- 3. Use the shorting bar to short the 80TK thermocouple input terminals.

- 4. Plug the 80TK into the dc volts input of the multimeter. Set the multimeter to the 300 mV or equivalent range.
- 5. Set the switch on the 80TK to CELSIUS position. Adjust R4 to half rotation, then adjust R5 until the reading on the multimeter matches the reading on the mercury reference thermometer  $\pm$  5.0°C. Now adjust R4 until the two readings are within  $\pm$  0.1°C.

Note

If the mercury reference thermometer displays °F, use the following conversion to get °C: [5/9 (temp in °F)-32] = (temp in °C)

- 6. Set the switch on the 80TK to the FAHRENHEIT (center) position.
- 7. Adjust R16 until the reading on the multimeter matches the reading on the mercury reference thermometer  $\pm$  0.2°F.

#### Note

If the mercury reference thermometer displays °C, use the following conversion to get °F:[9/5(temp in °C) + 32] = (temp in °F)

- 8. Set 80TK switch to the OFF position. Remove 80TK from multimeter and remove any connections to the 80TK thermocouple input terminals.
- 9. Reassemble the 80TK.
- 10. The 80TK is now calibrated.

### Calibration Procedure 2.

Use this procedure if the 80TK will be used exclusively with one K-type thermocouple:

Perform Calibration Procedure 1. Substitute the following for step 3 in Calibration Procedure 1:

3. Connect the thermocouple to the 80TK thermocouple input, and place the thermocouple into the room temperature bath along with the mercury reference thermometer.

## **Required Equipment**

Refer to Table 1 for equipment required to calibrate the 80TK.

Instrument	Minimum Specification	Recommended Model	
Mercury Reference Thermometer	0.1°C resolution	Princo Model SAMA-CP45	
Dewar Flask and Cap(water bath)	2 pint capacity, filled with water	Thermos bottle	
Digital Voltmeter	300 mV range, 100 $\mu$ V resolution	Fluke Model 87 Series III	
Shorting bar OR	<1 ohm	Wire	
K-type thermocouple	meets NBS standards(with subminiature K plug)	Fluke 80PK-1	

#### Table 1. Required Equipment

To contact Fluke, call one of the following telephone numbers:

USA: 1-888-99-FLUKE (1-888-993-5853) Canada: 1-800-36-FLUKE (1-800-363-5853) Europe: +31 402-678-200 Or, visit Fluke's Web site at www.fluke.com.

> Fluke Corporation P.O. Box 9090 Everett WA 98206-9090 USA

Japan: +81-3-3434-0181 Singapore: +65-738-5655 Anywhere in the world: +1-425-446-5500

> Fluke Europe B.V. P.O. Box 1186 5602 B.D. Eindhoven The Netherlands



#### 80TK Schematic Diagram

#### Replaceable Parts

735845 CASE TOP 735852 CASE BOTTOM 735910 COVER SWITCH 735928 SHIELD CONTACT 747501 SCREW,SCREW,PH, AR1 802691 IC.OP AMP,TLC2714	PO STI 4.40.250
735910 COVER SWITCH 735928 SHIELD CONTACT 747501 SCREW,SCREW,PH,	PO STI 4.40.250
735928 SHIELD CONTACT 747501 SCREW,SCREW,PH,	PO STI 4.40.250
747501 SCREW,SCREW,PH,	PO STI 4-40, 250
	PO STI 4-40 250
AR1 802691 IC,OP AMP.TLC271A	10,012,4-40,.200
	,PROGRAMMABLE,LOW POWER,SO8
BT1 696534 BATTERY,PRIMARY	,BATTERY,9V,0-15MA
C1 C2 942529 CAPACITOR,SMR,C/	AP,CER,0.1UF,+-10%,25V,X7R,0805
C3 942552 CAPACITOR,SMR,C/	AP,TA,1UF,+-20%,20V,3216
C4 650223 CAPACITOR,SMR,C	AP,TA,10UF,+-20%,10V,3216
CR1 CR4 830489 DIODE,BAS16,SMR,I	DIODE,SI,75V,250MA,SOT-23
CR2 876529 DIODE,BAT54,SMR,I	DIODE,SI,SCHOTTKY,30V,200MA,SOT-23
J1 J2 735993 80TK-8008,CONTAC	T, THERMOCOUPLE
MP1 1276793 80TK-3012,80TK - PC	CB SM_PIH
P1 P2 736033 80TK-8009,PLUG,BA	NANA
Q1 Q2 Q4 742676 NPN,MMBT3904,SM	R,TRANSISTOR,SI,NPN,60V,350MW,SOT-23
Q3 820902 NPN,MMBT5089,SM	R,TRANSISTOR,SI,NPN,30V,200MW,SOT-23
Q5 Q6 820910 PNP,MMBT5087,SMF	R,TRANSISTOR,SI,PNP,50V,225MW,SOT-23
R1 802725 RESISTOR,CERMET	,22M,+-1%,0.1W,400PPM,0805,TAPE
R10 943006 RESISTOR,CERMET	,2.1K,+-1%,0.1W,100PPM,0805,TAPE
R11 913731 RESISTOR,SMR,RES	S,CERM,22.1K,+-1%,100PPM,1206
R12 802675 RESISTOR,SMR,RES	S,MF,18.2K,+-0.1%,0.1W,25PPM,0805
R13 802683 RESISTOR,SMR,RES	S,MF,22.1K,+-0.1%,0.1W,25PPM,0805
R14 R18 867296 RESISTOR,SMR,RES	S,CERM,698K,+-1%,.125W,100PPM,1206
R15 802717 RESISTOR,CERMET	,1.82M,+-1%,0.1W,400PPM,0805
R16 928085 RESISTOR,SMR,RES	S,VAR,CERM,200K,+-25%
R17 821447 RESISTOR,SMR,RES	S,CERM,4.22K,+-1%,.125W,100PPM,1206
R19 943659 RESISTOR,CERMET	,10M,+-1%,0.1W,400PPM,0805,TAPE
R2 R20 928866 RESISTOR,SMR,RES	S,CERM,100K,+-1%,0.1W,100PPM,0805
R21 928767 RESISTOR,SMR,RES	S,CERM,4.99K,+-1%,0.1W,100PPM,0805
R22 928754 RESISTOR,SMR,RES	S,CERM,2.43K,+-1%,0.1W,100PPM,0805
R23 806240 RESISTOR,SMR,RES	S,CERM,1.2M,+-5%,.125W,200PPM,1206
R24 802709 RESISTOR,CERMET	,4.12M,+-1%,0.1W,400PPM,0805
R3 802659 RESISTOR,SMR,RES	S,MF,750K,+-0.25%,0.1W,50PPM,0805
R4 106937 RESISTOR,SMR,RES	S,VAR,CERM,100,+-20%,0.25W
R5 802782 RESISTOR,SMR,RES	S,VAR,CERM,1K,+-20%,0.25W
R6 927426 RESISTOR,SMR,RES	S,CERM,182K,+-1%,.125W,100PPM,1206
R7 876441 RESISTOR,SMR,RES	S,CERM,604K,+-1%,.125W,100PPM,1206
R8 802444 RESISTOR,SMR,RES	S,MF,10K,+-0.1%,0.1W,50PPM,0805
R9 802667 RESISTOR,SMR,RES	S,MF,442K,+-0.1%,0.1W,25PPM,0805
S1 740225 SWITCH,SWITCH,SL	IDE,DPTT
VR1 930065 BIPOLAR 4040,SMR,	IC,V REF,SHUNT,2.5 V,1%,150 PPM,SOT23

#### LIMITED WARRANTY & LIMITATION OF LIABILITY

Each Fluke product is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is one year and begins on the date of shipment. Parts, product repairs and services are warranted for 90 days. This warranty extends only to the original buyer or end-user customer of a Fluke authorized reseller, and does not apply to fuses, disposable batteries or to any product which, in Fluke's opinion, has been misused, altered, neglected or damaged by accident or abnormal conditions of operation or handling. Fluke warrants that software will operate substantially in accordance with its functional specifications for 90 days and that it has been properly recorded on non-defective media. Fluke does not warrant that software will be error free or operate without interruption.

Fluke authorized resellers shall extend this warranty on new and unused products to end-user customers only but have no authority to extend a greater or different warranty on behalf of Fluke. Warranty support is available if product is purchased through a Fluke authorized sales outlet or Buyer has paid the applicable international price. Fluke reserves the right to invoice Buyer for importation costs of repair/replacement parts when product purchased in one country is submitted for repair in another country. Fluke's warranty obligation is limited, at Fluke's option, to refund of the purchase price, free of charge repair, or replacement of a defective product which is returned to a Fluke authorized service center within the warranty period.

To obtain warranty service, contact your nearest Fluke authorized service center or send the product, with a description of the difficulty, postage and insurance prepaid (FOB Destination), to the nearest Fluke authorized service center. Fluke assumes no risk for damage in transit. Following warranty repair, the product will be returned to Buyer, transportation prepaid (FOB Destination). If Fluke determines that the failure was caused by misuse, alteration, accident or abnormal condition of operation or handling, Fluke will provide an estimate of repair costs and obtain authorization before commencing the work. Following repair, the product will be returned to the Buyer transportation prepaid and the Buyer will be billed for the repair and return transportation charges (FOB Shipping Point).

THIS WARRANTY IS BUYER'S SOLE AND EXCLUSIVE REMEDY AND IS IN LIEU OF ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. FLUKE SHALL NOT BE LIABLE FOR ANY SPECIAL, INDIRECT, INCIDENTAL OR CONSEQUENTIAL DAMAGES OR LOSSES, INCLUDING LOSS OF DATA, WHETHER ARISING FROM BREACH OF WARRANTY OR BASED ON CONTRACT, TORT, RELIANCE OR ANY OTHER THEORY.

Since some countries or states do not allow limitation of the term of an implied warranty, or exclusion or limitation of incidental or consequential damages, the limitations and exclusions of this warranty may not apply to every buyer. If any provision of this Warranty is held invalid or unenforceable by a court of competent jurisdiction, such holding will not affect the validity or enforceability of any other provision.