3325B-01

		SUPERSEDES	S: None		
HP 3325B Syr	nthesizer/Function Generator				
Serial Numbers:	0000A00100 / 2847A06410				
High Line and	Low Line Fuse Change				
•	Low Line Puse Change				
Parts Required:					
HP Part No.	Description	Line (Operation		
2110-0876	Fuse 1.5A 250V non time delay	(100/120	(100/120V operation)		
2110-0877	Fuse 750mA 250V non time delay	(220/240	V operation	n)	
03325-80401	Label- rear panel fuse label				
Situation:	v line fuses are being increased in value				
Both high and low		occurs during			
Both high and low plowing at power-	up (due to a large inrush current that of tage). This problem occurs most freque		line setting	2	
Both high and low plowing at power-	up (due to a large inrush current that of tage). This problem occurs most frequ		line setting	S	
Both high and low blowing at power- of applied line vol (220/240V).		ently at high	line setting	S	

ADMINISTRATIVE INFORMATION

SERVICE NOTE CLASSIFICATION:						
MODIFICATION RECOMMENDED						
ACTION CATEGORY:	IMMEDIATELY ON SPECIFIED FAILURE AGREEABLE TIME	STANDARDS: LABOR:				
LOCATION CATEGORY:	CUSTOMER INSTALLABLE	SERVICE I RETURN USED RETURN INVENTORY: SCRAP PARTS: SCRAP SEE TEXT SEE TEXT				
AVAILABILITY:	PRODUCT'S SUPPORT LIFE	RESPONSIBLE ENTITY: A100 UNTIL: 09 March 1994				
AUTHOR: DAA	ENTITY: A100	ADDITIONAL INFORMATION:				

© 1992 HEWLETT-PACKARD COMPANY PRINTED IN U.S.A.



Solution/Action:

Remove the power cord from the 3325B. Replace the line fuse with the appropriate value (listed above) and apply the fuse label over the incorrect silked screened label on the rear panel.

Make documentation corrections in the 3325B manuals as follows:

Manual Part No.	Page	Correction
Operating Manual 03325-90014	1-2 1-35,37 1-41,42	Change the fuse values on the rear panel diagram.
Installation Man. 03325-90006	4-3 4-4	Change fuse values in Table 4-2. Figure 4-1 change rear panel fuse label.
Service Manual 03325-90003	6-25	Table 6-3 Change p/n and description of F1. Add Label p/n to end of list.

Page 2