



# PIC17C42A

---

## PIC17C42A Rev. A Silicon Errata Sheet

---

The PIC17C42A (Rev. A) parts you have received conform functionally to the PIC17C4X preliminary data sheet (DS30412C), except for the following clarifications and corrections.

**NONE**

### Clarifications/Corrections to the Data Sheet:

The PIC17C42A Preliminary Data Sheet (document DS30412C) that you have received, requires the following clarifications and corrections.

1. The clearing of any interrupt enable bit(s) in the INTSTA register should be preceded by the disabling of the global interrupt control bit (setting GLINTD). Global interrupts may then be re-enabled. The individual interrupts may be re-enabled without further control of the GLINTD bit.

When global interrupts are enabled, if the interrupt flag is being set when the corresponding enable bit is being cleared the device will branch to the reset vector address (0h). The interrupt flag will not be (automatically) cleared.

2. The RETURN instruction causes an update of the PCLATH register. The PCLATH register is loaded with the high address of the RETURN instruction.
3. The Table write to internal program memory (self programming) can occur even when the MCLR pin is either at the  $V_{IH}$  or  $V_{IHH}$  voltage level. When the MCLR pin is at  $V_{IH}$ , the table write sequence occurs, but the programming voltage is marginal since the MCLR pin is not at the correct level. This table write may cause the specified program memory location to be corrupted (depending on the data in the TABLAT register).

**Note:** As with any windowed EPROM device, please cover the window at all times, except when erasing.

# PIC17C42A

4. Unexpected results may occur if a table write (TABLWT instruction) to external memory occurs after a table read (TABLRD instruction).

To ensure that the proper 16-bit value is written, a table write (TLWT) instruction(s) needs to be followed by the TABLWT instruction. If not the value that is written will not be as expected. The value will contain the values that were last written to the TABLATH and TABLATL registers and will not contain the values that had been read from the external memory into the TABLATH:TABLATL registers by the TABLRD instruction.

Example:

```

                                TABLAT  Ext Bus
TLWT    LO, fn1                x:fn1    -:-
TABLWT   HI, 1, fn2  fn2:fn1  fn2:fn1
:
TABLRD   HI, 0, fn3  X1:X0    X1:X0
TLRD     LO, fn4      X1:X0    -:-
:
TABLWT   HI, 1, fn5  fn5:X0    fn5:fn1
```

5. The Power-down current of the PIC17C42A has been increased as shown in Table 1. The specification of 5  $\mu$ A remains for the PIC17LC42A devices.

**TABLE 1: DC SPECIFICATION LIMITS THAT VARY FROM DATA SHEET**

Param No.	Sym.	Characteristic	Tested			Data Sheet			Units	Condition
			Min	Typ	Max	Min	Typ	Max		
D021	IPD	Power-down Current	—	< 1	10	—	< 1	5	$\mu$ A	PIC17C42A
			—	< 1	5	—	< 1	5	$\mu$ A	PIC17LC42A



**MICROCHIP**

# WORLDWIDE SALES & SERVICE

## AMERICAS

### Corporate Office

Microchip Technology Inc.  
2355 West Chandler Blvd.  
Chandler, AZ 85224-6199  
Tel: 602-786-7200 Fax: 602-786-7277  
Technical Support: 602 786-7627  
Web: <http://www.microchip.com>

### Atlanta

Microchip Technology Inc.  
500 Sugar Mill Road, Suite 200B  
Atlanta, GA 30350  
Tel: 770-640-0034 Fax: 770-640-0307

### Boston

Microchip Technology Inc.  
5 Mount Royal Avenue  
Marlborough, MA 01752  
Tel: 508-480-9990 Fax: 508-480-8575

### Chicago

Microchip Technology Inc.  
333 Pierce Road, Suite 180  
Itasca, IL 60143  
Tel: 630-285-0071 Fax: 630-285-0075

### Dallas

Microchip Technology Inc.  
14651 Dallas Parkway, Suite 816  
Dallas, TX 75240-8809  
Tel: 972-991-7177 Fax: 972-991-8588

### Dayton

Microchip Technology Inc.  
Two Prestige Place, Suite 150  
Miamisburg, OH 45342  
Tel: 937-291-1654 Fax: 937-291-9175

### Los Angeles

Microchip Technology Inc.  
18201 Von Karman, Suite 1090  
Irvine, CA 92612  
Tel: 714-263-1888 Fax: 714-263-1338

### New York

Microchip Technology Inc.  
150 Motor Parkway, Suite 202  
Hauppauge, NY 11788  
Tel: 516-273-5305 Fax: 516-273-5335

### San Jose

Microchip Technology Inc.  
2107 North First Street, Suite 590  
San Jose, CA 95131  
Tel: 408-436-7950 Fax: 408-436-7955

### Toronto

Microchip Technology Inc.  
5925 Airport Road, Suite 200  
Mississauga, Ontario L4V 1W1, Canada  
Tel: 905-405-6279 Fax: 905-405-6253

## ASIA/PACIFIC

### Hong Kong

Microchip Asia Pacific  
RM 3801B, Tower Two  
Metroplaza  
223 Hing Fong Road  
Kwai Fong, N.T., Hong Kong  
Tel: 852-2-401-1200 Fax: 852-2-401-3431

### India

Microchip Technology Inc.  
India Liaison Office  
No. 6, Legacy, Convent Road  
Bangalore 560 025, India  
Tel: 91-80-229-0061 Fax: 91-80-229-0062

### Korea

Microchip Technology Korea  
168-1, Youngbo Bldg. 3 Floor  
Samsung-Dong, Kangnam-Ku  
Seoul, Korea  
Tel: 82-2-554-7200 Fax: 82-2-558-5934

### Shanghai

Microchip Technology  
RM 406 Shanghai Golden Bridge Bldg.  
2077 Yan'an Road West, Hong Qiao District  
Shanghai, PRC 200335  
Tel: 86-21-6275-5700  
Fax: 86 21-6275-5060

### Singapore

Microchip Technology Taiwan  
Singapore Branch  
200 Middle Road  
#07-02 Prime Centre  
Singapore 188980  
Tel: 65-334-8870 Fax: 65-334-8850

### Taiwan, R.O.C

Microchip Technology Taiwan  
10F-1C 207  
Tung Hua North Road  
Taipei, Taiwan, ROC  
Tel: 886 2-717-7175 Fax: 886-2-545-0139

## EUROPE

### United Kingdom

Arizona Microchip Technology Ltd.  
Unit 505 Eskdale Road  
Winnersh Triangle  
Wokingham, Berks, RG41 5TU  
Tel: 44-118-921-5800 Fax: 44-118-921-5820

### France

Arizona Microchip Technology SARL  
Zone Industrielle de la Bonde  
2 Rue du Buisson aux Fraises  
91300 Massy, France  
Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79

### Germany

Arizona Microchip Technology GmbH  
Gustav-Heinemann-Ring 125  
D-81739 München, Germany  
Tel: 49-89-627-144 0 Fax: 49-89-627-144-44

### Italy

Arizona Microchip Technology SRL  
Centro Direzionale Colleoni  
Palazzo Taurus 1 V. Le Colleoni 1  
20041 Agrate Brianza  
Milan, Italy  
Tel: 39-39-6899939 Fax: 39-39-6899883

## JAPAN

Microchip Technology Intl. Inc.  
Benex S-1 6F  
3-18-20, Shinyokohama  
Kohoku-Ku, Yokohama-shi  
Kanagawa 222 Japan  
Tel: 81-45-471- 6166 Fax: 81-45-471-6122

10/20/97



All rights reserved. © 1997, Microchip Technology Incorporated, USA. 10/97 Printed on recycled paper.

Information contained in this publication regarding device applications and the like is intended for suggestion only and may be superseded by updates. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights. The Microchip logo and name are registered trademarks of Microchip Technology Inc. in the U.S.A. and other countries. All rights reserved. All other trademarks mentioned herein are the property of their respective companies.