



Coaxial

DA5000

Mounting

N Connector

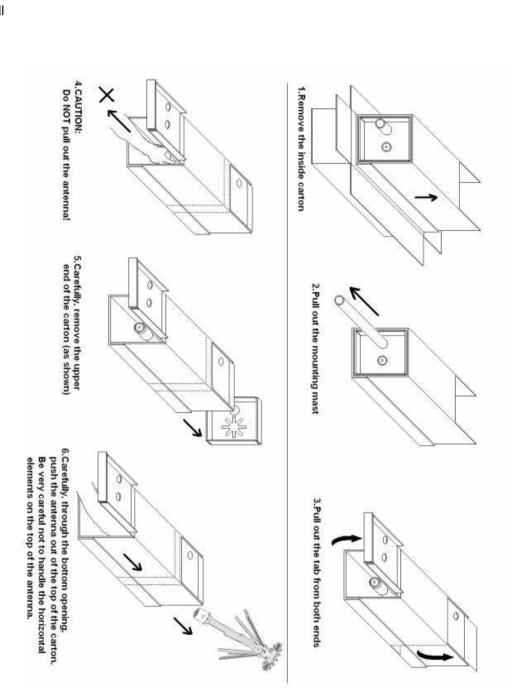



- 1. Connect the N connector
- 2. Insert the screw with washer (as shown)
- 3. Secure to stub-mast (included) and to mounting pole (not supplied)