

## Electro-Voice®


a MARK IV company

600 Cecil Street Buchanan, Michigan 49107 Phone: 616-695-6831 FAX: 616-695-3104

# SERVICE DATA

# N/D257B, 357B, 457B, 757B


### Microphones

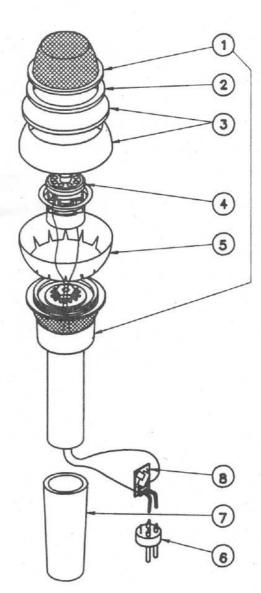



PARTS LIST				
Ref. No.	Part No.	Description		
1.	See chart	Screen & Handle S/A		
	See chart	(top screen only)		
2.	72813	Bumper Ring, silver		
	72213	Bumper Ring, black		
	71241	Bumper Ring, gold		
3.	See chart	Wind Filter S/A		
4.	See chart	Head S/A		
5.	71246	Wind Filter, Spher.		
6.	17162	Connector Insert		
7.	71220	Handgrip		
8.	82529	Passive EQ. Circuit S/A		


CHART					
Model	Item 1	Screen	Item 3	Item 4	
257	82633-XX	81205-ET	82632-XX	82535-XX	
357	82634-XX	81209-ET	82631-XX	82530-XX	
357S	82636-XX	81209-ET	82631-XX	82530-XX	
457	82635-XX	81205-ET	82632-XX	82539-XX	
757	82638-XX	81209-ET	82631-XX	82540-XX	
757S	82637-XX	81209-ET	82631-XX	82540-XX	











#### INSTRUCTIONS

#### TOOLS REQUIRED:

LOW WATT SOLDERING IRON
SMALL SCREWDRIVER
NEEDLE NOSE PLIERS
METHYL-ETHYL-KETONE SOLVENT
BLUE BARKER CEMENT
THREAD LOCKER EV#97207
CYCOLAC CEMENT

UNSCREW FRONT SCREEN ASSEMBLY OF ITEM 1.
 REMOVE ITEM 6 BY APPLYING A SMALL AMOUNT
 OF OF 'MEK' SOLVENT BETWEEN BRASS RING
 AND CASE. ITEM 6 MAY NOW BE PRIED OR
 TWISTED OUT. UNSOLDER LEAD WIRES FROM
 ITEM 6. REMOVE TAPE HOLDING WIRES AND ANY
 CEMENT SECURING WIRES TO HEAD. CLEAN OUT
 CASE TO PREPARE FOR INSERTING NEW ITEM 6.

- PASS LEADWIRES UNDER BAND OF SHOCKMOUNT. SOLDER WHITE LEAD TO TERMI-NAL WITH SPOT. COVER LEADS AT POINT JUST BELOW TERMINAL WITH CYCOLAC CEMENT. INSTALL HEAD ASSEMBLY INTO CASE WITH BLUE BARKER CEMENT. HOLD ASSEMBLY TO SCREEN USING WEIGHT OR TACK IN PLACE WITH SUPERGLUE WHILE BLUE BARKER DRIES.
- 3. REASSEMBLE SCREEN
- IF REPLACING SCREWS ON BAIL APPLY THREAD LOCKER TO SCREW AND NUT BEFORE ASSEM-BLING.

#### DISASSEMBLY INSTRUCTIONS

#### TOOLS REQUIRED:

LOW WATT SOLDERING IRON
SMALL SCREWDRIVER
SHARP KNIFE (X-ACTO OR EQUAL)
NEEDLE NOSE PLIERS
METHYL-ETHYL-KETONE SOLVENT
BLUE BARKER CEMENT

- REMOVE ITEM 7 BY GRASPING NEAR TOP EDGE AND TWISTING OFF.
- LOOSEN SCREW HOLDING ITEM 6. PULL OUT INSERT USING PLIERS. UNSOLDER LEADWIRES FROM CIRCUIT BOARD.
- 3. UNSCREW FRONT SCREEN ASSEMBLY OF ITEM 1. REMOVE ITEM 4. OLDER UNITS WILL REQUIRE THE SHOCK MOUNT TO BE CUT OUT USING SHARP KNIFE. NEW UNITS CAN BE REMOVED BY APPLYING A SMALL AMOUNT OF 'MEK' SOLVENT BETWEEN THE BRASS RING AND CASE AND THEN PRIED OUT. CLEAN OUT THE CASE TO PREPARE FOR INSERTING NEW HEAD S/A.

- INSERT ITEM 5 INTO SCREEN ON HANDLE S/A BEING SURE THAT EDGES ARE LOCKED UNDER LIP OF THE CASE (THIS IS ONLY DONE IF ITEM 5 NEEDS REPLACEMENT). REPEAT FOR ITEM 3 IF NECESSARY INTO TOP SCREEN.
- 5. PASS LEADWIRES THROUGH STUD IN HANDLE
  AND SOLDER BLACK WIRE TO PAD ON ITEM 8
  WHICH IS MARKED WITH NUMBER 3. SOLDER RED
  WIRE TO PAD ON ITEM 8 WHICH IS MARKED WITH
  NUMBER 2. IF OLDER STYLE UNIT, ITEM 8 NEEDS
  TO BE SOLDERED TO ITEM 6.
- 6. CEMENT ITEM 4 TO ITEM 1 USING A SMALL
  AMOUNT OF BLUE BARKER CEMENT.
  REASSEMBLE TOP SCREEN TO HANDLE. GENTLY
  PULL SLACK OF LEADWIRES THROUGH HANDLE
  AND ATTACH ITEM 6 TO HANDLE. SLIDE ITEM 7
  ONTO HANDLE. NOTE IF INSTALLING NEW
  HANDGRIP WITH NOTCH IN CONNECTOR END
  THAT THE NOTCH IS TO BE ALIGNED WITH SCREW
  ON THE INSERT.

