3-phase motor driver BA6463FP-Y

The BA6463FP-Y is a motor driver developed for cylinders, which a constant power supply of 5V, and the start and stop pins which opens output are incorporated.


Applications

VCR cylinder motors

Features

- 1) 3-phase, full-wave, pseudo-linear drive system.
- 2) Internal constant voltage power supply. (5V)
- 3) Internal thermal shutdown circuit.

Block diagram

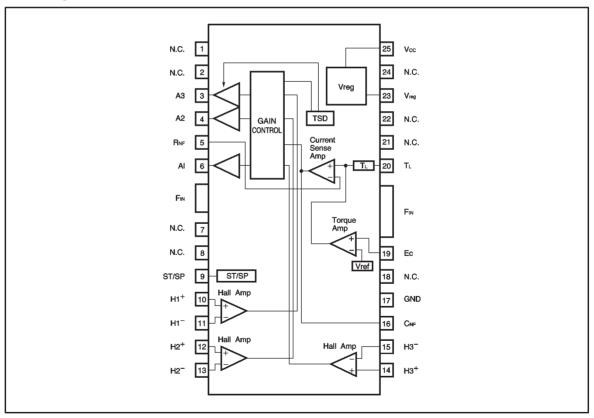

● Absolute maximum ratings (Ta = 25°C)

Parameter	Symbol	Limits	Unit
Power supply voltage	Vcc	24	V
Power dissipation	Pd	1450*1	mW
Operating temperature	Topr	−20~ +75	င
Storage temperature	Tstg	−55∼+150	င
Output current	Іоит	1000*2	mA

^{*1} When mounted on a glass epoxy board (90×50×1.6 mm). Reduced by 11.6 mW for each increase in Ta of 1°C over 25°C.

● Recommended operating conditions (Ta = 25°C)

Parameter	Symbol	Min.	Тур.	Max.	Unit
Operating power supply voltage	Vcc	8.0	_	20.0	٧

●Electrical characteristics (unless otherwise noted, Ta = 25°C, Vcc = 12V)

Parameter	Symbol	Min.	Тур.	Max.	Unit	Conditions
Supply current	Icc	_	5.0	10.0	mA	
Constant output voltage	Vreg	4.5	5.0	5.5	٧	
⟨MDA⟩						
Hall input bias current	Івн	_	0.25	5.0	μA	H ⁺ =High, H ⁻ =Low or H =Low, H ⁻ =High
Hall common-mode input voltage	V _{НВ}	1.5	_	V _{reg-1.0}	٧	
Hall element minimum input level	VINH	60	_	_	mV _{P-P}	
Allowable torque command input voltage	Ec	0	_	V _{reg}	٧	
Torque control voltage offset	Ecofs	-150	0	+150	mV	For Ec=V _{reg} ×0.46
Output idle voltage	Ecidle	_	0	10	mV	Ec=2V, R _{NF} =0.5 Ω
I / O gain	GEC	0.41	0.5	0.59	A/V	Measured at Ec= 2.8V, 3.3V; R _{NF} = 0.5 Ω
Start / stop ON voltage	Vs/s ON	3.5	_	V _{reg}	٧	
Start / stop OFF voltage	Vs/s OFF	0	-	1.2	٧	
Output saturation high level voltage	Vон	_	1.05	1.75	٧	lo=600mA
Output saturation low level voltage	Vol	_	0.45	1.05	٧	lo=600mA
Output drive current capacity	lo (Max.)	800	-	-	mA	R _{NF} =0.5Ω *Tj=25°C
Torque limit current	lτ∟	520	650	780	mA	TL=0.4V, Rn==0.5 Ω

^{*2} Should not exceed Pd or ASO values.

●Pin descriptions

Pin No.	Pin name	Function
1	N.C.	Not used
2	N.C.	Not used
3	Аз	Output
4	A 2	Output
5	Rnf	Output current sensing
6	A 1	Output
7	N.C.	Not used
8	N.C.	Not used
9	ST/SP	Start/stop switching
10	H ₁ +	Hall signal input
11	H ₁ -	Hall signal input
12	H₂ ⁺	Hall signal input
13	H2	Hall signal input
14	H₃ ⁺	Hall signal input
15	H₃ [–]	Hall signal input
16	Cnf	Capacitor connection pin for phase compensation
17	GND	GND
18	N.C.	Not used
19	Ec	Output current control
20	TL	Torque limit
21	N.C.	Not used
22	N.C.	Not used
23	V _{reg}	Internal constant voltage
24	N.C.	Not used
25	Vcc	Power supply
FIN	FIN	Be sure to connect this radiation fin to the ground.




●Input/output circuits

Pin No.	Pin name	Pin description	I/O equivalent circuit
9	ST/SP	Start / stop switching pin	10kΩ \$
20	TL	Torque limit pin	1κΩ
19	Ec	Output current control pin	1kΩ 1kΩ 1kΩ 1kΩ 1kΩ 1kΩ 1kΩ 1kΩ
3, 4, 6	Аз, Аг, Аз	Output pin	RINF
10, 11, 12, 13, 14, 15	H ₁ ⁺ , H ₁ ⁻ , H ₂ ⁺ , H ₂ ⁻ , H ₃ ⁺ , H ₃ ⁻	Hall signal input pin	1kû 1kû 1kû 18

Circuit operation

(1) Hall I/O

The 3-phase Hall signal is amplified in the hall amplifiers and sent to the matrix circuit, where the signal is further amplified and combined. After the signal is converted to a current in the amplitude control circuit, the current is supplied to the output driver, which then provides a motor drive current. The phases of the Hall input signal, output voltage, and output current are shown in Fig. 1.

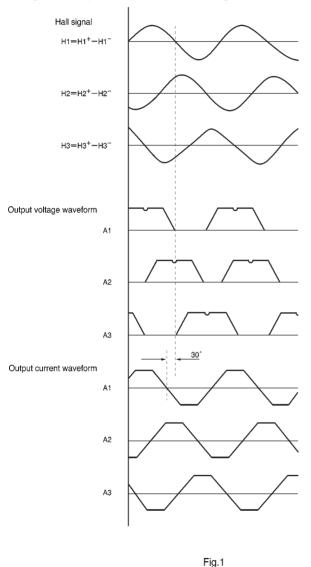

(2) Torque control pin (EC pin)

The output current can be controlled by adjusting the voltage applied to the torque control pin.




Fig.2 B) Start/stop pin

The motor is in the run mode when the pin input voltage is 3.5V or more and in the standby mode (all output transistors are off) when the voltage is 1.2V or less.

(4) Power ground pin (RNF pin)

The R_{NF} pin is the output stage ground pin. Connect a resistor (0.5 Ω recommended) between this pin and the ground to monitor the output current.

(5) Phase compensation pin (CNF pin)

Connect a capacitor between this pin and V_{CC} if the output tends to oscillate.

Application example


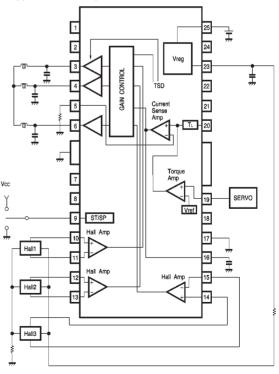


Fig.3

Operation notes

(1) Start/stop pin

The I/O equivalent circuit of the start/stop pin is shown in Fig. 4. The pin has a temperature dependence of -7mV/C, and its resistance can vary \pm 30%. The voltage on this pin should be less than Vreg.



(2) Hall input

The I/O equivalent circuit of the Hall input pins is shown in Fig. 5. The Hall devices can be connected in either series or parallel. The input Hall signal should be within the range of the Hall input common-mode voltage.




Fig.5

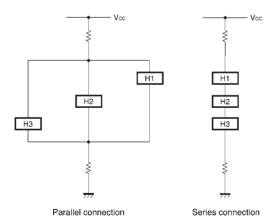


Fig.6

(3) Torque limit pin

The output current can be limited by applying a voltage to the torque limit pin. Control is provided so that this pin will have the same potential as the power ground pin (R_{NF}). Note that there is a voltage offset on this pin. The R_{NF}-pin voltage is 0.325V when the TL-pin voltage is 0.4V (typical) and the R_{NF}-pin resistance is 0.5 Ω . Note that the voltage offset changes with the R_{NF}-pin resistance. Connect the TL Vreg (pin 23) when the TL pin is not used.




Fig.7

(4) Thermal shutdown circuit

The thermal shutdown circuit puts the driver outputs (A_1 , A_2 , and A_3) to the open state at the temperature of 175°C (typical). The circuit is deactivated when the temperature drops to about 150°C.



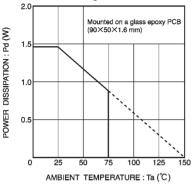


Fig.8

Electrical characteristic curves

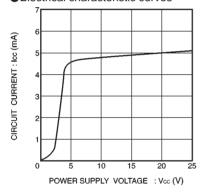


Fig.9 Supply current vs. power supply voltage

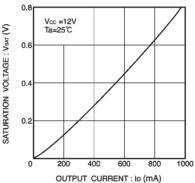


Fig.10 Low-side output saturation voltage vs. output current

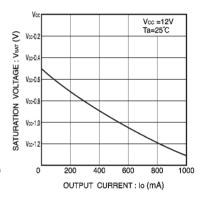


Fig.11 High-side output saturation voltage vs. output current

External dimensions (Units: mm)

